


TECHNICAL CHEMISTS' HANDBOOK

LUNGE

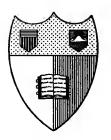

New York State College of Agriculture At Cornell University Ithaca, N. P.

Library

Cornell University Library TP 151.L96

Technical chemists' handbook. Tables and


3 1924 003 620 006

manı



The original of this book is in the Cornell University Library.

There are no known copyright restrictions in the United States on the use of the text.

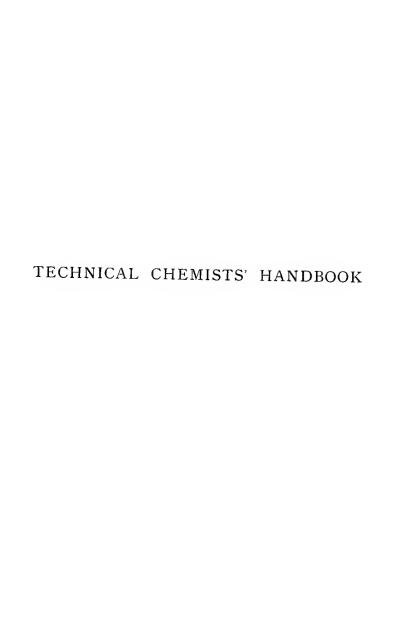

TECHNICAL CHEMISTS' HANDBOOK

TABLES AND METHODS OF ANALYSIS FOR MANUFACTURERS OF INORGANIC CHEMICAL PRODUCTS

BY GEORGE LUNGE, Ph.D.

PROFESSOR EMERITUS OF TECHNICAL CHEMISTRY IN THE FEDERAL TECHNICAL UNIVERSITY, ZÜRICH

HONORARY AND FOREIGN MEMBER OF THE CHEMICAL SOCIETY, LONDON, AND OF
THE AMERICAN CHEMICAL SOCIETY
DR.ING.(H.C.) OF KARLSRUHE, ETC., ETC.

SECOND EDITION, REVISED



NEW YORK D. VAN NOSTRAND COMPANY TWENTY-FIVE PARK PLACE

PREFACE

THE aim of *The Technical Chemists' Handbook* is to effect, as far as possible, the task of establishing uniformity among practical chemists, buyers and sellers, and analysts, in regard to both the numerical data employed in their work and the analytical methods used for the control of processes, and for the testing of the resulting products.

In the preparation of this new edition, all the analytical factors have been recalculated on the basis of the atomic weights published by the International Committee for 1916. This has involved in exceedingly numerous cases changes of the data contained in the last edition, some of them of importance even for merely practical purposes. The tables of specific gravities and other tables have been selected from among the most recent and reliable determinations.

In regard to the analytical methods, they are again chosen as before, on the principle that, as a rule, only one method should be given for each analytical operation, as well as for the preparation of standard solutions and for sampling the materials, in order to avoid discrepancies such as might arise should two or more methods be described. The method chosen should always, of course, be that which permits the greatest degree of accuracy possible that can be attained in a well-appointed works laboratory by a properly trained chemist. In cases where there is a choice between equally accurate methods, that occupying least time or least apparatus, or which is already widely known and employed, has been preferred. Many new methods have accordingly had to be omitted, but in all cases such omissions have

been justified by means of a careful examination of the relative merits of the processes under consideration, and only such methods as were found thoroughly reliable have been included. Also, a considerable number of tables of specific gravities of solutions not previously worked out, or which were unsatisfactory, have been very carefully checked and extended.

When necessary, reference is made to the more complete treatment of the subject matter in my larger treatise, published with the co-operation of Dr Charles A. Keane, under the title *Technical Methods of Chemical Analysis*, in three volumes of two parts each, in 1908-1914. This treatise is referred to in the text as *Tech. Meth.*

THE AUTHOR.

ZÜRICH, Jan. 1916.

CONTENTS

GENERAL TABLES

PAGE

Note	on Temperatures and Atomic Weights	. 2
Table	s 1. Internstional Atomic Weights	. 3
,,	2. Symbols, Molecular Weights, and Percentage Composition of Con	a -
	pounds which are important in the Inorganic Chemical Industrie	es
	and in Technical Analysis	. 4
,,	3. Factors for calculating Gravimetric Analyses	. 12
1)	4. Density and Litre Weights of Gases and Vapours	. 14
37	5. Calculation of the c.c. read off in Gas-volumetric Analysis to mill	
	grams of the substance required	. 15
,,	6. Solubility of Salts	. 16
,,	7. Solubility of other Salts at various Temperatures .	. 17
33	8. Solubility of Gases in Water	. 18
11	9. Specific Gravities of Solids	22
,,	10. Weight of Substances as Stored	. 24
,,	II. Specific Gravity of Liquids	. 25
22	12. Specific Gravity and Percentage of Saturated Solutions .	. 25
,,	18. Linear Expansion of Substances	26
72	14. Comparison of Thermometric Scales	. 27
	A. Celsius (Centigrade) Degrees as Units	. 27
	B. Fahrenheit Degrees as Units	. 28
23	15. Conversion of Centigrade into Fahrenheit Degrees above 100, an	d
	vice versa	. 29
,,	16. Melting Points (Freezing Points)	. 30
11	17. Freezing Mixtures	32
91	I8. Boiling Points	33
27	19. High Temperatures as measured with Le Chatelier's Pyrometer	. 35
,,	20. I. Reduction of the Volume of Gases to a Temperature of 0° C.	36
	 Reduction of the Volume of Gases to a Pressure of 760 mm. 	. 42
,,	21. Factors for reducing a given Volume of Gas to Normal Temperatur	e
	and Pressure	. 48
23	21a. Volumes of Water at different Temperatures	51
22	22. Reduction of Water Pressure to Mercurial Pressure .	51
,,	23. Tension of Aqueous Vapour between -20 and +II8° C.	52
,,	24. Tension of Aqueous Vapour for Temperatures above +40° C	. 53
,,	25. Tension of Aqusous Vapour in Inches of Mercury from I° to 100° F.	. 55
,,	26. Boiling Point of Water at different Barometric Pressures .	57
21	27. Specific Heats:—	
	(a) Of Solids and Liquids; (b) of Gases and Vapours .	57
1)	28. Hesting Effects:	
	(a) Definitions; (b) of Fuele; (c) of Gases	. 58
	ix	

		PAGE
Table	29. Air Compression	59
,,	30. Explosive Mixtures of Gases and Air	60
2.5	31. Properties of the Liquefied Gases found in Commerce	61
,,	32. Electrical Units	69
,,	33. Electro-chemical Equivalents	62
19	34. Mathematical Tables: Circumference and Area of Circles, Squares,	
	Cubes, Square and Cube Roots	65
1,	35. Formulæ for Mensaration of Areas and Solid Contents .	77
19	36. Weights and Measures of different Countries .	79
,,	37. Reducing English to Metrical Weights and Measures, and vice versa	8
"	33. Weight of Sheet Metals .	81
"	39. Coinage of different Countries	88
	SPECIAL PART	
1. Fo	EL AND FURNACES:	
	A. Fuel1. Moisture; 2. Residual Coke; 3. Ash	98
	4. Snlphur	94
	5. Calorific Power	98
	B. Furnaces.—1. Chimney Gases; Orsat Apparatus	98
	Checking the Working of Furnaces	9
	2. Gas from Producers (Generators)	9
	Estimation of Hydrogen by the Orsat-Lunge Apparatus.	98
	3. Speed of Draught; Fletcher's Anemometer	99
	Tables for using this .	100
	Seger's Differential Anemometer	103
	C. Temperature.—Pyrometers	10:
	Le Chatelier's Pyrometer	103
	Pyrometers for the Highest Temperatures	104
	D. Feed-water for Steam-Boilers, etc.	10-
	1. Hardness.—(a) Temporary .	10
	(b) Total; (c) Residue on Evaporation	10
	Estimation of the Reagents required for Purifying Water	10
11. 80	A. Brimstone.—1. Moisture; 2. Bituminous Substances; 3. Ashes	100
	4. Arseuic	10
	5. Direct Estimation of Sulphur	10
	Specific Gravities of Solutions of Sulphur in Carhon Disulphide.	10
	6. Selenium; 7. Degree of Fineness	10
	B. Spent Oxide of Gas-works. See "Coal-Gas" (p. 222)	108
	C. Pyrites1. Moisture; 2. Sulphur	10
	3. Copper.	10
	4. Lead; 5. Zinc	110
	6. Carbonates; 7. Arsenic	113
	D. Burnt Pyrites (Cinders)1. Sulphur	113
	2. Copper; 3. Iron	11:
	E. Zin: Blende1. Total Sulphur; 2. Zinc	11:
	3. Lead; 4. Lime and Magnesia; 5. Arsenic.	114
	6. Carhonic Dioxide; 7. Available Sulphur	114
	F. Cinders from Blende.—1. Sulphur.	114
	2. Zinc .	113

II. SULPHURIC ACID MANUFACTURE—Continued:—		PAGE
G. Gases: (I.) Chamber Process1. Burner Gases: (a) Estima	tion of	
SO ₂ by Reich's Test		115
(b) Total Acids		116
 Chamber Gases Chamber Exit Gases: (a) Oxygen; (b) Sulphur and N 		116
Acids	inogen	117
(c) Nitric Oxide		119
(II.) Contact Process.—1. The Entering Gases; 2. The Ca	talysed	119
Gasee		119
H. Sulphuric Acid		120
I. Specific Gravities of Sulphuric Acid; General Remarks		120
Tables Specific Gravity of Sulphuric Acid at 60° F.		121
2. Table for reducing the Specific Gravities of Sulphuric	Acid to	200
any other Temperature		126
 Specific Gravities of Commercial Nordhausen Oil of Vitr Specific Gravities and Percentage of Fuming Nordhau 		180
of Vitriol at different Temperatures		181
Freezing and Melting Points of Sulphuric Acid .		132
6. Boiling Points of Sulphuric Acid .		132
7. Fusing Points of Nordhausen Oil of Vitriol	•	133
8. Percentage of SO ₃ in Nordhausen Oil of Vitriol .		134
9. The Quantitative Estimation of Free Sulphuric Acid		185
10. Examination of Sulphuric Acid for other Substances		136
(a) Nitrous Acid (Nitrososulphuric Acid)		135
Table for expressing the Results .	• •	186
(b) Total Nitrogen Acids; Nitrometer		187
Gas-volumeter	•	189
(c) Relative Proportions of the Three Nitrogen Acids	•	142
(d) Qualitative Test for Traces of Nitrogen Acids(e) Selenium; (f) Lead; (g) Iron.	•	142 143
	•	144
(h) Arsenic; (i) Chlorides .11. Analysis of Fuming Sulphuric Acid (Nordhausen Oil of	Withiall	
and of Sulphuric Anhydride	VIULIUI)	144
and of Sulphune Analydrids	•	144
III. SALTCAKE AND HYDROCHLORIC ACID:-		
A. Salt (Common and Rock Salt)		146
1. Moisture; 2. Insoluble; 3. Chlorine		146
4. Lime; 5. Sulphatee; 6. Magnesium Chloride		147
B. Saltcaks (Sulphate of Soda).—1. Free Acid .		147
2. Sodium Chloride; 3. Iron; 4. Residue; 5. Lime; 6. M	Iagnesi a	148
7. Alumina; 8. Sodium Sulphate		148
C. Chimney-Testing.—Act of Parliament		149
Hydrochloric Acid in Chimney Gases		149
D. Testing of the Gases in the Hargreaves' Process .		151
E. Hydrochloric Acid.—Specific Gravities at 15°	•	152
2. Influence of Temperature on the Specific Gravity.		152
3. Analysis of Hydrochloric Acid: (a) Estimation of HCl		153
(b) Of Sulphuric Acid; (c) Iron; (d) Free Chlorina		154
(e) Sulphur Dioxide; (f) Arsenic.		154
(s) puriputit morne, (1) viscuit.	•	104

J٧.	BLEA	ACHING POWDER AND CHLORATE OF POTASH MANUFACTURE:-	PAG	E
	A.	Natural Manganese Ore1. Manganese Dioxide .	15	5
		2. Carbon Dioxide	15	5
		3. Hydrochloric Acid required for Decomposing the Ore	15	6
	В.	Recovered Mungunese Mud and Weldon Liquors .	15	6
		1. MnO_2 in Weldon Mnd; 2. Total Manganese of the Mud.	15	6
		Estimation of the Base (the Monoxides)	15	7
	C.	Limestone.—1. Insoluble; 2. Lime .	15	7
		3. Magnesia; 4. Iron	15	S
	D.	Quicklime1. Free CaO; 2. Carbon Dioxide .	15	8
	Ε.	Sinked Lime.—1. Water; 2. Carbon Dioxide; 3. Specific Gravi Amount of Lime in Milk of Lime	ties 169 159	
	F.	Bleaching Powder.—1. Available Chlorine	. 15	9
		2. Comparison of the Percentages with the French (Gay-L Degrees		
		3. Carbon Dioxide, Lunge and Rittener's Process	16	
		4. Testing the Atmosphere of the Chambers before opening t	hem . 16	1
	G.	Deacon Process 1. Proportion of HCl and Cl in the Gases .	16	2
		2. Carbon Dioxide	16	2
		3. Steam	16:	3
	H.	Electrolytic Chlorine.—Examination for CO ₂	16	3
	I.	Chlorate of Potash	16	4
		 Chlorate Liquors: (a) Chlorate; (b) Chloride 	16	1
		2. Commercial Chlorate of Potash .	16	1
	к.	Bleach Liquors	164	1
	L.	Liquid Chlorine.—Pressure and Specific Gravities .	16	5
v.	Soda	ASH MANUFACTURE BY THE LEBLANC PROCESS:		
	A.	Raw Materials	. 160	
		1. Saltcake; 2. Limestone or Chalk; 3. Mixing Coal .	16	6
	в.	Black-Ash	160	3
		1. Teets made with the Muddy Mixture:-		_
		(a) Free Lime	. 166	-
		2. Tests made with the Clear Portion:—	10	ſ
		(a) Available Alkali and Sodium Carbonate	16	7
		(b) Caustic Soda	16	
		(c) Sulphide; (d) Chloride.	. 168	8
		(e) Sulphate; (f) Carbonated Sample	168	8
	C.	Tunk Waste (Vat Waste).—1. Available Soda	168	3
		2. Total Soda; 3. Total and Oxidisable Sulphur	169	J
	D.	Tank Liquor (Vat Liquor)1. Sodium Carbonate	169	9
		2. Hydrate; 3. Snlphide	169	
		4. Sulphate; 5. Total Sulphur.	170	
		6. Chloride; 7. Ferrocysnide .	170	
		S. Silica, Alumina, and Ferric Oxide 9. Carbonated Sample	. 170 171	
	177	-	. 17	
	Ei.	Curbonated Liquor.—Test for Bicarbonate Lunge and Rittener's Process for estimating CO ₂ .	17	
	173	Mother Liquor.—(a) Sulphste; (b) Other Compounds of Sulphste	-	
	ъ.	moster refund (a) partitions, (a) Const compounds of partition	44 16	υ


V. Soda Ash Manufacture by the Leblanc Process-Continued:-	PAOE
G. Tables of Specific Gravities :—	
 Specific Gravities of Solutions of Sodium Carbonate at 15 Specific Gravities of Concentrated Solutions of Sodium Car 	
at 30° C	. 175 Intlone
of Sodium Carhonate	176
H. Analysis of Commercial Soda Ash	. 178
Table for comparing French, German, and English Comp	nercial
Alkalimetrical Degrees .	. 180
I. Sulphur Recovery (Chance Process)	. 182
1. Snlphur as Sulphide in Vat Waste	182
 Sulphur as Sulphide in Carbonated Mud 	. 182
3. Sulphide-Sulphur+CO2 in Vat Waste .	182
4. Sulphur in Solutions	183
5. Soda, Lime, and Thiosulphate in Liquors .	188
6. Lime-kiln Gases	183
7. Gas from Gas-holder	. 184
8. Exit Gases from Claus Kilns	. 184
VI. MANOFACTURE OF SODA BY THE AMMONIA PROCESS:-	
A. Raw Materials1. Rock Salt; 2. Brine	. 186
3. Gas Liquor or Sulphate of Ammonia	. 185
4. Limestone: 5. Quicklime: 6. Coale or Coke	185
B. Tests made during the Manufacturing Process:	
1. Ammoniacal Brine: (a) Chloride	. 185
(b) Ammonia, Free and Combined	. 186
2. Carbonators; 3. Mother Liquor; 4. Crude Bicarbonate	
5. Distillation of Ammonia; 6. Lime-kiln Gases .	186
C. Commercial Products.—1. Soda Ash; 2. Commercial Bicarbon	
Or committee to the second of	. 100
VII. CAUSTIC SODA:—	
A. Caustic Liquor.—(a) Available Alkali	186
(b) Table of Specific Gravities of Sodium Hydroxide at 15° (
(c) Influence of Temperature on the Specific Gravities of	Caustic
B. Lime Mud.—(a) Sodium as Carbonated Hydrate	. 190 192
(b) Caustic Lime; (c) Calcium Carbonate	192
C. Fished Salts; D. Caustic Bottoms	192
E. Commercial Caustic Soda	192
11. Commercut Caustic Sout	, . 195
VIII. ELECTROLYTIC ALKALINE LIQUORS:—	
1. Hypochlorites; 2. Free Hypochlorous Acid; 3. Chlorate	193
4. Chloride; 5. Carbon Dioxide; 6. Bases; 7. Free Alkali	194
1X. NITRIC ACID MANUFACTURE:-	
A. Commercial Nitrate of Soda:—	
General Remarks; Refraction; Sampling	195
1. Moisture; 2. Insoluble; 3. Sodium Nitrate .	. 195
4. Sulphate; 5. Chloride; 6. Iodine	196
7. Potaseium; 8. Perchlorate	. 197
B. Nitre-Cake1. Free Acid; 2. Nitric Acid .	. 197
3. Ferric Oxide and Alumina	197

IX. NITRIC ACID MANUFACTURE—Continued:—	PACE
C. Nitric Acid1. Specific Gravity of Nitric Acid at 15° C.	. 198
2. Influence of Temperature on the Specific Gravity of Nitric	
3. Total Acidity; 4. Chlorine; 5. Sulphuric Acid .	. 203
6. Nitrons Acid or Nitrogen Tetroxide; 7. Fixed Residue.	203
8. Iron; 9. Iodine	203
D. Mixtures of Sulphuric Acid and Nitric Acid.—1. Total Acidity	203
2. Nitrons Acid; 3. Nitrogen Acids; 4. Salpharic Acid.	204
2. Microus Acid, 5. Microgen Acids, 4. Surplining Acid .	204
X. Potassium Salts:-	
A. Crude Salts (Carnallite, Kainite, etc.)	. 205
1. Moisture	. 205
2. Percentage of Potassium:	
(α) In the Absence of more than 0.5% Potassium Sulphate	. 205
(b) In the Presence of more than 0.5% Potassium Sulphate	
3. Percentage of Sodium Chloride; 4. Magnesium Chloride	206
5. Total Magnesinm	207
B. Commercial Potassium Chloride	. 207
C. Potassium Sulphate	207
D. Leblanc Process for the Manufacture of Potassium Carbonate	207
E. Beet Ashes	. 207
F. Commercial Carbonate of Potash	207
G. Tables:—	201
1. Specific Gravities of Solutions of Potassiom Carbonate at 1	5° . 209
2. Influence of Temperature on the Specific Gravities .	. 212
3. Specific Gravity of Solutions of Potaseium Hydroxide	
5. Specific Gravity of Solutions of Potassium Hydroxide .	. 214
XI. Ammonia Manufacture:	
A. Gas-Liquor.—1. Volatile Ammonia; 2. Total Ammonia; 3.	
Salphur	. 217
4. Thiocyanate	. 218
B. Sulphate of Ammonia.—Estimation of Ammonia.	. 219
C. Liquor Ammonia	. 220
1. Specific Gravities of Solutions of Ammonia	. 221
2. Specific Gravities of Solutions of Ammonium Carbonate.	. 222
XII. MANUFACTURE OF COAL-GAS (ILLUMINATING GAS):-	
· · · · · · · · · · · · · · · · · · ·	
A. Coal-Gas.—Apparatus; Notes on the Bunte Borette	222
Taking Samples; Measuring the Gas in the Burette	223
Introduction of the Absorbing Liquids	224
1. Carbon Dioxide; 2. Heavy Hydrocarbons.	. 224
3. Oxygen; 4. Carbon Monoxide	. 224
5. Hydrogen	. 225
6. Methane; 7. Nitrogen	. 226
B. Purifying Material (Spent Oxide).—1. Cyanogen; 2. Sulphur .	. 227
XIII. CALCIUM CARBIDE AND ACETYLENE:-	
A. Raw Materials; B. Technical Calcium Carbide .	000
A. Itan Materials; B. Lechnicas Caterum Caronal .	. 228
XIV. Examination of the Raw Materials and Products of the M	ANU-
FACTURE OF FERTILISERS:—	
A. Sampling; B. Moisture	229

XIV.	Examination of the Raw Materials, Eto Continued :-	PAGI
	C. The Insoluble Matter; D. Phosphoric Acid	. 230
	1. Preparation of the Solutions	. 236
	(a) Phosphates Soluble in Water	. 236
	(b) Phosphates Soluble in Ammonium Citrate	230
	(c) Total Phosphoric Acid	23
	(d) Thomas-Slag Phosphatea	230
	2. Examination of the Solutions: For Phosphoric Acid	23
	(a) Molybdenum Method; (b) Citrate Method	23
	E. Free Acid; F. Ferric Oxide and Alumina	235
	G. Nitrogen.—1. Nitric Nitrogen; 2. Ammoniacal Nitrogen	231
	3. Total Nitrogen	233
	4. Organic Nitrogen	238
	H. Potash .	. 234
		. 20.
XV.	ALUMINA PREPARATIONS:—	
	A. Raw Materials.—1. Kaolin (China Clay); 2. Bauxite .	234
	B. Control of Working Conditions	238
	C. Commercial Products.—1. Sulphate of Alumius and Alum	231
	(a) Estimation of Alumina	23
	(b) Iron, Lunge and Kéler's Method .	23
	(c) Free Aoid; (d) Zinc	. 237
	 Aluminate of Soda: (α) Soda and Alumina 	. 23
	(b) Insoluble; (c) Silica .	. 237
	3. Commercial Alumins	237
XVI.	. CEMENT INDUSTRY:-	
	A. Portland Cement1. Raw Materials. (a) Limestone; (b) Clay	. 23
	Complete Analysis:—	
	1. Decomposing by means of Alkaline Carbonate .	231
	2. Alkaliea; 3. Sulphur	. 239
	4. Carbon Dioxide; 5. Loss of Weight on Ignition .	. 239
	(c) Separation of Silica present as Quartz, and such present in the	
	form of Silicates	239
	Process of Lunge and Milharg	239
	2. Control of Working Conditions	240
	3. Commercial Cement.—(a) Silica; (b) Alumina+Ferric Oxide	. 240
	(c) Ferric Oxide	240
	(d) Lime; (e) Magnesia; (f) Sulphatea	. 240
	(g) Total Sulphur; (h) Alkalies; (i) Physical Testa .	. 24
	B. Hydraulic Lime and Roman Cement	. 24]
	C. Puzzuolanas, Trass, Granulated Blast-Furnace Slag .	. 24
	The second of Street and Secondary	
X V 11.	PREPARATION OF STANDARD SOLUTIONS:— Introductory	. 24
		. 24:
	A. Normal Acid and Alkali	. 24
	Indicatora .	. 24
	Standard Alkali	. 246
	Corrections for Temperature	
	B. Potassium Permanganate	. 246
	C. Iodine Solution; Starch Solution	
	D. Sodium Arsenite Solution; E. Silver Solution .	248
	F. Copper Solution; G. Oxalic Acid Solution	249

CONTENTS

XVIII. Rules for Sampling: A. Fuel B. Ores and Minerals (Pyrites, Manganese, Salt, etc.) (a) Smalls, Slack, Salt, or other Substances not requiring to be Crushed (b) Ores in Pieces requiring to be Crushed C. Chemicals.—Saltcake, Soda Ash; Bleaching Powder Caustic Soda; Solid Sulphuric Anhydride XIX. Comparison of the Hydrometer Deorges according to Baumé and Twaddell, with the Specific Gravities XX. Value of Alkali per Ton Index		PAGE
B. Ores and Minerals (Pyrites, Manganese, Salt, etc.) (a) Smalls, Slack, Salt, or other Substances not requiring to be Crushed (b) Ores in Pieces requiring to be Crushed C. Chemicals.—Saltcake, Soda Ash; Bleaching Powder Caustie Soda; Solid Sulphuric Anhydride XIX. Comparison of the Hydrometer Deorges according to Baumé And Twaddell, with the Specific Gravities XX. Value of Alkali per Ton	XVIII. RULES FOR SAMPLING:	249
(a) Smalls, Slack, Salt, or other Substances not requiring to be Crushed (b) Ores in Pieces requiring to be Crushed C. Chemicals.—Saltcake, Soda Ash; Bleaching Powder Caustic Soda; Solid Sulphuric Anhydride XIX. Comparison of the Hydrometer Deorres according to Baumé And Twaddell, with the Specific Gravities XX. Value of Alkali per Ton	A. Fuel	249
Crushed (b) Ores in Pieces requiring to be Crushed C. Chemicals.—Saltcake, Soda Ash; Bleaching Powder Caustic Soda; Solid Sulphuric Anhydride XIX. Comparison of the Hydrometer Degrees according to Baumé AND Twaddell, with the Specific Gravities XX. Value of Alkali per Ton	B. Ores and Minerals (Pyrites, Manganese, Salt, etc.) .	249
(b) Ores in Pieces requiring to be Crushed . C. Chemicals.—Saltcake, Soda Ash; Bleaching Powder . Caustic Soda; Solid Sulphuric Anhydride . XIX. Comparison of the Hydrometer Deorees according to Baumé And Twaddell, with the Specific Gravities . XX. Value of Alkali per Ton	(a) Smalls, Slack, Salt, or other Snbstances not requiring to be	
C. Chemicals.—Saltcake, Soda Ash; Bleaching Powder Caustic Soda; Solid Sulphuric Anhydride XIX. Comparison of the Hydrometer Deoress according to Baumé And Twaddell, with the Specific Gravities XX. Value of Alkali per Ton	Crushed	249
Caustic Soda; Solid Sulphuric Anhydride	(b) Ores in Pieces requiring to be Crushed	250
XIX. COMPARISON OF THE HYDROMETER DEGREES ACCORDING TO BAUMÉ AND TWADDELL, WITH THE SPECIFIC GRAVITIES	C. Chemicals.—Saltcake, Soda Ash; Bleaching Powder	251
AND TWADDELL, WITH THE SPECIFIC GRAVITIES XX. VALUE OF ALKALI PER TON	Caustic Soda; Solid Sulphuric Anhydride	252
XX. VALUE OF ALKALI PER TON	XIX. COMPARISON OF THE HYDROMETER DEGREES ACCORDING TO BAUMÉ	
	AND TWADDELL, WITH THE SPECIFIC GRAVITIES	253
Index .	XX. VALUE OF ALKALI PER TON	255
	NDEX .	259



NOTE

ALL temperatures are given in degrees Centigrade, unless otherwise stated.

The atomic weights are those adopted by the International Committee on Atomic Weights for the year 1916, as given in Table No. 1 referred to. Oxygen = 16.

TABLE 1.—INTERNATIONAL ATOMIC WEIGHTS

According to the Table issued by the International Committee on Atomic Weights for 1916.

	 	ı i	· · · · · · · · · · · · · · · · · · ·	_		
Aluminium .	Al	27.1	Neodymium		Nd	144.3
Antimony .	Sb	120.2	Neon	.	Ne	20.2
Argon	Ar	39.88	Nickel .		Ni	58.68
Arsenic .	As	74.96	Niobium .		Nb	93.5
Barium .	Ba	137:37	Niton		Nt	222.4
Beryllium .	Be	9.1	Nitrogen .		N	14.01
Bismuth .	Bi	208.0	Osmium .		Os	190.9
Boron	В	11.0	Oxygen .		0	16.00
Bromine .	Br	79.92	Palladium .		Pd	106.7
Cadmium .	Cd	112.40	Phosphorus.		P	31.04
Cæsium .	Cs	132.81	Platinum .		Pt	195.2
Calcium .	Ca	40.07	Potassium .		K	39.10
Carbon .	C	12.005	Praseodymium		Pr	140.9
Cerium	Ce	140.25	Radium .		Ra	226.0
Chlorine .	Cl	35.46	Rhodium .	1	Rh	102.9
Chromium .	Cr	52.0	Rubidium .		Rb	85.45
Cobalt	Co	58.97	Ruthenium.		Ru	101.7
Copper .	Cu	63:57	Samarium .		Sm	150.4
Dysprosium	Dy	162.5	Scandium .		Sc	44.1
Erbium .	Er	167.7	Selenium .		Se	$79 \cdot 2$
Europium .	Eu	152.0	Silicium .		Si	28.3
Fluorine .	F	19.0	Silver		Ag	107.88
Gadolinium	Gd	157.3	Sodium .		Na	23.00
Gallium .	Ga	69.9	Strontium .		Sr	87.63
Germanium	Ge	72.5	Sulphur .		S	32.06
Gold	Au	197-2	Tantalum .		Ta	181.5
Helium .	He	4.0	Tellurium .		Te	127.5
Holmium .	Ho	163.5	Terbium .		Tb	159.2
Hydrogen .	Н	1.008	Thallium .		Tì	204.0
Indium .	In	114.8	Thorium .		Th	232.4
Iodine .	I	126.92	Thulium .		Tu	168.5
Iridium .	Ir	193.1	Tin		Sn	118.7
Iron	Fe	55.84	Titanium .		Ti	48.1
Krypton .	Kr	82.92	Tungsten .		w	184.0
Lantbanum	La	139.0	Uranium .		U	238.2
Lead	Pb	207.20	Vanadium .		v	51.0
Lithium .	Li	6.94	Xenon .		X	130.2
Lutetium .	Lu	175.00	Ytterbium .		Yb	173.5
Magnesium	Mg	24.32	Yttrium .		Y	88.7
Manganese .	Mn	54.93	Zinc		Zn	65.37
Mercury .	Hg	200.6	Zirconium .	.	\mathbf{Zr}	90.6
Molybdenum	Mo	96.0				
	 L					

TABLE 2.—SYMBOLS, MOLECULAR WEIGHTS, AND PERCENTAGE COMPOSITION

Of Compounds which are of importance in the Inorganic Chemical Industries and in Technical Analysis. Note.-The salts are arranged alphabetically according to their cations. The H2O given in the percentage composition includes the water formed by the decomposition of hydrates and of the ammonium-ion.

TABLE 2—Continued.

	Formula.	weight. O=16.	Percentage Composition.
Ammonium phosphate sodium phosphate .	(NH ₄),HPO ₄ . (NH ₄)NaPO ₄ + 4H ₂ O .	132-09 209-15	NH ₃ 25.79; P ₂ O ₅ 53.75; H ₂ O 20.46. NH ₃ 8.14; Na ₂ O 14.85; P ₂ O ₅ 33.95; H ₂ O
platinum chloride .	(NH4)2PtCl6 .	444.00	^{43.06} _{43.767} ; Pt 43.96; Cl 47.92; H ₂ O
sulphate thiocyanate	(NH.),SO,	132.15	0.45, NH ₃ 25.78; SO ₃ 60.59; H ₂ O 13.63. NH ₂ 29.38; H 1.39. CN 34-17; S 40.19
	As_2O_6	229.92	As 65.21; O 34.79.
	As ₂ O ₃	197.92	As 75.75; O 24.25. As 60.91 · S 39.09
	BaÔ	153.37	Ba 89.57; O 10.43.
hydroxide	$Ba(OH)_2$	171.40	BaO 89.49; H2O 10.51.
carbonate	$BaCO_a$ + $8H_2O$	315.51	BaO 48 62; H ₂ O 51 38. BaO 77 71; CO 22:20
	BaCl ₂ + 2H ₂ O.	244.32	BaCl, 85 25; H.O 14.75.
	BaSO⁴	233.44	BaO 65.71; SO3 34.29.
Calcium oxide (lime)		24.00	Ca 71.46; O 28:54.
carbonate		100.02	CaO 56 03 : CO, 43 97.
chlorate	Ca(ClÕ ₃₎₂	206.99	CaO 27-10; Cl.O5 72-90.
chloride	CaCl.	110-99	Ca 36·13; Cl 63·87.
cryst.	$CaCl_2 + 6H_2O$.	219.09	CaCl ₂ 50.66; H ₂ O 49:34.
hypochlorite		142.99	CaO 39-23; Cl 49-58; O 11-9.
prosphate, primary .	$\operatorname{CaH}_{(PO_1)^2}$	234·18 136·12	CaO 23:94; P_2O_5 60:67; H_2O 15:39. CaO 41:19; P_2O_5 52:19; H_2O 6:62.

TABLE 2—Continued.

Molec, weight, Percentage Composition. $O=16$.	Cas(Po ₁) ₂ 130-29 CaO 54-21; P ₂ O ₅ 45-79. CaSO ₄ +2H ₂ O 172-17 CaO 32-67; SO ₃ 68-81. CaSO ₄ +2H ₂ O 172-17 CaO 32-67; SO ₃ 46-11; H ₂ O 20-92. CaS ₂ 200-40 Ca 50-65; S 44-44. CaS ₂ 120-14 Ca 50-65; S 44-44. CaS ₂ 120-14 Ca 50-15; SO ₃ 42-16; S 21-06. CaS ₂ O ₃ 120-14 Ca 20-01; S 79-99. CaS ₂ O ₃ 120-14 Ca 20-01; S 79-99. CaS ₂ O ₃ 120-14 Ca 20-01; S 79-99. CaS ₂ O ₃ 120-14 Ca 20-01; S 79-90. CaS ₂ O ₃ 120-14 Ca 20-01; S 79-90. CaS ₂ O ₃ 120-14 Ca 20-01; S 79-90. CaS ₂ O ₃ 120-14 Ca 20-01; S 79-90. CaS ₂ O ₄ 141-98; O 47-36; H ₂ O 10-67. CaS ₂ 120-14 Ca 141-98; O 47-36; H ₂ O 10-67. CaS ₂ 120-15 Ca 159-16 Ca 159-16. CaS ₂ 120-16 Ca 164-18; S 30-15. CaSO ₄ +5H ₂ O 22-96. CaS ₂ 120-15 Ca 164-18; S 30-15. CaSO ₄ +6H ₂ O 22-96. CaS ₂ 120-15 Ca 167-88; O 30-50; H ₁ O 36-07. CaS ₂ O ₄ 11-92. CaS ₂ O ₄ 11-93. CaS ₂ O ₄ 11-92. CaS ₂ O ₄ 11-93. CaS ₂ O ₄ 11-92. CaS ₂ O ₄ 11-93. CaS ₂ O ₄ 11-93. CaS ₂ O ₄ 11-92. CaS ₂ O ₄ 11-93. CaS ₂ O ₄ 11-93
Compounds.	Calcium phosphate, tertiary . Calcium phosphate (anhydrite) . hydrated (gyp-sum) . csuphide

TABLE 2—Continued.

Compounds.	Formuls.	 Molec. weight. O=16.	Percentage Composition.
Iron chloride (ferric) bisulphide (pyrites) . sulphate (ferrous) .	FeCl ₃ FeS ₂ . FeS ₂ + 7H ₂ O	 162-22 119-98 278-02	Fe 34.42; Cl 65.58. Fe 46.54; S 53.46. Fe 20.09; O 5.76; SO ₃ 28.80; ${\rm H_2O}$
Lead monoxide (litharge) .	. Pb0 Pb ₃ O ₄	 223-10 684-7	
carbonate chloride	PbCO.	 2567-10 278-02 303-17	FbO 53.53; CO ₂ 10 47. Pb 74.49; Cl 25.41. PbO 73:59; SO ₃ 26·41.
sulphate sulphide Sul	PbS MgO MgOH)	 239·17 40·32 58·34	Pb 86·55; S 13·45. Mg 60·34; O 39·66. MgO 69·11; H ₂ O 30·89.
chloride cryst.	MgCl ₂ MgCl ₂ +6H ₂ O	 95·24 203·34	Mg 25·56; Cl 74·44. MgCl ₂ 46·82; H ₂ O 53·18.
carbonate pyrophosphate sulphate, cryst.	$\begin{array}{c} \text{MgCO}_3 \\ \text{Mg}_2\text{P}_2\text{O}_7 \\ \text{MgSO}_4 + 7\text{H}_2\text{O} \end{array}$	 84.32 222.72 246.50	MgO 47.82; CO _{2.527.16} . MgO 36.24; P ₂ O _{5.63.76} . MgO 16.36; SO _{3.32.48} ; H ₂ O _{57.16} .
Manganese protoxide. sesquioxide	MnO	 70.93	Mn 77.44; O 22.56. Mn 69.59; O 30.41. Mn 63.19 · O 36.81.
dioxide	MngO	 228·79 125·85	Mn 72.03; O 27.97. Mn 43.65; Cl 56.35.
sulphate Mercurous chloride	$\left \begin{array}{c} MnSO_4 \\ HgCl \end{array}\right $	 151.00 236.06	MnO 46.97; SO _{3.53} .03. Hg 84.72; Cl 15.28.

TABLE 2.—Continued.

ı——	
Percentage Composition.	Hg 73·83; Cl 26·17.* C 74·86; H 25·14. SO ₃ 63·00; N ₃ O ₃ 29·91; H ₂ O 7·09. N 63·65; O 36·33. N 46·68; O 63·32. N 36·86; O 63·14. N ₂ O ₃ 80·84; H ₂ O 19·16. N ₂ O ₃ 80·84; H ₂ O 19·16. N ₂ O ₅ 80·71; H ₂ O 14·29. P 43·69; O 66·31. P ₂ O ₅ 72·46; H ₂ O 27·56. P ₂ O ₅ 70·77; H ₂ O 20·23. P ₂ O ₅ 70·77; H ₂ O 20·23. P ₃ O ₄ 87·76; H ₂ O 11·35. P ₄ C 68·76; Cl 79·98. K ₂ O 88·94; H ₂ O 16·06. K ₂ O 88·94; H ₂ O 16·06. K ₂ O 88·94; H ₂ O 16·96. K ₂ O 88·94; Cl 28·93; O 32·64. K ₂ O 38·48; Cl 28·93; O 32·64. K ₂ O 88·48; Cl 28·93; O 32·64. K ₂ O 88·48; Cl 28·93; O 32·64.
Molec. weight. O=16.	271 50 16 03 127 09 144 02 30 01 47 02 47 02 47 02 63 02 142 08 80 05 178 11 80 05 98 06 178 11 188 20 188 20 20 20 20 20 20 20 20 20 20 20 20 20 2
Formuls.	HgCl, CH, SO ₂ (OH)(ONO) NO ₂ NO ₂ NO ₂ NO ₃ NO ₃ NO ₃ NO ₃ HgC ₃ HgC ₃ HgC ₃ KGH KGC ₃ KGC ₃
	HECL, CH, COH)(ON N.O. O. H.P.O. H.P
	rososul- rystals) phur. de
Compounds.	Mercuric chloride Methane Nitrosulphonic acid (nitrososul- puburic acid, chamber crystals) Nitrous oxide Nitric oxide Nitric oxide Nitric peroxide (tetroxide) Nitric peroxide (tetroxide) Rentathionic acid, of, Sulphur. Phosphoric pentoxide acid, ortho pyro Ratinum-hydrogen chloride Potassium oxide hydroxide carbonate bicarbonate bichromate chloride chloride chloride chloride chromate chloride chloride
	Mercuric chloride Methane Nitrosulphonic aci phurto acid, cha, Nitrio oxide Nitrio oxide Nitrio paroxide (re acid oxide Nitric peroxide (te acid, o Pentathionic acid, o Platinum-hydroger Potassium oxide oxide Carbona

TABLE 2—Continued.

Compounds.		Formula.		Molec. weight. O=16.	Percentage Composition.
Potassium cyanide ferricyanide . ferrocyanide .		KCN K, Fe(CN), K, Fe(CN),		65·11 329·20 422·35	K 60·05; CN 39·95. K 35·63; Fe 16·97; CN 47·40. K 37·03; Fe 13·22; CN 36·96; H ₂ O
iodide nitrate	• • •	KJ KNO.	• • •	166.12	K 23.55; J 76.45. K ₂ O 46.58; N ₂ O ₅ 53.42.
nitrite permanganate .		KNO KMnO.		85.11 158.03	K_2O 55·34; N_2O_3 44·66. K_2O 29·80; Mn_2O_7 70·20.
phosphate. platinum chloride		$K_{s}HPO_{4}$.		174.25 486.2	$K_2^{\bullet}O$ 54.06; $P_2O_6^{\bullet}$ 40.77; H_2O 5.17. Pt 40.15; Cl 43.76; K 16.09 (KCl 30.67).
silicate sulphate		K,SiO, K,SO,	•	154.50	K2O 60-97; SiO ₂ 39-03. K2O 54-05; SO, 45-95
bisûlphate . sulphide		KHSO.		136.18	K-0 34 59; SO 58 80; H ₂ O 6 61.
sulphite, cryst.		K2SO2+2H2O		194.12	K ₂ O 48 53; SO ₂ 33 01; H ₂ O 18 46.
bisulphite . thiocyanate .		KHSO		120•18 97•18	$ m K_2O~39\cdot19$; $ m SO_2~53\cdot31$; $ m H_2O~7\cdot50$. $ m K~40\cdot23$; $ m CNS~59\cdot77$.
Potash alum	•	KAl(SO ₄) ₂ +12H ₂ O		474.5	K2O 9.93; Al2O, 10.77; SO, 83.75;
Selenious anhydride .	•	SeO ₂ .		111.2	Se 71.22; O 28.78.
Silver bromide		AgBr		187.80	St 47 '02; U 52'98. Ag 57'44: Br 42'56.
chloride	•	AgCI	•	143.34	Ag 75-26; Cl 24-74.
iodide nitrate		AgJ AgNO,	. .	234.80 169.89	Ag 45 95; J 54 05. Ag 63 50; NO. 36 50.

TABLE 2—Continued.

Percentage Composition.	Ag 87·06; S 12·94. ' Ag 65·00; CNS 35·00. Na 74·19; O 25·81. Na ₂ O 64·54; H ₂ O 22·52. Na ₂ O 64·54; Al ₂ O ₃ 85·46. Na ₂ O 87·76; Al ₂ O ₃ 85·64; H ₂ O 47·14. Na ₂ O 16·22; B ₂ O ₃ 86·64; H ₂ O 47·14. Na ₂ O 21·67; CO ₃ 41·51. Na ₂ O 29·12; Cl ₂ O ₅ 70·88. Na ₂ O 29·12; Cl ₂ O ₅ 70·88. Na ₂ O 29·12; Cl ₂ O ₅ 70·88. Na ₂ O 29·12; Cl ₂ O ₅ 70·88. Na ₂ O 22·14; Cl ₂ O ₅ 86·73. Na ₂ O 41·64; Cl ₂ O ₅ 86·73. Na ₂ O 41·64; Cl ₂ O ₅ 86·73. Na ₂ O 41·64; Cl ₂ O ₅ 86·86. Na ₂ O 17·31; P ₂ O ₅ 19·83; H ₂ O 65·86. Na ₂ O 41·64; Sl ₂ O ₅ 85·91. Na ₂ O 17·31; P ₂ O ₅ 19·83; H ₂ O 65·86. Na ₂ O 26·89; SlO ₂ 49·31. Na ₂ O 18·24; SO ₃ 87·85; H ₂ O 65·91. Na ₂ O 26·89; SlO ₂ 49·31. Na ₂ O 26·89; SlO ₂ 49·31. Na ₂ O 26·89; SlO ₂ 49·31. Na ₂ O 26·89; SlO ₂ 87·85; H ₂ O 7·50. Na ₂ O 26·89; SlO ₂ 27·741; H ₂ O 46·00.
Molec. weight. O=16.	247.83 165.96 62.00 62.00 164.10 164.2 382.20 286.16 84.01 106.46 160.0 140.01 74.46 85.01 85.01 85.01 85.01 85.01 74.46 85.01 85.01 74.46 85.01 74.46 85.01 74.00 85.01
Formula.	Ag.S. AgC.NS. Na.O. Na.O. Na.A.NO. Na.A.NO. Na.C.O. Na.H.C.O. Na.C.O. Na.H.C.O. Na.C.O. Na.H.C.O. Na.C.O. Na.H.C.O. Na.H.C.O. Na.H.C.O. Na.H.C.O. Na.H.C.O. Na.S.O.
Compounds.	Silver sulphide thiocyanate

TABLE 2—Continued.

Molec. Percentage Composition. O=16.		64.07 S 50.05 O 43.35. 80-07 S 40.05 O 59.95. 88-09 SO ₂ 81.63; H ₂ O 18.37. H ₂ SO ₄ 55.06; SO ₃ 44.94.		258-37 SO ₈ 30-99; SO ₂ 24-80; S 37-23; H ₂ O ₆ .	34.09 S 94.07; O 5-93. 226.0 Sn 52.56; Cl 31.38; H ₂ O 15-96. 18-02 H 11-21; O 88-79.		287.55 ZnO 28.31; SO ₃ 27.84; H ₂ O 43.85. 97.44 Zn 67·10; S 32·90.
F & C					- 61		
	•						
		• • • •	• •	•		• •	
Formula	NaHSO ₃ Na ₂ S ₂ O ₃ +5H ₂ O	SO. H.SO. S.O.	H ₂ S ₃ O ₆	$H_2S_5O_6$.	$\begin{array}{c} H_2S\\ SnCl_2+2H_2O.\\ H_2O\end{array}$	ZnO ZnCl, ZnSO	$ZnSO_4 + 7H_2O$ ZnS
					• •		• • •
			·	•	• •	· · ·	
Compounds.	Sodium bisulphite . thiosulphate .	Sulphur dioxide trioxide Sulphuric acid	Trithionic acid	Pentathionic acid	Sulphuretted hydrogen Tin chloride (stannous)	Zinc oxide	surpuate sulphide

TABLE 3.—FACTORS FOR CALCULATING GRAVIMETRIC ANALYSES.

Substance weighed.	Snbstance to be determined.	1.	Iog
Ammonium.		-	
Ammonium chloride, NH ₄ Cl	Ammonia, NH_3 . Ammonium oxide,	0.3183	0.50286 -1
Ammonium platinum	$(NH_4)_2O$	0.1174	
chloride, $(N\dot{H}_4)_2$ PtCl ₆ .	Ammonia, NH ₃ . Nitrogen N	0.0767	1
Arsenic.	Triblogon Iv		
	Arsenic, As Arsenic trioxide,	0.6091	-0.78470 -1
Arsenic trisulphide, As_2S_3 .	As ₂ O ₃ Arsenic anhydride,	0.8041	0.90533 -1
ļ	As_2O_5	0.9342	0.97042 -1
Ammonium magnesium	Arsenic, As Arsenic trioxide,	0.3939	0.59532 -1
arsenate, $Mg(NH_4)AsO_4$ $+\frac{1}{2}aq$.	As ₂ O ₃	0.5200	0.71595 -1
Barium.	As ₂ O ₅	0.6040	0.78104 -1
Barium sulphate, BaSO, .)	(BaO	0.6570	0.81756 -1
Barium carbonate, BaCO ₃ .	Barium oxide, BaO	0.7771	0.89046 -1
Barium silicofluoride, $BaSiF_6$ Calcium.	(BaO	0.5483	0.73905 -1
Calcium sulphate, CaSO4.)	Calcium oxide, $\begin{cases} CaO \\ CaO \end{cases}$	0.4119	0.61484 -1
Calcium carbonate, $CaCO_3$ \int Carbon.	CaU	0.5603	0.74843 -1
Barium carbonate, BaCO ₃ .	Carbon dioxide, CO2	0.2229	0.34817 -1
Calcium carbonate, CaCO ₃ .	Carbon dioxide, CO ₂	0.4397	0.64314 -1
Carbon dioxide, CO ₂	Carbon, C	0.2727	0.43573 - 1
Chlorine.	Chlorine, Cl	0.2474	0.39337 -1
	Chloric anhydride,		_
İ	${ m C}_2{ m O}_5$. Potasium chlorides.	0.5264	0.72135 -1
Silver chloride, $AgCl$. $\left\{ \right.$	KC!	0.5202	0.71614 -1
	Sodium chloride, NaCl	0.4078	0.61049 -1
	Hydrogen chloride, HCl	0.2544	0.40557 -1
Copper. Cupric oxide, CuO	Conner Cu	0.7989	0.90250 -1
• •	Copper, Cu	0.7986	0.90230 - 1
Cuprous sulphide, Cu ₂ S . {	Cupric oxide, CuO .	0.9996	0.99981 -1
$\begin{array}{cccccccccccccccccccccccccccccccccccc$	Hydrogen, H	0.1119	0.04884 -1
Iron.	Iron, Fe	0.6994	0.84470 -1
	Ferrous oxide, FeO	0.8998	0.95416 -1

TABLE 3—Continued.

IADDE	3—Convolued.		
Substance Weighed.	Substance to be determined.	1.	log
Lead. Lead monoxide, PbO	Lead, Pb	0.9283	0.96768 - 1
, , , , , , , , , , , , , , , , , , , ,	Lead, Pb	0.6831	0.83449 - 1
Lead sulphate, PbSO ₄ . {	Lead oxide, PbO .	0.7359 0.8659	0.86681 - 1 0.93747 - 1
Lead sulphide, PbS . {	Lead Pb Lead oxide, PbO .	0.9328	0.969747 - 1 0.96979 - 1
Lead, Pb	Lead oxide, PbO .	1.0773	0.03234
Magnesium. Magnesium pyrophosphate,	Magnesium oxide,		
Mg _o P _o O ₂	MgO	0.3621	0.55883 1
Magnesium sulphate, MgSO ₄	Magnesium oxide,	0.3349	0.52493 - 1
Manganese.	MgO	0 9949	0 32433 - 1
Mangano manganic oxide,	3.5	0.7000	0.05540 3
Mn_3O_4	Manganese, Mn . Manganese, Mn .	0.7203 0.6314	0.85749 - 1 0.80029 - 1
Manganese sulphide, MnS	Manganous oxide,		
Nitro	MnO	0.8153	0.91131 – 1
Nitrogen. Ammonium platinum chloride,			
$(NH_4)_2PtCl_6$	Nitrogen, N	0.0631	0.80009 2
Platinum, Pt	Nitrogen, N	0.1435	0.15699 – 1
Magnesium pyrophosphate,	(Phosphorus, P .	0.2787	0.44519 - 1
Mg ₂ P ₂ O ₇	Phosphorus pent-	0.6379	0.80477 - 1
Potassium.	O oxide, P_2O_5 .	0.0918	0 80477 - 1
Potassium chloride, KCl .	Potassium oxide,		
Potassium-platinum chloride,	$ m K_2O$ Potassium oxide .	0.6317 0.1930	0.80051 - 1 0.28556 - 1
K ₂ PtCl ₆ (reduction factors-	Potassium chloride	0.3056	0.48515 - 1
adopted at Stassfurt).	Potassium sulphate	0.3571	0.55279 - 1
Potassium sulphate Sodium.	Potassium oxide .	0.5405	0.73282 1
Sodium sulphate, Na ₂ SO ₄ .	Sodium oxide, Na ₂ O	0.4364	0.63989 - 1
Sodium carbonate, Na ₂ CO ₃ . Sodium chloride, NaCl	Sodium oxide, Na ₂ O Sodium oxide, Na ₂ O	0.5849 0.5303	0·76708 - 1 0·72450 - 1
Sulphur.			
1	Sulphur, S	0.1374	0.13792 - 1
	Sulphur dioxide, SO ₂ Sulphur trioxide, SO ₃	0.2745 0.3430	0·43847 - 1 0·53529 - 1
Barium sulphate, $BaSO_4$.	Sulphuric acid,		
	H_2SO_4 Sodium sulphate,	0.4202	0.62344 - 1
Į į	Na ₂ SO ₄	0.6086	0.78432 - 1
Zinc.	Time In	0.8034	0400400 4
Zinc oxide, ZnO	Zinc, Zn Zinc, Zn	0.8034	0.90492 - 1 0.82664 - 1
Zinc sulphide, ZnS . {	Zinc oxide, ZnO .	0.8351	0.92172 - 1

TABLE 4.—DENSITY OF GASES AND VAPOURS

And Litre Weighte at 0° C., and at a pressure of 760 mm.

grm. mol. of each gas = 22.412 litree. 1 lltre of each gas = 0.04462 xits molecular weight. The spec. gravity of gases referred to

		Formula.	enlar ght,	Weight of 1 li in grams.	Weight of 1 litre in grams.	Density, air=1.	air=1.	Observer
			Mole Wei	Calculated.	Observed.	Calculated. Observed.	Observed.	
Acetylene	·	C ₂ H ₂	26.02	1.1610	1.189	0.8989	0.9056	Leduc.
Ammonia	•	NH.	17.03	9094-0	1.7708	0.5883	0.5962	Saussure.
Atmospheric air		: 't	150.07	1.2928	7.17.10	1.0000	K.5049	7 (°000 +0)
Chlorine		วีซี	70.92	3.1674	3.2191	2.4501	2.491	Treadwell
Carbon monoxide		က္မ	28.00	1.2505	1.2503	0.9673	0.96716	Ravleigh, Leduc.
dioxide	•	တိ	44.00	1.9651	1.9768	1.5201	1.52908	Guye.
Ethylene	•	C,H,	28.03	1.2519	1.2737	0.9683	0.9852	Saussure.
_		H,	2.02	0.0000	0.08987	0.06965	0.06952	Morley.
chloride .	•	HCI	36.47	1.6289	1.6394	1.2598	1.2681	Schener.
Methane		CH ⁷	16.03	0.7159	0.7160	0.5538	0.5545	Baume, Perrot.
Nitrogen	•	z	28.02	1.2514	1.2505	0.9680	0.96727	Rayleigh, Leduc.
Nitrous oxide	•	O.	44.02	1.9660	1.9777	1.5208	1.5298	Guye.
Nitric oxide		ON ON	30.01	1.3403	1.3402	1.0368	1.0367	Guye.
neroxide	<u>_</u>	o N	46.01	2.0549	:	1.5895	:	:
•	_	o Z	92.05	4.1098	:	3.1790	:	:
Oxygen	•	ြီ	32 .00	1.4292	1.4292	1.1055	1.1055	Guye.
ulphur		Š	64.12	2.8610	:	2.2130	:	
Sulphuretted hydrogen		H _o S	34.09	1.5226	1.5392	1.1777	1.1906	Baume, Perrot.
ulphur dioxide		် လိ	64.07	2.8615	2.9266	2.2134	2.2638	Jaquerod, Pintza,
trioxide	•	တ္ထ	80.08	3.5722	:	2.7631	:	:
Water	-	H,Ö	18.02	0.8040	:	0.6219		•

TABLE 5.—CALCULATION OF THE C.C. READ OFF IN GAS-VOLUMETRIC ANALYSIS, TO MILLIGRAMS OF THE SUBSTANCE REQUIRED.

 $N_c B_c$.—The data for this calculation are not the theoretically calculated, but the observed densities

of the gases, according to Table 4.

	.6	17-7912	40.4712	12.8628	6.4314	34.9625	28.5085	11.2545	13.6800	_	_		12.0627	15-2766	25.3297	34.1874	28.9719	13.8528
	si e	15.8144	35-9744	11.4336	5.7168	31.0600	25.3408	10.0040	12.1600	10.2544	12.4656	2.0048	10.7224	13.5792	22.5144	30.3704	25.7528	12.3136
	F:	13.8376	31.4776	10.0044	2.0052	27.1775	22.1725	8.7535	10-6400	8.9726	10.9074	4.3792	9-3821	11.8818	19.7001	26.5741	22.5337	10-7744
	. 6.	11.8608	26.9808	8.5752	4.2876	23-2950	19.0050	7.5030	9.1200	2.6908	9.3492	3.7536	8-0418	10.1846	16.8858	22.7778	19.3146	9.2352
	າລໍ	9.8840	22.4840	7.1460	3.5730	19.4125	15.8375	6.2525	2.6000	6.4090	7.7910	3.1280	6.7015	8.4870	14.0715	18.9815	16-0955	0969-2
	4.	7.9072	17-9872	5.7168	2.8584	15.5300	12.6700	5.0020	0080-9	5-1272	6.2328	2.5024	5.3612	9684.9	11.2572	15.1852	12.8764	6.1568
	ကံ	5.9304	13.4904	4.2876	2.1437	11.6475	9.5025	3.7515	4.5600	3.8454	4.6746	1.8769	4.0209	5.0922	8.4429	11.3889	9.6573	4.6176
,	2.	3.9536	8.9936	2.8584	1.4292	7.7650	6.3350	2.5010	3.0400	2.5636	3.1164	1.2513	2-6806	3.3948	5.6286	7.5926	6.4382	3.0784
	log	0.29597	0.65290	0.15509	0.85406 - 1	0.58912	0.50072	0.09709	0.18184	0.10782	0.19263	0.79633 - 1	0.12720	0.22979	0.44937	0.57936	0.50773	0.18730
	1.	1.9768	4-4968	1.4292	0.7146	3.8825	3.1675					0.6256	1.3403	1.6974	2.8143	3.7963	3.2191	1.5392
4	0° and 760 mm.	$CO_2 = mg CO_3$	$CO_{s} = mg CaCO_{s}$	O = BRO	*(O = mg O)*	O = mg MnO	0 = mg Cl	N = ma N	$N = mg NH_3$.			Nom = ON	11	$NO = mg N_3O_3$.	NO = mg HNO.	NO = mg NaNO	Cl = mg Cl	$H_2S = mg H_2S$.

* In the case of the bydrogen peroxide methods, where only half of the oxygen liberated comes from the substance analysed, † In the case of the azotometric methods, where the potassium-bromate method yielde 2·5 per cent, too little nitrogen.

TABLE 6.—SOLUBILITY OF SALTS.

Note.—The solubility is given in parts of the anhydrous salt dissolved by 100 parts of water.

At 100° C.	791 102 108 16 980 6.9 800 77 77 6 77 6 6.9 150 55 128 5 100 988 22.86 101.9 948
At 15°.	200 - 62 10.5 2.5 2.5 5.4 deliquescent 0.46 150 122 22 22 22 22 23 40 140 35 35 35 35 35 35 35 35 35 35 35 35 35
100 parts of Water diesolve	Potassium hydrate
At 100° C.	109.7 (95°) 154 89 840.8 871 60 140 34.2 21 0.002 0.05 380 19.8 250 19.8 250 70.5 586.7 43 (90°) 71 83.3 116
At 15°.	5.5 33 4.5 16.3 34.5 2.8 8.1 2.8 8.1 2.8 10 0.0013 110 7 100 110 110 110 110 110
100 parts of Water dissolve	Alum, ammonium potassium potassium potassium alphate mitrate parium chloride planitate promine caid mitrate calcium carbonate phydroxide phydroxide phydroxide mitrate copper acetate mitrate sulphate chloride chloride mitrate sulphate chad acetate chloride mitrate sulphate chad acetate chloride mitrate sulphate chad acetate chad

TABLE 7.—SOLUBILITY OF OTHER SALTS IN WATER AT VARIOUS TEMPERATURES.

Interpolated from the values given in Landolt-Börnstein-Meverhoffer's Tobles No. 178

100 parts of Water dissolve	_	At 0.	At 15°.	At 30°.	At 50°.	At 109	Observer	_
	' 						Ousel Vel:	_
Aluminium sulphate .	600	1:3	34.6	40.4	52.1	1.68	Poggiale.	_
Ammonium bicarbonate	Η.	11.9	17.3	27	:	; :	Dibbits.	_
chloride .	~ ~	2-6	35-1	41.4	50.4	77.3	Mulder.	
sulphate .	<u>.</u>	9.0	74.2	0.84	84.1	103.3	Mulder.	_
Calcium chloride		9.5	89	102.7	134	159	Roozeboom.	_
sulphate	_		0.199	0.210	0.207	0.17	Hulett and Allen.	_
Magnesium chloride .		_		26	60	73	Van't Hoff. Meverhoffer.	_
sulphate .	<u>ه</u>			40.6	50.4	68.5	Loewel, Mulder, Meverhoffer.	_
Potassium chlorate .	_	_		10.1	19.7	56	Gav-Lussac.	
chloride .	· 2			37.3	42.9	56.6	Andreas. Mulder.	
hydroxide .	6			126	140	178	Pickering.	_
nitrate	_			45.9	85.5	246	Andreg. Berkelev.	_
	-			13.6	16.5	24.1	Andreæ, Berkelev, Trevor.	_
Sodium bicarbonate .	_			11.1	14.5		Dibbits.	
carbonate				40.9	47.5	45.1	Mulder, Loewel, Epple.	
chlorate	•	82		111	135	204	Kremers, Graebe.	
chloride	ه			36.03	36.67	39.12	Andreæ, Berkelev.	
hydroxide .	4	_		119	145	340	Pickering.	_
nitrate	7			96.5	114	175.5	Berkelev.	_
sulphate	_			40	46.8	42.7	Loewel, Gav-Lussac.	
tetraborate (borax)				9.0	10.5	52.3	Horn and van Wegener.	_
thiosulphate .	<u>د</u>		65.2	84.7	169.7	266	Taylor	_
Zinc chloride.	20		350	435	470	615	Mylins and Dietz.	
sulphate	4		50.0	62	8.92	78.5	Cohen, Callendar & Barnes, Etard	

TABLE 8.—SOLUBILITY OF GASES IN WATER.

Column α gives the volume of gas (reduced to 0° and 760 mm.) dissolved by one volume of the liquid at the temperature indicated, if the partial pressure of the gas ie = 760 mm. Hg.

Column q gives the weight of the substance in grams, dissolved by 100 gr. of the pure solvent, if the partial presence of the gas + the vapour pressure of the liquid at the temperature indicated = 760 mm. Hg.

The letters following the name of the gas indicate the observer, viz., W.=Winkler;
B. & B.=Bohr & Bock; F.=Fauser; R.=Raoult; S.=Schönfeld; R.-D.=Roscoelithmen, B.—Roscoence, B.—Roscoe

Dittmar; R.=Roozeboom; B.=Bunsen.

T.	Оху	gen, W.	Hydr	ogen, W.	Nitroge	n, B. & B.	Chlori	ine, W.
	u.	q.	a.	q.	u.	q.	a	q.
0	*04890	.006948	.02148	.0001922	•02388	.002 977		l i
1	*04759	.006758	.02126	.0001902	.02337	.002912		
2	.04633	*006576	*02105	.0001882	'02288	.002843		
3	04512	*006401	*02084	*0001862	.02241	.002790		
4	04397	006234	*02064	.0001843	.02196	002732		
5	·04286	006074	*02044	.0001824	.02153	.002677	•••	
6	•04181	*005920	•02025	.0001806	.02111	.002624	•••	
7	.04080	.005775	•02007	0001789	02070	.002570	•••	•••
8	.03983	•005633	.01989	.0001772	02031	.002520		•••
9	.03891	.005499	01972	.0001756	.01993	.002472	0.005	
10	.03802	.005370	01955	0001739	.01956	002424	3.095	.9969
11	.03718	*005248	.01940	*0001725	01920	.002378	2.996	.9652
12	.03637	.005129	·01925 ·01911	·0001710	·01885 ·01851	·002333 ·002289	2.900	9344
13	.03560	.005011		.0001696			2.808	9048
14	·03486 ·03415	·004908 ·004804	·01897 ·01883	*0001682	·01818 ·01786	·002246 ·002205	2·720 2·635	·8766 ·8493
15	.03347	004804	01869	*0001669 *0001654	01755	002205	2.553	8230
16 17	03283	.004703	01856	*0001634	01735	.002104	2.474	•7977
18	03220	*004515	.01844	*0001630	01698	.002125	2.399	7736
19	.03161	.004313	.01831	*0001616	·01667	002049	2.328	·7508
20	.03101	004428	.01819	.0001614	.01639	002043	2.260	•7291
21	.03044	.004253	.01805	.0001590	.01611	002012	2.200	7098
22	.02988	*004169	01792	.0001575	.01584	.001940	2.143	6916
23	.02934	.004088	01779	0001561	.01557	.001903	2.087	6737
24	.02881	.004009	01766	.0001548	.01530	.001868	2.035	6570
25	02831	.003932	.01754	.0001534	.01504	.001832	1.985	6411
26	.02783	.003859	01742	.0001522	01478	.001798	1.937	6257
27	.02736	.003787	.01731	.0001509	.01453	.001764	1.891	·6110
28	02691	.003717	.01720	.0001497	.01428	.001731	1.848	•5973
29	02649	·003653	.01709	.0001485	01404	.001699	1.808	•5845
30	02608	.003588	.01699	.0001470	.01380	.001666	1.769	5722
35	.02440	•003315	.01666	.0001426	.01271	.001516	1.575	•5103
40	.02306	.003081	.01644	.0001385	.01182	.001386	1.414	4589
45	.02187	·002860	·01624	.0001338	·01111	.001275	1.300	4227
50	02090	002657	.01608	.0001288	01061	.001184	1.204	3927
60	.01946	.002274	·01600	.0001178	·01000	.001026	1.006	∙3294
70	.01833	·001857	·01600	0001021	***	•••	0.848	.2792
80	01761	•001381	·01600	.0000790	•••		0.672	•2226
90	01723	·000787	·01600	-0000461		•••	0.380	1268
100	·01700	-0000000	·01600	.0000000	·01000	.000000	0.000	•0000
							<u> </u>	L

TABLE 8-Continued.

T.		nonoxide, W.		dioxide, & B.		gen sul- le, F.	Amme	
	u.	q.	a.	q.	u.	q.	u	q.
0	0.03537	0.004397	1.713	0.3347	4.686	0.710	1298 • 9	98.7
1	0.03455	0.004293	1.646	0.3214	4.555	0.689	1220.2	92.7
2	0.03375	0.004192	1.584	0.3091	4.428	0.670	1154.7	87.7
3	0.03297	0.004092	1.527	0.2979	4.303	0.651	1100.9	83.6
4	0.03222	0.003997	1.473	0.2872	4.182	0.632	1053.0	79.9
5	0.03149	0.003904	1.424	0.2774	4.063	0.615	1019.5	77.3
6	0.03078	0.003814	1.377	0.2681	3.948	0.596	997.2	75.6
7	0.03009	0.003726	1.331	0.2590	3.836	0.579	974.9	73.9
8	0.02942	0.003641	1.282	0.2494	3.728	0.562	954.5	72.3
9	0.02878	0.003560	1 237	0.2404	3.622	0.546	933.0	70.6
10	0.02816	0.003481	1.194	0.2319	3.520	0.530	910.4	68 9
11	0.02757	0.003416	1 154	0.2240	3.421	0.515	888.0	67.2
12	0.02701	0.003333	1.117	0.2166	3.325	0.500	865.6	65.5
13	0.02646	0.003260	1.083	0.2099	3.232	0.485	843.2	63.7
14	0.02593	0.003188	1.050	0.2033	3.142	0.471	822.1	62.1
15	0.02543	0.003130	1.019	0.1971	3 056	0.458	802.4	60.6
16	0.02494	0 003065	0.985	0.1904	2.973	0.445	783 2	59.1
17	0.02448	0.003007	0.956	0.1845	2.893	0.433	764.1	57.6
18	0.02402	0.002943	0.928	0.1789	2.816	0.421	744.3	56.1
19	0.02360	0.002893	0.902	0.1736	2.742	0.409	725.8	54.7
20	0.02319	0.002839	0.878	0.1689	2.672	0-398	710.6	53.5
21	0.02281	0.002789	0.854	0.1641			690.2	51.9
22	0.02244	0.002739	0.829	0.1591		•••	674.3	50.6
23	0.02208	0.002691	0.804	0.1541			661.0	49.6
24	0.02174	0.002647	0.781	0.1494	l i	•••	647.8	48.6
25	0.02142	0.002603	0.759	0.1450	i	•••	634.6	47.6
26	0.02110	0.002560	0.738	0.1407			621.3	46.5
27	0.02080	0.002519	0.718	0.1367		•••	608.1	45.5
28	0.02051	0.002479	0.699	0.1328		•••	594.8	44.4
29	0.02024	0.002442	0.682	0.1293				•••
30	0.01998	0.002405	0.665	0.1259		•••	•••	•••
35	0.01877	0.002231	0.592	0.1106	···	•••	•••	•••
40	0.01775	0.002076	0.530	0.0974		• • • •		
45	0.01690	0.001934	0.479	0.0862		•••	•••	•••
50	0.01615	0.001797	0.436	0.0762		•••	•••	•••
60	0.01488	0.001521	0.359	0.0577		•••		}
70	0.01440	0.001276				•••	•••	
80	0.01430	0.000981				•••	•••	
90	0.01420	0.000568				•••	•••	
100	0.01410	0.000000				•••	•••	••
	l	l	<u> </u>	<u> </u>			<u> </u>	

TABLE 8—Continued.

т.	Sulphur S		Hydrogen Rl	chloride, O.	Metha	ne, W.
	a.	q.	u.	q.	a.	q.
0	79.789	22.83	506.7	82.5	0.05563	0.003959
1	77.210	22.09	i '		0.05401	0.003842
2	74.691	21.37	499.8	81.4	0.05244	0.003729
3	72.230	20.67			0.05093	0.003620
4	69.828	19-98	493.7	80.4	0.04946	0.003514
5	67.485	19:31			0.04805	0.003411
6	65.200	18.66	486.9	79.3	0.04669	0.003312
7	62.973	18.02			0.04539	0.003218
8	60.805	17.40	480.8	78.3	0.04413	0.003127
9	58.697	16.80			0.04292	0.003039
10	56.647	16:21	473.9	77.2	0.04177	0.002956
11	54.655	15.64		''	0.04072	0.002880
12	52.723	15.09	467.7	76.2	0.03970	0.002805
13	50.849	14.56	200		0.03872	0.002733
14	49.033	14.04	461.5	75.2	0.03779	0.002666
15	47.276	13.54	102.0		0.03690	0.002600
16	45.578	13.05	455.2	74.2	0-03606	0.002538
l îř	43.939	12.59	100 2		0.03525	0.002479
18	43.360	12.14	448.3	73.1	0.03446	0.002422
19	40.838	11.70	110 0		0.03376	0.002369
20	39.374	11.29	442.0	72.1	0.03308	0.002319
21	37.970	10.89	1120	121	0.03243	0.002270
22	36.617	10.50	435.0	71.0	0.03180	0.002223
23	35.302	10.13	100 0	,,,	0.03119	0.002178
24	34.026	9.76	428.7	70.0	0.03061	0.002134
25	32.786	9:41	120	,,,,	0.03006	0.002092
26	31.584	9.07	423.0	69.1	0.02952	0.002051
27	30.422	8.43	1200	""	0.02901	0.002031
28	29.314	8.42	417.2	68.2	0.02852	0.001974
29	28.210	8.10	71, 2	002	0.02806	0.001939
30	27.161	7.81	411.5	67:3	0.02762	0.001905
35	22.489	6.47	111.0	0.0	0.02546	0.001732
40	18.766	5.41	387.7	63.3	0.02340	0.001586
50		9 41	361.6	59.6	0.02134	0.001359
60	•••	i	338.7	56.1	0.01954	0.001339
70	***		500 /	201	0.01825	0.000926
80				•••	0.01770	0.000926
90		""		•••	0.01735	0.000398
100	•••				0.01700	0.000000
100		"		•••	0.01100	0.00000

TABLE 8-Continued.

т.	Ethyle	ene, W.	Acetyle	one, W.	Air,	w.	Nitrous oxide, in Alcohol, B.
	u.	q.	и.	q.	a.		a.
0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 20 20 20 20 20 20 20 20 20 20 20 20 20	0.226 0.219 0.211 0.204 0.197 0.191 0.184 0.178 0.162 0.157 0.162 0.143 0.139 0.136 0.139 0.125 0.122 0.129 0.125 0.114 0.111 0.108 0.106 0.104 0.102 0.100 0.098	0·0281 0·0272 0·0262 0·0254 0·0245 0·0237 0·0228 0·0221 0·0214 0·0207 0·0200 0·0194 0·0188 0·0188 0·0176 0·0171 0·0167 0·0162 0·0158 0·0153 0·0150 0·0146 0·0142 0·0139 0·0135 0·0123 0·0123 0·0123 0·0123 0·0121 0·0121 0·0121	1.73 1.68 1.63 1.58 1.58 1.49 1.45 1.41 1.37 1.24 1.31 1.27 1.21 1.18 1.10 1.08 1.05 1.01 0.99 0.97 0.95 0.89 0.89 0.84	0·20 0·19 0·18 0·18 0·17 0·16 0·16 0·15 0·15 0·14 0·14 0·13 0·13 0·13 0·12 0·12 0·12 0·12 0·11 0·11 0·11 0·11 0·11 0·11 0·10 0·10 0·10 0·10 0·10	0.02881 0.02808 0.02738 0.02670 0.02606 0.02543 0.02424 0.02369 0.02316 0.02217 0.02171 0.02127 0.0205 0.02045 0.02045 0.01808 0.01869 0.01869 0.01751 0.01724 0.01650 0.01650 0.01650		4·1780 4·1088 4·0409 3·9741 3·9085 3·8442 3·7811 3·7192 3·6585 3·5990 3·5408 3·4838 3·4279 3·3734 3·3200 3·2678 3·2169 3·1672 3·1187 3·0714 3·0253 2·9805 2·9368 2·9368 2·8944 2·8532
		•••			0.01503		
					0.01418	•••	
					0.01297		•••
		***			0.01156		
•••		···	:::		0.01126		
,			:::	:::	0.01113		:::
		:::	:::	:::	0.01105		
	"			'''			

TABLE 9.—SPECIFIC GRAVITIES OF SOLIDS.

		<u> </u>	
Alumina, anhydrous .	4.15	Calcspar	
Alum, ammonium potassium.	1.626	Cannel coal	1 16-1 27
potassium	1.724	Cement	2.7 - 3.05
Aluminium sulphate,		China clay, kaolin .	2.21
cryst	1.596	Cement	1.57
Aluminium	2.76	wood	
Alum stone	2.8	Coke, porous	-0.4
	1.707	Coal, porous	1.16-1.63
sulphate .	1.77	Copper, meranic, case.	
chloride .	1.528	hammered .	8.94
Anhydrite (CaSO ₄) .	2.96	pyrites	4.1-4.3
Anthracite	1.4-1.7	oxide	6.43
Antimony	6.7	sulphate .	2.27
Anthracite	3.884	oxide	5.97
Arsenic acid Asphalt	4.250	Clay	1.8-5.6
Asphalt	1.1-1.2	Cryolite	2.96
Ash wood	0.7-0.8	Elm wood	0.67
Barium chloride, cryst.	2.664	Fat, animal	0.92
carbonate .	4.56	Felspar	2.5-2.6
sulphate (spar)		Fibres, vegetable .	1.51
bydroxide, crys	t.1.66	Fir wood, dry	0.6
Basalt	2.8-3.2	Firebricks	1.85
Basalt	0.4-0.8	Flint Glass, green	2.7
Birch wood, dry	0.4-0.8	Glass, green	2.642
Bismuth	9.85	plate	2.450
Borate of magnesium		crystal, Bohem.	2.9-3.0
(boracite) Borax, crystallised .	2.9	flint, English . Glauber's salt, cryst	3.4-3.44
Borax, crystallised .	1.692	Glauber's salt, cryst	1.52
Boric acid, crystallised	1.479	anhydrous	
fused	1.830	Granite	2.5-2.9
Brown coal, lignite .	1.2-1.4	Gypsum, plaster-of-Paris	2.322
Brickwork	1.5-1.7	cast, dry .	0.97
Bricks, ordinary	1.4-2.2	Heavy spar	4.3-4.48
Brass	8.4-8.7	$ \operatorname{lce} (0^{\circ}).$	0.917
Calamine	4.1-4.5	lodine	4.948
Chalk	1.8-2.7	Iron, wrought	7.8-7.9
Calcium chloride, crys-		grey, cast .	6.6-2.3
	1.612	Cast, dry Heavy spar . Ice (0°). Iodine . Iron, wrought grey, cast . white, cast .	7 · 1 - 7 · 9
chloride, anhydrous	2.240	sesquioxide .	5.42
silicate	2.9	hydrated oxide .	
silicate	2.7	magnetic oxide .	5.4
phosphate	9 10	carbonate	3.87
sulphate, anhydrous	2.927	sulphate, cryst	1.904
		·	

TABLE 9—Continued.

The state of the s	
	Potassium chloride . 1 945
pyrites 5·18 Ivory 1·83-1·94 Larch wood 0·44-0·5	chromate . 2.603
Ivory 1.83-1.94	
Larch wood 0.44-0.5	sulphate . 2.66
Lignite 1 2-1 4	bisulphate. 2.277
Lime, burnt, quick 3.08	
Lime wood 0.5	Quartz 2.7
Litharge 9.36	Resin 1.07
Lead, cast 11'3	Rock salt 2·1-2·2
red 8.62	Sal-ammoniac 1.528
chromate 6.00	Sand, dry 1.4-1.6
acetate, cryst 2.395	damp 1.9-2.0
carbonate . 6.47	Sandstone 1.9-2.5
nitrate 4.40	Resin 1 '07
Lime, burnt, quick- Lime wood	Shver chidrine 9 901
sulphide 7.505	Slate 2.7
sulphate . 6 169	Sodium carbonate, anh. 2.509
chloride 5.802	carbonate, cryst. 1.454
Magnesia, calcined . 3.2	chloride 2.078
carbonate . 2'94	nitrate 2.226
Magnesite 2.9-3.1	sulphate 2.63
Magnesite 2·9-3·1 Magnesium sulph., cryst. 1·751	chloride 2 · 078 nitrate 2 · 226 sulphate 2 · 63 sulphide 2 · 471 thiosulphate . 1 · 736
chloride, cryst. 1 558	thiosulphate . 1.736
Manganese peroxide . 2.94	nvaroxiae . 2.130
native are 4.7-5.0	Steel 7.80
Maple wood 0.5-0.6 Marble 2.5-2.8	Steel 7.80 Steel, cast 7.92 hardened 7.66
Marble 2.5-2.8	hardened 7.66
Nickel 8.9	Sulphur, native 2.069 sticks, fresh . 1.98
Oak, dry 0.85-0.95	sticks, fresh . 1.98
Phosphorns, yellow . 1.826	sticks, old . 2.05
red 2:106	soft, amorphous 1.96
Pine wood, white . 0.55	Sulphuric anhydride . 1.97
red 0.5	Tin, cast 7.21-7.4
red 0.5 Platinum 21.1 Pock wood 1.263	hammered 7.475
Pock wood 1.263	Willow wood 0.5-0.58
Poplar 0.38	Witherite 4.30
Poplar 0.38 Porcelain 2.1-2.5 Porphyry 2.8 Potash, natural 2.3 Potassium carbonate 2.264	Witherite
Porphyry 2.8	rolled 7.2
Potash, natural 2.3	blende 3·9-4·2
Potassium carbonate . 2.264	oxide 5.73
chlorate . 2:35	sulphate 2.036

TABLE 10.—WEIGHT OF SUBSTANCES AS STORED.

Substance.		1 Cubic Metre Weighs	1 Cubic Foot Weighs	Tons per Cub. Foot.
		Kilo.	lb. avdp.	
Bricks		2100	131	.0584
Cement	.	1200	75	·0335
Clay, damp	.	1650	103	•0459
dry		1570	98	.0437
Limestone and other building ston	ies.	2000	125	0558
Mortar (lime and sand)		1800	112	•0500
Quicklime		1000	62.5	0279
Sand, dry		1330	83	·0370
damp		1770	110	•0491
Wood, beech logs	. 1	400	24.5	·0107
fir logs	. [330	20.5	·0091
oak logs		420	26	·0116
Raw Materials, etc., for Alkali Wo	rks.			
Pyrites, broken pieces	.	2500	156	•0696
smalls	.	2340	146.5	·0654
burnt	• •	1 520	95.0	.0424
Nitre	.	1310	81.5	.0364
Nitre cake (acid sulphate of soda)	.	1335	83	.0375
Salt	.	689	43	.0192
Saltcake	.	1180	73.5	.0328
Limestone (small pieces)	.	1400	87.5	•0391
Black ash (lumps)	.	962	60	·0268
Alkali waste (wet)	. 1	1268	79	.0352
Soda salts $(Na_2CO_3 + H_2O)$ (draine	d) .	810	50.5	.0225
Soda ash (unground)	.	1195	74.5	.0332
Soda crystals	. 1	1010	63	-0281
Bicarbonate (ground)		986	61.5	.0274
Quicklime (small lumps)		1058	66	.0295
Sieved lime (for bleaching powder) .	497-593	31-37	·0151
Bleaching powder	٠,	721-834	45-52	•0216
Manganese dioxide, native	٠, [2210	138	.0616
Limestone dust	.	1550	96.5	.0431
Coke (for filling towers)		417-534	26-33	.0131
Flints ,, ,,	.	1600	100	.0446
Cinders (ashes) ,	- 1	738	46	.0205

TABLE 11.—SPECIFIC GRAVITY OF LIQUIDS.

				Specific - Gravity.	Temp.
Acetic anhydride		•		1.004	17°
Acetone			. 1	0.81	•••
Alcohol			. 1	0.7939	12°:5
Acetic acid				1.064	17°
Bisulphide of carbon				1.272	
Benzene	_	-	_ 1	0.884	15°•5
Coal tar	-			1.15	15°
Ether		-		0.723	12°·5
Glycerine.	•	·		1.260	15°
Linseed oil		·		0.9347	15°
Mercury	•	·	. i	13.596	0°
Nitrogen peroxide (liquid	`	•	•	1.45	U
Olive oil	,	•	•	0.917	 15°
Petroleum	•	•	•	0.78-0.81	15°
	•	•	•	0.9136	15°
Rapeseed oil	•	•	•	1.45	20°
	•	•	•	1.02-1.04	20 15°
Sea-water	•	•	•		
Spirits of turpentine	•	•		0.865	15°

TABLE 12.—SPECIFIC GRAVITY AND PERCENTAGE OF SOLUTIONS SATURATED AT 15°.

The percentage refers to Anhydrous Salt in 100 solution.

		Tem- perature.	Percentage of Salt.	Specific Gravity.	Degrees Twaddell.
Ammonium chloride sulphate Barium chloride . Calcium chloride . Magnesium sulphate		15 19 15 15	26·30 50·00 25·97 40·66 25·25	1.0776 1.2890 1.2827 1.4110 1.2880	15.5 57.8 56.5 82.2 57.6
Potassium chloride. carbonate nitrate		15 15 15 15	24.90 52.02 21.07	1·1723 1·5708 1·1441	34·4 114 28·8
sulphate Sodium chloride carbonate		15 15 15	9.92 26.395 14.35	1.0831 1.2043 1.1535	16.6 40.8 30.7
nitrate . sulphate .	:	19.5 15.0	46·25 11·95	1·3804 1·1117	76 22·3

TABLE 13.—LINEAR EXPANSION OF SUBSTANCES.

By heating from 0° to 100° C. $(32^{\circ}-212^{\circ}$ F.).

1				1		
Aluminium					0.00218	1:459
Brass					0.001982	1:535
Bronze					0.001820	1:549
Charcoal from oak		•			0.001200	1:833
fir	-				0.00100	1:1000
Copper	-	-			0.001714	1:582
Glass, flint			-		0.000817	1:1219
white .	Ċ		-		0.000861	1:1161
green	•	•	:		0.000766	1:1305
Gold	·	•		- 1	0.001431	1:682
Iron, wrought .	•	•	•		0.001235	1 : 812
cast	:	•	•	- 1	0.001144	1:901
Lead			•	- 1	0.002938	1:351
Marble of Carrara	•	•	•		0.000849	1:1178
St Beat	•	•	•		0.000418	1:2392
Mercury			•		0.0182	1:55
Nickel		:	•	.	0.001516	1:600
Platinum		:	•	•	0.000884	1:1132
Porcelain (Berlin)	•	•	•	٠,۱	0.000336	1:3000
Silver		•	•	•	0.001954	1:524
		•	•	•	0.002058	1:486
Steel, hardened.	•	•	•	• 1	0.001240	1:807
not hardened	•	•	•	•	0.001240	1:927
Trim.	•	•	•	•	0.002703	1:516
	•	•	•	•	0.015538	1:510
	•	•	•	•	0.015556	1:714
Zinc	•	•	•	•	0.001/11	1:340
<u> </u>				1		L

TABLE 14.—COMPARISON OF THERMOMETRIC SCALES.

 $t^{\circ}C = \frac{9}{5}t^{\circ}R = \frac{9}{5}t + 32^{\circ}F; \ t^{\circ}R = \frac{9}{4}t^{\circ}C = \frac{9}{4}t + 32^{\circ}F; \ t^{\circ}F = \frac{9}{5}(t - 32^{\circ})C = \frac{9}{5}(t - 32^{\circ})R.$

Celsius' (Centigrade) degrees as units.

Cola. Réau. Pahr. Cola. Réau. Fahr. Cola. Réa Proc. Réau. Fahr.	- 1		_						_				_	_								_		_	_		_
Réau. Fahr. Cols. Réa. Réa. Réa. Réa. Réa. Réa. Réa. Réa. </td <th></th> <td>Fahr.</td> <td>+172.4</td> <td>174.2</td> <td>176</td> <td>177.8</td> <td>179.6</td> <td>181-4</td> <td>183.2</td> <td>185</td> <td>186.8</td> <td>188-6</td> <td>190.4</td> <td>192.2</td> <td>194</td> <td>195.8</td> <td>9.461</td> <td>199.4</td> <td>201.2</td> <td>203</td> <td>204.8</td> <td>206-6</td> <td>508.4</td> <td>210-2</td> <td>212</td> <td>:</td> <td></td>		Fahr.	+172.4	174.2	176	177.8	179.6	181-4	183.2	185	186.8	188-6	190.4	192.2	194	195.8	9.461	199.4	201.2	203	204.8	206-6	508.4	210-2	212	:	
Réan. Fahr. Cols. Réau. Fahr. Cols. Réa. Réa. Réa. Réa. Réa. Réa. Réa. Réa. </td <th></th> <td>Réau.</td> <td>+62.4</td> <td>63.2</td> <td>64</td> <td>64.8</td> <td>9.99</td> <td>66.4</td> <td>67.2</td> <td>89</td> <td>8.89</td> <td>9.69</td> <td>70.4</td> <td>71-2</td> <td>72</td> <td>72.8</td> <td>73.6</td> <td>74.4</td> <td>75.2</td> <td>94</td> <td>8.92</td> <td>9-44</td> <td>78.4</td> <td>79.2</td> <td>80</td> <td>:</td> <td></td>		Réau.	+62.4	63.2	64	64.8	9.99	66.4	67.2	89	8.89	9.69	70.4	71-2	72	72.8	73.6	74.4	75.2	94	8.92	9-44	78.4	79.2	80	:	
Réan. Fahr. Cols. Réau. Fahr. Cols. Hér. 44.8 45.2 48.2 38.2 26.4 49.6 45.6 44.8 45.6 44.8 45.6 44.8 45.6 44.8 45.6 48.6 44.8 45.6 48.6 48.2 28.6 48.6 48.7 29.6 48.7 29.6 48.7 29.6 48.7 29.6 48.7 29.6 48.7 29.6 48.7 29.6 48.7 29.6 48.7 29.6 48.7 29.6 48.7 29.6 48.7 29.6 48.7 2		Cels.																								:	
Réan. Pahr. Cols. Réau. Fahr. Cols. Béau. Fahr. Cols. Béau. Fahr. Cols. Bár. Cols. Fahr.		Fahr.	+131	132.8	134.6	136.4	138-2	140	141.8	143.6	145.4	147-2	149	150.8	152.6	154.4	156.2	158	159.8	161.6	163.4	165.2	167	168.8	170.6	:	
Réan. Pahr. Cols. Réau. Fahr. Cels. Réau. Réau		Réau.																								;	
Réan. Fahr. Cols. Réan. Fahr. Cols. Réan. Fahr. Cols. Réan. Fahr. Cols. Béan. Fahr. Cols. Béan. Bahr. Báhr. Báhr. <th< td=""><th></th><td>Cels.</td><td>+ 55</td><td>56</td><td>22</td><td>28</td><td>59</td><td>09</td><td>61</td><td>62</td><td>63</td><td>64</td><td>65</td><td>99</td><td>49</td><td>68</td><td>69</td><td>70</td><td>71</td><td>72</td><td>73</td><td>74</td><td>75</td><td>92</td><td>22</td><td>:</td><td></td></th<>		Cels.	+ 55	56	22	28	59	09	61	62	63	64	65	99	49	68	69	70	71	72	73	74	75	92	22	:	
Réan. Pahr. Cols. Réau. Fahr. Cols. Réau. Fahr. Cols. Ban. Fahr. Cols. Ban. Fahr. Cols. Ban. Fahr. Cols. Fahr. Fa		Fahr.	9.68+	91.4	93.2	95	8.96	9.86	100.4	102.2	104	105.8	107.6	109-4	111.2	113	114.8	116.6	118.4	120-2	122	123.8	125.6	127.4	129.2	:	
Réau. Fahr. Cols. Réau. Fahr. Cols. Réau. Fahr. -32 -40 -16 -12.8 +3.2 +8 +6.4 +46.4 31.2 38.2 15 12 5 9 7.2 48.2 29.6 34.6 13 10.4 12 5 9 7.2 48.2 29.6 34.6 13 10.4 12 9.6 53.6 3 24.8 51.8 51.8 52.8 51.8 52.4)	Réau.	+25.6	26.4	27.2	28	28-8	29.6	30.4	31.2	32,	32.8	33.6	34.4	35.2	36	36.8	37.6	38.4	39-2	40	40.8	41.6	42.4	43.2	:	
Réau. Fahr. Cols. Réau. Fahr. Gels. Réau. Gels. Ré	- 1	Cels.		33	34	32	36	37	န္	33	40	41	42	43	44	45	46	47	48	49	20	51	52	53	54	:	_
Réan. Pahr. Cols. Réau. Fahr. Cols. -32		Fahr.			20	51.8	53.6	55.4	57.2	59	8.09	62.6	64.4	66.2	89	8.69	9.12	73.4	75.2	22	78.8	9.08	82.4	84.2	98	87.8	
Réan. Pahr. Cols. Réau. Fahr. 12 12 13 13 13 14 14 15 15 15 15 15 15		Réau.	+6.4	7.2	œ	8.8	9.6	10.4	11.2	12	12.8	13.6	14.4	15.2	16	16.8	17.6	18.4	19.5	20	20.8	21.6	25.4	23.2	24	24.8	
Réan. Pahr. Cols. Réau. Fahr. 12 12 13 13 13 14 14 15 15 15 15 15 15		Cels.	- *	6	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	56	27	28	29	30	31	•
Réan. Pahr. Cols. Rada. Pahr. Cols. Rada. Rada			+3.2	ъ	8-9	9.8	10.4	12.2	14	15.8	17.6	19.4	21.2	73	24.8	26.6	28.4	30.5	32	33.8	35.6	37-4	39.2	41	42.8	9.74	
Réau. Pahr. Galler Galler Pahr. Galler Pahr. Galler Galler		Rèsu.	- 12.8	12	11.2	10.4	9.6	8	œ	7.5	6.4	5.6	4.8	4	63 63	5.4	1.6	8.O	0	8.0÷	1.6	2.4	89 Ç7	4	4.8	5.6	
1 1 1 1 1 1 1 1 1 1		Cels.	-16	15	14	13	12	1	01	6.	∞	7	9	20	4	က	7	_	0	+1	22	ಣ	4	2	9	7	
<u> </u>		Fahr.	- 40	38.2	36.4	34.6	32.8	31	29.5	27.4	25.6	23.8	22	20.2	18.4	16.6	14.8	13	11.2	9.4	9.4	2.0	4	2.2	7.0	+1.4	
20 0 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8 8		Réau.	- 32	31.2	30.4	29.6	28.8	28	27.2	7.97	25.6	24.8	24	23.2	22-4	21.6	20.8	20	19.5	18.4	17.6	16-8	16	15.2	14.4	13.6	_
		Cels.	- 40	39	38	37	36	35	34	33	32	31	30	53	28	27	26	25	24	23	22	21	20	19	18	17	

Réau.	+ + + + + + + + + + + + + + + + + + +
	+ 1
Fah.	1777 1777 1778 1778 1778 1779 1779 1779
Réau.	+ \$6.40
	+ + + + + + + + + + + + + + + + + + +
Fah.	1142 1145 1145 1145 1145 1155 1155 1155
Réau.	+ \$28,88,89,88,88,88,89,88,89,99,88,83,44,44,44,44,44,44,44,44,44,44,44,44,44
Cel.	++ ++ +
Fah.	1,000 1,000
Réau.	+110-1118-1118-1118-1118-1118-1118-1118-
Cel.	++ 1128 2232 2232 2232 2232 224 200 224 200 225 225 225 225 225 225 225 225 225
Fah.	+ 1002122475475475444444444444444444444444444
Réau.	+ 001122288844446655
Cel.	0-1-1-22 88.88 88.88 99.69
Fah.	+ 8%88888444844444444460000466000000000000
Réau.	1-1 1-1 1-1 1-1 1-1 1-1 1-1 1-1
Cel.	68.87.50.00.00.00.00.00.00.00.00.00.00.00.00.
Fah.	- + 8010101000000000000000000000000000000
Réau.	- 822 -
Ğ.	
Fah.	0.88.88.88.88.88.88.88.88.88.88.88.88.88

TABLE 15.—CONVERSION OF CENTIGRADE INTO FAHRENHEIT DEGREES ABOVE 100. AND VICE VERSA.

Divide the degrees above 100 into hundreds and a remainder. figure corresponding to the hundreds is taken from the following tables and added to that corresponding to the remainder as taken from Table 14. If, on converting Fahrenheit into Centigrade, the "remainder" amounts to 32°, or less, the degrees Centigrade corresponding to it are negative (below freezing point), and hence must be deducted from the figures of the following table. Also note, for example, that 300° F. is not= 166.7° C., but=166.7-17.8, = 148.9° C.

Α.

C.	Fabr.	C.	Fahr.	C.	Fahr.	C.	Fahr.
100	180	600	1080	1100	1980	1600	2880
200	360	700	1260	1200	2160	1700	3060
300	540	800	1440	1300	2340	1800	3240
400	720	900	1620	1400	2520	1900	3420
500	900	1000	1800	1500	2700	2000	3600

B.

Fahr.	c.	Fahr.	C.	Fahr.	C.	Fahr.	C.
100 200 300 400 500 600 700 800 900	55.6 111.1 166.7 222.2 277.8 333.8 388.9 444.4 500	1000 1100 1200 1300 1400 1500 1600 1700 1800	556.6 611.1 666.7 722.2 777.8 833.3 888.9 944.4 1000	1900 2000 2100 2200 2300 2400 2500 2600 2700	1055.6 1111.1 1166.7 1222.2 1277.8 1333.3 1388.9 1444.4 1500	2800 2900 3000 3100 3200 3300 3400 3500	1555·6 1611·1 1666·7 1722·2 1777·8 1833·3 1888·9 1944·4

TABLE 16.—MELTING POINTS (FREEZING POINTS).

									Degrees Cent.
Alcohol (eth	wlic)								130
Aluminium	yncy	•	:	•	•	•	•	- 1	657
Ammonia	•	•	•	•	•	•	•	.	- 7 5
Antimony	•	•	•	•	•	•	•	$\cdot $	630
Asphalt	•	•	•	•	•	•	•	٠,	100
Aspnant Benzene (pu	•	•	•	•	•	•	•	•	6
Bismuth	irej	•	•	•	•	•	•	•	268
Boric acid	•	•	•	•	•	•	•	• ;	186
	•	•	•	•	•	•	•	• ;	900
Brass .	•	•	•	•	•	•	•	- 1	
Bromine	•		•	•	•	•	•	• '	-70
Bronze.	•	•	•	•	•	•	•	• ;	900
Cadmium	.·_			•	•	•	•	•	321
Carbon diox	ride						•		-79
Cobalt .									1490
Colophoniu	m.								135
Copper								. 1	1083
Cupric chlor	ride								498
Cuprous chl	oride							. '	434
Fat. ox			_		-	_			40
sheep	Ī					-		- 1	42
pig	•	•	•	•	•	•	•	- 1	27
Fluorspar *	•	•	•	•	•	•	•	•	133 0-13 78
Glass free f	nom I		•	•	•	•	•	1	1200
	ioin r		•	•	•	•	•	• 1	1000
	uorog	lead	•	•	•		•	•	1063
Gold .		•	•	•	•	•	•	•	
Iron, cast,		•	•	•	•	•	•	•	1075-1135
	grey	: .	•	•	•	•	•	•	1200-1250
	wroug	ht	•	•	•	•	•	•	1500
Iodine .	•						•		113
Lead .								- 1	327
oxide								.	954
chlori									498
Magnesium								.	650
Mercury		_					_	1	-39.4
Mercuric ch	loride	*	-	Ĭ.	-	-	Ī.		287-293
Naphthalen	e	•	:	•	•	•	•	•	79
Nickel .		•		•	•	•	•	- 1	1452
Nitric acid	•	•	•	•	•	•	•	. [- 50
oxide		•	•	•	•	•	•	٠	- 148.8 to - 167
		•	•	•	•	•	•	•	
Nitric tetro		•	•	•	•	•	•	•	-11
Nitrous oxi	ae					•		•	-102

^{*} The statements found in literature vary between these limits.

TABLE 16-Continued.

							Degrees Cent.
Palm oil	_						29
Paraffin, hard .			-			.	45-60
Pitch (coal tar, hard)					-		150-200
Phosphorus .	•		-	-	•		44
Platinum	•	•	•	•	•		1753
Potassium chlorate*	•	٠	•	•	•	- 1	248-372
indide*	•	•	•	•	•	.	674-723
carbonate	*	•	•	•	•	. [878-898
nitrate*		•	•	•	•	•	336-343
chloride*	•	•	•	•	•	.	740-804
	•	•	•	•	•	•	1058-1076
sulphate	•	•	•	•	•	•	94
Rose's metal .	•	•	•	•	•	•	94 217
Selenium	•	•	•	•	•	•	
Stearic acid .	•	•	•	•	•	•	70
Steel				•	•	•	1375
Silver, metallic .						.	961.5
chloride* .]	450-460
nitrate .						.	217
Strontium chloride						.	825
Sodium chloride*							772-840
sulphate*						. -	861-884
nitrate*.						.	308-330
chlorate*						.	248-302
carbonate*	:	·	-				814-918
Spermaceti	-	·	·	:		[]	45-50
Sulphur (monoclinic)	-	:	•	•	:	: 1	113
dioxide.	•	•	•	•	•	- 1	-72.7
trioxide.	•	•	•	•	•	•	14.8
Sulphuretted hydroge	·	•	•	•	•		- 85
		l bas		•	•	•	- 00
Sulphuric acid, <i>cf.</i> sp Thallium	ecta	n bar	L.			1	301
	•	•	•	•	•	•	301 232
Tin	•	•	•	•	•	•	
tetrachloride	•	•	•	•	•	•	- 33
Wax, bees'.	•	•	•	•	•	•	62-70
Wood's metal .			•	•	•	•	70
Zinc							419

^{*} The statements found in literature vary between these limits.

TABLE 17.—FREEZING MIXTURES.

Temp. falls	From To	14° -35°	10° -18°	10° -16°	0° -37°	0 - 40°	5° -41°	0 - 33°	0 42.
	Jisq * gieW	[]	2 3			2 2 2	<u></u>	23	12
Aq s	Jag *								
		• •	• •	• •		• • •	• •	• •	• •
		• •	• •	• •				• •	• •
ž	Su bstances.	7. Dilute nitric acid. Snow	8. Sodium sulphate . Hydrochloric acid	9. Ammonium nitrate Water	10. Potassium hydroxide Snow	11. Dilute nitric acid Dilute sulphuric acid Snow	 Dilute sulphuric acid Snow 	13. Calcium chloride.	14. Calcium chloride.
_		ຳດ		ຶ່			-:		
Temp. falls	T ₀	- 25°		- 12°	- 10°	- 23°	,	81 -	- 24°
Temi	From	10°		10。	10°	10°	ę	Ь	တိဂ
s pa	stra¶ gieW	919	4 %	16	23	948	1	§ 8	
				• •					• • •
	Substances.	1. Sodium sulphate . Ammonium nitrate	Dunte nitric acid . 2. Ammonium chloride	Potassium nitrate . Water	3. Sodium sulphate . Dilute nitric acid .	4. Sodium sulphate . Ammonium chloride Potassium nitrate .	Dilute nitric acid . 5. Sodium chloride .	Snow	6. Anmonium chloride Potassium nitrate . Water .

BOILING POINTS

TABLE 18.—BOILING POINTS.

				Degrees Centigrade.
Acetone		•		56
Alcohol, absolute				78
Aldehyde				21
Ammonia, anhydrous				- 33.7
nitrate, satur. solution				240
Barium chloride, satur. solution .	•			104.4
Benzene				80.4
Bromine				63.0
Calcium chloride, satur. solution				260
66 per cent. solution .				156
33 per cent. solution .				128
nitrate, satur. solution .				151
Carbon dioxide				-78
disulphide				46
Chlorine				- 33.6
Ether				35
Hydrochloric acid, 20°2 per cent. Ho	Cl			110
Iodine.				184.4
Methylic alcohol				60
Mercury				356
Naphthalene				218
Nitric acid, very concentrated .				86
specific gravity 1.42				121
Nitrous anhydride				3.5

34 THE TECHNICAL CHEMISTS' HANDBOOK

TABLE 18-Continued.

					Degrees Centigrade.
Nitrous oxide					-88
Nitric peroxide					20
Potassium chloride, satur. solution				.]	108.5
chlorate, satur. solution		•			104.4
acetate, satur. solution					161
carbonate, satur. solution				.	133.5
nitrate, satur. solution					115
sulphate, satur. solution					102.1
Sodium chloride, satur. solution.		•			108.8
acetate, satur. solution .					125
carbonate, satur. solution					105
phosphate, satur. solution					106.6
nitrate, satur. solution .				.	120
Sulphur					444 • 4
Sulphuric acid, H ₂ SO ₄					326
anhydride α					15
β					50
Sulphur dioxide					-10
Toluene					111
Xylenes	•				136-141
Turpentine, spirits of					160
Zine	•	•	•	•	918

HIGH TEMPERATURES

TABLE 19.—HIGH TEMPERATURES, AS MEASURED WITH LE CHATELIER'S PYROMETER.

(Where no other observer is quoted, according to Le Chatelier's publications 1892, 1895, and 1900.)

ibout	pig) at tuyeres
Petroleum flame, about 1500	g 1400-
ne	
The efferment come, cone, cone,	ring hot firing .
0001	cistern furnace 1400
le of outer cone 1553	cistern furnace, temp. of glass 1310
1175	Porcelain furnace, for hard porcelain (final
Margin	temperature) 1400
cone.)	Coal-gas. Siemen furnaces, top 1190
Fusing point of white Swedish pig iron 1135	
grey foundry pig iron 1220	
-	
် င်	Annular brick kiln 1100
ingot steel, 0.9 per cent. C. 1410	ant lamps 1800-
	light arc (absolute temp.) 4100
gold 1065	Fusing point of fireclay 1670-1700
	raeus) · · ·
• • • •	•
platinum 1753	
Bessemer converter 1580-1640	No. 33 1650
Siemens-Martin furnace 1420-1550	250
Siemens crucible steel furnace 1600	No. 31 1618
Revolving puddling furnace (final temperature) 1330	30

TABLE 20.—REDUCTION OF THE VOLUME OF

General formula for Dry Gases, $V_0 = \frac{V \times 273b}{(273+t)760}$

b=Barometric pressure, reduced to 0°; t=temperature; f=tension

I. Table for reducing the volumes of

0°.	1°.	2°.	3°.	4° .	5°.	6°.	7°.	8°.	9°.	10°.	0°.
1	0.996	0.998	0.989	0.986	0.982	0.978	0.975	0.972	0.968	0.965	1
2	1.993	1.985	1.978	1.971	1.964	1.957	1.950	1.943	1.936	1.929	2
3	2-989	2.978	2.967	2.957	2.946	2.936	2.925	2.915	2.904	2.894	8
4	3.985	3.971	3.956	3.942	3.928	3-914	8 900	3.886	3.872	3.859	4
5	4.982	4.964	4.946	4.928	4.910	4.893	4.876	4.858	4.841	4.824	5
6	5.978	5.956	5.935	5.913	5.892	5.871	5.850	6.830	5.809	5.788	6
7	6.974	6.949	6.924	6.899	6.874	6.850	6.825	6.801	6.777	6.753	7 }
8	7.970	7.942	7.913	7.885	7.856	7.828	7.800	7.773	7.745	7.718	8
9	8.967	8.934	8-902	8.870	8.838	8.807	8.775	8·744 9·716	8·713 9·681	8.682	9
10	9.963	9.927	9.891	9.856	9.820	9.785	9.750	9-110	9.001	9.647	ענ
11	10.96	10.92	10.88	10.84	10.80	10.76	10.73	10.69	10.65	10.61	11
12	11.96	11.91	11.87	11.83	11.78	11.74	11.70	11.66	11.62	11.57	12
13	12.95	12.91	12.88	12.81	12.76	12.72	12.68	12.63	12.59	12.54	13 14
14	13.95	13.90	13.85	13.80	13·75 14·73	13 70 14 68	13·65 14·63	13.60 14.67	13·55 14·52	18·50 14·47	15
15	14.95	14.89	14.84	14.78	14.75	14 00	14.09	14 01	14.02	14.41	10
18	15.94	15.88	16.83	15.77	15.71	15.66	15.60	15.56	15.49	15.43	16
17	16.94	16.87	16.82	16.76	16.69	16.64	16.58	16·52 17·49	16·46 17·48	16·40 17·36	17 18
18 19	17·93 18·93	17·87 18·86	17·81 18·79	17·74 18·72	17·67 18·65	17:61 18:59	17·55 18·53	16:46	18:39	18.33	19
20	19 98	19.85	19.78	19.71	19.64	19.57	19.50	19.43	19.36	19.29	20
				i		["		-0.40		· .	
21	20.93	20.84	20.77	20-69	20.62	20.55	20.48	20.40	20.35	20.26	21 22
22	21.92	21.84	21.76	21.68	21.60	21·58 22·51	21.45	21.87	22.26	21.22	23
23 24	23.92	22-83 23-82	22·75 23·74	23.65	23.20	23.48	28-40	23.32	23.23	23.16	24
25	24.91	24.81	24.73	24.64	24.55	24.46	24.88	24.29	24.20	24.11	26
26	25-91	25.81	25.72	25.62	25.23	25*44	25:35	25.26	25.17	25.08	26
27	26.90	26.80	26.71	26.61	26.52	26.42	26.33	26.23	28.18	26.04	27
28	27.90	27.79	27.69	27.59	27.50	27.40	27.30	27.20	27.10	27.01	28
29	28.90	28.78	28 68	28.68	28.48	28-58	28.28	28.17	28-07	27.97	29
30	29.89	29.78	29.67	29.57	29.46	29.86	29.25	29.15	29.04	28.94	30
31	80.89	80.77	30.66	30.55	30 44	80.84	30-25	30-12	30.01	29.91	81
82	31.88	31.76	31.65	31.24	31.42	31 32	31.20	31.09	30.98	80.87	82
83	82.88	82.76	82.64	32.52	32.40	82.30	32.18	32.06	81.94	81.84	88
84	38.88	33.75	33.63	33.51	83.88	33-27	83.15	33·03 34·01	33·88	82·80 88·77	84 35
35	84.87	34.74	84.62	84.50	34.37	84.25	84.18		1)
36	35.87	36.74	8 5 61	35.48	85.85	35.23	85.10	34.98	34.85	34 73	36
87	36.67	36.73	86.60	86.47	36.33	36.21	86.08	35.95	85.82	85.70	87
38	37·86 88·86	37.72	87.59	37.45	87·32 38·80	87·19 88·16	87·05 38·03	36·92 37·89	36·79 87·75	36.66	38
39	39.85	38·71 59·71	88·58 39·56	38·44 89·42	39.28	89.14	39.00	38.86	38.72	87·62 88·59	89 40
40		99.11	39 30	_	ł	1				_	
41	40.85	40.70	40.55	40.41	40.26	40.12	39·98 40·95	39·85 40·80	59·69 40·66	39.55	41
42	41.85 42.84	41.69	41.64 42.53	41.89	41.24	41.10	41.93	41.78	41.82	40.52	42
43 44	48.84	42.68	43.52	43.37	43.20	43.05	42.90	42.75	42.59	42.45	44
44	44.84	44.67	44.61	44 35	44.19	44.03	43.88	48.72	43.66	43.41	45
	45-83		45.50	46.34	45.17	45.01	44.85	44.69	44.53	44.38	46
46	46.88	45.66 46.65	46.48	46 82	46.16	45.99	45.63	46.66	45.60	45.34	47
47 48	47.83	47.65	47.48	47.31	47.18	46 97	46.80	46.68	46.47	46.31	48
49	48-82	46.64	48.47	48.29	48.12	47-95	47.78	47.60	47.44	47.27	49
50	49.82	49 64	49.46	49-28	49.10	48.98	48.75	48.68	48-41	48.24	5 0
			ļ			l	L		l		

GASES TO NORMAL TEMPERATURE & PRESSURE.

General formula for Moist Gases, $V_0 = \frac{\nabla \times 273(b-f)}{(273+t)700}$

of aqueous vapour at t° . Compare Table 28.

gases to a temperature of 0° C.

0•.	1°.	2°.	8°.	4°.	5°.	8°.	7°.	8°.	۶°.	10°.	0°.
51	50.82	50.68	50.45	50.26	50.08	49.91	49.78	49.55	49.88	49.21	61
52	51.81	51.82 52.82	51·44 52·43	51·25 52·24	51.06 52.05	50·89 61·87	50·70 51·68	50·52 51·49	50·35 51·31	50·17 51·18	52 58
58 54	52·81 53·81	53.81	58.42	58.22	53.08	52.84	52.65	52.46	52.28	52.10	54
55	54.80	54.60	54.41	54.21	54.01	53.82	53.63	63.44	53.25	58.08	55
56	55*80	55.80	55.40	56.19	54 99	54.80	54.80	54.41	54.22	64 08	56
57	56.80	56.59	56.39	55.18	55.97	55.78	55.58	55.38	55.19	54.99	67
58	57·79 58·79	57·58 58·57	57·37 58·37	67 18 58 15	58·95 57·93	58·76	58·56 57·68	58·3 5 57·82	56·15 57·12	55.98 66.92	58 59
59 80	59.78	59.58	59.35	59.18	58.92	58.71	58.50	58.30	58.09	57.88	50
61	80.78	60.55	80.34	50.12	59.90	59.69	59.48	69.27	59.08	58-85	81
82	81.78	61.55	61.38	61.10	60.88	80.87	60.45	60.24	80.03	59.81	62
88	62.77	62.54	62·32 63·31	62·09 63·07	61.86 62.84	61.65 62.68	81·48 62·40	81·21 62·18	60·99	60·77 61·74	63 64
64 66	63·77 64·76	63·53 64·58	64.80	84.06	68.83	83.61	63.38	63.15	82.98	62.70	65
66	65.76	65.52	65.29	65.04	64.81	64.68	64:35	84.18	58.89	63.67	86
87	86.75	66.21	66.27	66 03	55.79	85.58	65.33	65.10	64.86	64 63	67
68	67.75	67.50	67.26	87.02	66.77 87.75	66·54 87·52	66·80 57·28	86·07 87·04	65·83 68·80	85·60 66·56	68
69 70	58·75 69·74	88·50 69·49	68·25 69·24	68·01 88·99	68.74	68.20	68.25	68.01	07.77	67.53	70
71	70.74	70.48	70.23	69.98	69.72	69.48	69.23	68.98	68.74	68:49	71
72	71.74	71.48	71.22	70.96	70.70	70.48	70.20	89.95	69.71	69.46	72
73	72.73	72.47	72.21	71·95 72·93	71·59 72·68	71.44	71.18	70.93	70·67	70.42	73 74
74 76	73·73 74·72	73·46 74·45	78·20 74·19	73.92	73.65	73.89	73.13	72.87	72.61	72.35	75
76	75.72	75.45	75.18	74.90	74.63	74.37	74.10	73.84	73.58	73:32	76
77	75.72	78.44	76.17	75 89	76.61	75.85	75.08	74.81	74.55	74.28	77
78	77.71	77·43 78·42	77·15 78·14	76·87 77·86	76·59 77·58	76·38 77·31	76·05	75·78 76·75	75·51 76·48	75·25 75·21	78 79
79 80	78·71 79·70	79.42	79.13	78.85	78.50	78.28	78.00	77.73	77.45	77.18	80
81	80.70	80.41	80.12	79.88	79.54	79.26	78.98	78.70	78.42	78-14	81
82	81.69	81.40	81.11	80.82	80.62	80.24	79.95	79.67	79.89	79.11	82 83
88	82·69 83·69	82·89 88·89	82·10 88·09	81·81 82·79	81·51 82·49	81·22 82·20	80·93 81·90	80·64 81·51	80·35 81·32	80·07 81·04	84
84 85	84.68	84.38	84 08	83.78	83.47	88.17	82.88	82.58	82.29	82.00	85
86	85.88	85.87	85.07	84.75	84.45	84.15	83.85	88.55	83.26	82.97	86
87	86.88	86.87	86 06	85.75	85.43	85.13	84.83	84.53	84.23	83.93	87
88	87.67	87.88	87·05 88·04	88·73 87·72	85·42 87·40	86·11 87·09	85·80 86·78	85·50 86·47	85·20 86·16	84·90 85·86	88 89
89 90	88·67 89·67	88·35 89·34	89.02	88.70	88.38	88.07	87.75	87.44	87.13	85.82	90
91	90.86	90.34	90.01	89-89	89.38	89.05	88.73	88:41	88-10	87.79	91
92	91.88	91.33	91.00	90.67	90.34	90.08	89.70	89.38	89.07	88.75	92
93	92.66	92.32	91.99	91.66	91.33	91.01	90.68	90.38	90.03	89·72 90·68	98
94 95	98·85 94·65	93·31 94·31	92·98 93·97	92·84 93·63	92·31 93·29	92.96	92.68	92.30	91.97	91.65	95
98	95.85	95.80	94.98	94.81	94.27	93.94	93.60	98.27	92.94	92.61	96
97	96.84	95.29	95.95	95.60	95.25	94.92	94.58	94.24	93.91	93.57	97
98	97.64	97.28	96.93	96.58	96.24	95.90	95.55	95.21	94.87	94.54	98
99	98.64	98.27	97·92 98·91	97·57 98·56	97·22 98·20	96.87	96.58	96·18 97·15	95.84	95·60 95·47	100
100	99.83	99.41	20 91	00 00	20.20	", ""	1	1	""	""	100

TABLE 20—
I. Table for reducing the volumes of

							C IOI I		5 010		
0°.	11°.	12°.	13°.	14°.	15°.	16°.	17°.	18*.	19°.	20°.	0°.
1	0.961	0.958	0·955	0·951	0.948	0·945	0.941	0.938	0.935	0-982	1
2	1.923	1.916	1·909	1·903	1.896	1·889	1.883	1.876	1.869	1-864	2
3	2.884	2.874	2·864	2·654	2.844	2·834	2.824	2.815	2.805	2-795	3
4	3.845	3.832	3·818	8·805	3.792	8·779	3.766	3.753	3.740	3-727	4
5	4.807	4.790	4·773	4·757	4.740	4·724	4.707	4.691	4.675	4-659	5
6	5·768	5·747	5·728	5·708	5·688	5·668	5 648	5·629	5.609	5·591	6
7	6·729	6·705	6·682	6·659	6·636	6·613	6 590	6·567	6.544	6·528	7
8	7·690	7·663	7·637	7·610	7·584	7·558	7 581	7·506	7.479	7·454	8
9	8·652	8·621	8·591	8·562	8·532	8·502	8 472	8·444	8.414	8·386	9
10	9·613	9·579	9·546	9·518	9·480	9·447	9 414	9·882	9.349	9·318	10
11	10·67	10·58	10·50	10·46	10·43	10·39	10·85	10·32	10·28	10·25	11
12	11·53	11·49	11·45	11·42	11·38	11·83	11·30	11·26	11·21	11·18	12
13	12·49	12·45	12·41	12·36	12·32	12·28	12·24	12·20	12·15	12·11	13
14	18·45	13·41	13·36	13·81	13·27	13·22	18·17	13·13	13·08	13·04	14
14	14·42	14·87	14·32	14·27	14·22	14·17	14·12	14·07	14·02	18·97	15
16	15-88	15·82	15·27	15·22	16·17	15·11	15.06	16.01	14.96	14·91	16
17	16-34	16·28	16·23	16·17	16·12	16·06	16.00	15.95	15.89	15·84	17
18	17-30	17·24	17·18	17·12	17·06	17·00	16.94	16.89	16.82	16·76	13
19	18-26	18·20	18·14	18·07	18·01	17·95	17.89	17.83	17.76	17·70	19
20	19-28	19·16	19·09	19·08	18·96	18·89	18.83	18.76	18.69	18·64	20
21	20·19	20·12	20·04	19.93	19·91	19-84	19.77	19·70	19·62	19·57	21
22	21·16	21·08	21·00	20.93	20·86	20-78	20.71	20·64	20·56	20·50	22
23	22·11	22·03	21·95	21.88	21·30	21-78	21.65	21·58	21·50	21·43	23
24	23·07	22·90	22·91	22.83	22·75	22-67	22.69	22·51	22·43	22·37	24
25	24·03	23·95	23·86	23.78	23·70	23-61	23.54	23·45	23·37	23·30	26
26	25.00	24·91	24·81	24.78	24.65	24·56	24·48	24·39	24·30	24·23	26
27	25.96	25·87	25·77	25.69	25.60	25·50	25·42	25·38	26·28	25·16	27
28	26.92	26·82	26·72	26.64	26.64	26·46	26·36	26·27	26·17	26·09	28
29	27.88	27·78	27·68	27.69	27.49	27·89	27·30	27·20	27·10	27·02	29
30	28.84	28·74	28·64	26.54	28.44	28·34	28·24	28·15	28·05	27·95	30
81	29·80	29·70	29·59	29·49	29-89	29·28	29·18	29·09	28-99	26.87	31
82	30·76	30·66	80·55	30·44	80-34	80·23	80·12	80·08	29-92	29.81	32
83	31·72	31·61	81·50	81·89	81-28	31·17	31·06	30·97	30-86	30.74	33
34	32·68	32·57	32·46	32·34	82-28	82·12	32·91	81·90	31-79	31.68	34
35	83·65	83·53	83·41	83·80	83-18	33·06	32·95	82·84	32-73	32.61	35
36	84·61	34·49	84·37	34·25	\$4·13	84·01	88-89	33·78	\$3.66	33·54	36
87	85·57	85·46	86·32	86·20	\$5·08	84·95	84-83	34·72	\$4.59	84·47	37
38	86·68	86·40	36·28	36·15	\$6·02	85·90	85-77	35·66	\$5.53	36·40	38
39	87·49	87·36	87·23	87·10	\$6·97	86·84	86-71	36·59	\$6.46	36·34	39
40	88·45	38·82	88·18	33·05	\$7·92	87·79	87-66	37·68	\$7.40	87·27	40
41	89·41	89·28	89·14	39.00	38·87	38·73	38·60	36·47	38·34	88·20	41
42	40·87	40·24	40·09	89.95	89·82	89·68	89·54	39·41	89·27	89·18	42
43	41·38	41·19	41·05	40.90	40·76	40·62	40·48	40·35	40·21	40·07	48
44	42·80	42·15	42·00	41.86	41·71	41·57	41·43	41·28	41·14	41·00	44
45	43·26	43·11	42·95	42.81	42·66	42·51	42·87	42·22	42·08	41·98	45
46	44·29	44.07	43·91	43·76	48·61	48·40	48.81	43·16	43.01	42.86	46
47	45·18	45.08	44·86	44·71	44·56	44·40	44.25	44·10	43.04	48.79	47
48	46·14	45.98	46·82	45·66	45·50	46·85	45.19	45·04	44.88	44.72	48
49	47·10	46.94	46·77	46·61	46·45	46·29	46.18	45·97	45.81	45.66	49
60	48·07	47.90	47·73	47·57	47·40	47·24	47.07	46·91	46.75	46.59	50

Continued. gases to a temperature of 0° C. - Continued.

0°.	11°.	12*.	18°.	14°.	15°.	16*.	17°.	18°.	19°.	20°.	0•.
51	49.08	48.36	46.69	48.52	48.35	48.18	48.01	47:65	47.68	47.52	51
52	49.99	49.82	49-64	49.47	49.30	49.13	48.95	48.79	48.62	48:45	52
53	50.95	50.77	58.59	50.42	50.24	58.07	49.89	49.72	49.55	49.36	58
54	51.01	51.78	51.55	51.37	51.19	51.02	50.54	59.66	50.49	60.32	64
55	52.87	52.69	52.50	52.83	62.14	61.96	61.78	51.60	51.43	51.25	56
		1	58:46	58.28					52:86	62.18	56
56	53.84	53·65 54·61	54.41	54.28	53·09 54·04	52·91 53·86	52.72	52·54 53·48	58.29	58.71	67
57	54.80		65.37	55.18	54.98		58.66	54.42	54.23	54.04	58
58	455.76	55·56 56·52	56.32	56.13	65.93	54 ·80 55·74	54·60 55·54	55.35	55.16	54.97	59
59 60	56·72 57·68	57.47	57.28	57.08	56.88	56.68	66.48	56-29	56.09	55.91	60
		56.43	58.23	58-08	57.83	57.63	57.42	67:23	57.02	56.84	61
61	58.64	59.39	59.19	58.98	58.78	58.57	58-36	58-17	57.06	57.77	62
62	59.60	60.36	60.14	59.98	59.72	59.52	69.80	59.11	58.90	58.71	63
63	60.56	61.31	61.10	60.88	60.67	60.46	60 25	60.04	59-83	59.64	64
64 65	61.58	62.26	62.05	61.84	61.62	61.40	61.19	60.98	60.77	60.57	65
	1	1	1			l		az-00	61.70	63.50	66
66	63.45	68.22	63.01	62.79	62.57	62.35	62.13	61.92	62.63	61.59	67
67	64.41	64.18	63.96	68.74	68.52	63.29	63.97	62.86	63.57	63.36	68
68	65.37	65.18	64·92 65·87	64·69 65·64	64·46 65·41	64·23 65·18	64·01 64·95	68.80	64.50	64.30	69
69	66.33	66·09 67·05	66.82	66.29	66.36	66.18	65.90	65.67	65.44	65.23	70
70	67.29	01.00	00 02	00.99	00.50	00.19	00 90	05 01	ļ		
71	68:25	68.01	67.77	67.54	67:31	67:07	66.84	66.61	66.88	66.16	71
72	69.21	68-97	68.73	68.49	68-26	68-02	67.78	67.55	67:31	67:09	72
73	70.17	69-92	69 68	69.44	69.20	68.96	68.72	66.49	66.26	68-03	73
74	71.14	70.88	70 64	70.40	70.15	69.91	69-66	69.42	69-18	68.96	74
75	72.10	71.84	71-59	71.35	71.10	70.85	70.61	70.37	70-12	69.89	75
76	78.06	72:80	72-65	72.80	72.05	71-80	71.55	71.30	71.05	70.82	76
77	74.02	73.76	73.51	78-25	78.00	72.74	72.49	72.24	71.98	71.75	77
78	74.98	74.71	74.46	74.20	78.94	73.69	73.43	73.18	72.92	72.68	78
79	75.94	75.67	75.41	75.15	74.89	74.63	74.37	74.11	73.85	73.61	79
80	76.90	76.63	76.37	76.10	75.84	75.58	75.81	75.06	74.79	74.54	80
81	77.86	77.59	77:32	77:05	76-79	76-52	76.25	76:00	75-73	75.47	81
82	78.82	78.55	75.28	78.00	77.74	77:47	77.19	76.94	76.66	76.40	82
83	79.78	79.50	79-23	78.95	78.68	78.41	78.13	77.87	77:60	77.34	83
84	80.75	80.46	86.19	79.91	79.63	79.85	79.08	78-81	78 58	78.27	84
85	81.71	81.42	81.14	80.86	80.58	80.80	80.02	79.75	79.47	79-20	85
86	82.67	82:38	82.10	81.81	81.53	81.24	80.96	80.69	80.40	80.13	86
87	83.63	88.83	63.05	82.76	82.48	82.19	61.90	81.63	81.33	81.06	87
88	84.59	84.29	84.01	83.71	63.42	83.18	82.84	82.57	82.27	81.99	88
89	85.26	85 25	84.96	64.66	84.87	84.08	88.76	83.50	63-22	82.93	69
90	86.52	36.21	85.92	85.62	85.32	85-02	84.72	84.44	84.14	83.86	90
91	87:48	87-17	86.87	86.57	86.27	85-96	85.66	85-36	85.07	64.79	91
92	86.44	80.13	87.83	67.52	87.22	86.91	86.60	86.32	86.01	85.72	92
93	89.40	\$9.08	88.78	88-47	68-16	87.85	87.64	87.26	86.95	86.66	93
94	90.86	90.64	89.78	89.42	89.11	86.80	88.49	88 19	87 88	87 59	94
95	91.33	91.00	90.68	90.38	90.08	89.74	89.43	89.13	86.82	68-62	05
00	1	91.96	91.64	91-83	91-01	90-69	90.37	90.07	89-75	69.45	96
96	92.29	92.92	92.59	92.28	91.96	01.63	91.81	01.00	90.68	90-88	97
97	98.25	93-87	93.56	93.23	92.90	92-58	92.25	91.04	91.62	91.81	08
98	94.21	04.83	04.50	94.18	93.65	93.52	93.19	92.86	92.55	02-24	99
100	95.17	96.70	95.46	95.13	94.80	04.47	94.14	93.82	93.49	93.13	100
	96.13	1 20 10	1 00 20	00 20	1 0 - 00	1	1 -		1	1	

TABLE 20—
I. Table for reducing the volumes of

0°.	21°.	22°.	23°.	24°.	25°.	26°.	27°.	28°.	29°.	0°.
1	0·929	0·926	0·922	0·919	0·916	0·913	0.910	0·907	0·904	1
2	1·857	1·851	1·845	1·839	1·832	1·826	1.820	1·814	1·808	2
3	2·786	2·777	2·767	2·758	2·749	2·739	2.730	2·721	2·712	3
4	3·714	3·702	3·690	3·677	3·665	3·652	3.640	3·628	3·616	4
5	4·643	4·628	4·612	4·697	4·581	4·566	4.551	4·636	4·520	5
6	5-672	6·553	5·534	5·516	5·497	5-479	5:461	5·442	5·424	6
7	6-500	6·479	6·457	6·435	6·413	6-392	6:371	6·349	6·328	7
8	7-429	7·404	7·379	7·354	7·330	7-305	7:281	7·256	7·232	8
9	8-357	8·330	8·302	8·274	8·246	8-218	8:191	8·163	8·136	0
10	9-286	9·255	9·224	9·193	9·162	9-131	9:101	9·070	9·040	10
11	10·21	10·18	10·15	10·11	10·07	10·04	10·01	9·98	9·94	11
12	11·14	11·11	11·07	11:03	10·99	10·96	10·92	10·88	10·85	12
13	12·07	12·03	11·99	11·95	11·91	11·87	11·83	11·79	11·75	13
14	13·00	12·96	12·91	12·87	12·83	12·78	12·74	12·70	12·66	14
15	13·93	13·88	13·84	13·79	13·74	13·70	13·65	13·61	13·56	15
16	14·86	14·81	14·76	14.71	14.66	14·61	14·56	14·51	14·46	16
17	15·79	15·73	15·68	15.63	15.58	15·52	15·47	15·42	15·37	17
18	16·71	16·66	16·60	16.55	16.49	16·44	16·38	16·33	16·27	18
19	17·64	17·58	17·53	17.47	17.41	17·35	17·29	17·23	17·18	19
20	18·57	18·51	18·45	18.39	18.32	18·26	18·20	18·14	18·08	20
21	19·50	19·43	19·37	19·31	19·24	19·17	19·11	19·05	18:98	21
22	20·43	20·36	20·29	20·23	20·16	20·09	20·02	19·96	19:89	22
23	21·36	21·29	21·21	21·15	21·07	21·00	20·93	20·86	20:79	23
24	22·28	22·21	22·14	22·07	21·99	21·91	21·84	21·77	21:70	24
26	23·21	23·14	23·06	22·99	22·90	22·83	22·76	22·68	22:60	25
26	24·14	24·06	23·08	23·91	28-82	23.74	23·66	23·58	23·50	26
27	25·07	24·99	24·90	24·83	24-73	24.65	24·57	24·49	24·41	27
28	26·00	25·91	25·82	25·74	25-65	25.57	25·48	25·40	25·81	28
29	26·93	26·84	26·75	26·67	26-57	26.48	26·39	26·30	26·22	29
80	27·86	27·77	27·67	27·58	27-49	27.39	27·30	27·21	27·12	30
81	28·79	28·70	28.69	28:50	28·41	28·30	28-21	28·12	28·02	31
32	29·72	29·62	29.51	29:42	29·32	29·22	29-12	29·02	23·93	32
33	30·65	30·55	30.44	30:34	30·24	30·13	30-03	29·93	29·83	33
34	31·57	31·47	31.36	81:26	31·16	31·04	30-94	30·84	30·74	34
35	82·50	32·40	32.28	32:18	32·07	31·96	31-85	81·75	31·64	35
36	33·43	33·32	33·20	38·10	82-99	32·87	\$2.76	\$2.65	82.54	86
37	34·36	34·25	84·12	34·02	33-90	83·78	\$3.67	33.56	33.45	37
38	35·29	35·17	35·05	84·93	34-82	34·70	\$4.58	34.47	34.35	38
39	86·22	36·10	85·97	35·85	85-74	35·61	\$5.49	35.47	35.26	39
40	37·14	37·02	36·90	36·77	36-65	36·52	\$6.40	36.28	36.16	40
41	38·07	37.95	87·82	37·69	37·67	87:43	37·31	37·19	37·06	41
42	39·00	38.87	38·74	88·61	38·48	38:35	88·22	38·09	37·97	42
43	89·93	39.80	39·60	89·53	39·40	89:26	39·13	39·00	38·87	48
44	40·85	40.72	40·59	40·46	40·32	40:17	40·04	39·91	39·78	44
45	41·78	41.65	41·51	41·37	41·23	41:09	40·95	40·82	40·68	45
46	42·71	42:57	42:43	42·29	42.16	42:00	41.86	41.72	41.58	46
47	43·64	43:50	43:35	43·21	43.06	42:01	42.77	42.63	42.49	47
48	44·67	44:42	44:27	44·12	43.98	48:83	43.68	43.54	43.39	48
49	45·50	45:35	45:19	45·04	44.89	44:74	44.59	44.44	44.30	49
50	46·43	46:28	46:12	45·97	45.81	45:66	45.51	45.35	45.20	60

Continued. gases to a temperature of 0° C .- Continued.

0°.	21°.	22°.	28°.	24°.	25°.	26°.	27°.	28°.	29°.	0°.
51	47.86	47·20	47.04	46.89	46.78	46.67	46·42	46·26	48·10	81
52	48.29	48·13	47.98	47.81	47.64	47.49	47·83	47·16	47·01	52
63	49.22	49·06	48.89	48.78	48.66	48.40	48·24	48·07	47·91	58
64	50.14	49·98	49.81	49.66	49.48	49.31	49·15	48·98	48·82	54
55	61.07	50·91	50.78	50.57	50.89	50.28	60·06	49·89	49·72	55
58	62:00	61.88	61.65	51·49	51·31	51·14	50.97	50·79	50 ·62	56
57	52:93	52.76	52.58	52·41	52·22	52·05	61.88	51·70	51 ·53	57
68	53:86	58.68	53.60	58·32	53·14	52·97	52.79	52·81	52 ·43	58
69	64:79	64.61	54.42	54·24	54·08	53·88	53.70	68·61	63 ·34	59
60	55:72	55.53	55.34	55·16	54·97	54·79	64.61	64·42	54 ·24	60
61	66.65	56.46	68.26	56.08	56.89	65.70	55.62	66.88	55·14	61
62	57.58	57.38	67.19	67.00	66.80	66.62	56.48	56.28	58·05	82
63	68.51	68.31	58.11	67.92	57.72	67.58	57.34	57.14	56·95	68
84	59.42	59.23	59.03	58.84	58.64	58.44	58.25	58.05	57·86	64
66	60.86	60.16	59.96	59.75	59.56	69.36	59.16	58.96	58·76	65
66	61·29	61.08	50.87	60.68	60·47	60.27	60.07	59.86	59.66	66
87	62·22	62.01	61.79	51.60	61·38	61.18	60.98	60.77	60.57	67
68	63·15	62.98	62.72	62.51	62·30	62.10	61.89	61.68	61.47	68
69	64·08	53.85	68.64	63.43	63·22	63.01	62.80	62.58	62.38	59
70	65·00	64.79	64.57	64.35	64·13	63.92	63.71	63.49	68.28	70
71	65.98	65·71	65*49	65.27	65.05	64.88	64·62	54-40	64·18	71
72	66.86	66·64	66*42	66.19	65.96	65.75	65·53	65-30	65·09	72
78	67.79	67·57	67*84	67.11	66.88	66.68	56·44	66-21	65·99	73
74	68.61	68·49	68*26	68.03	67.80	67.67	67·35	67-12	66·90	74
75	69.64	69·42	69*18	68.95	68.71	68.49	68·26	68-03	67·80	75
76	70·57	70·84	70·10	69·87	69.63	69:40	69·17	58·93	68·70	76
77	71·50	71·27	71·03	70·79	70.54	70:31	70·08	59·84	69·61	77
78	72·43	72·19	71·96	71·70	71.45	71:22	70·99	70·75	70·51	78
79	73·88	78·12	72·87	72·62	72.38	72:14	71·90	71·65	71·42	79
80	74·29	74·04	73·79	73·54	73.80	73:05	72·81	72·56	72·32	80
81	75·22	74·97	74·71	74·46	74·22	78·98	73·72	73·47	78·22	81
82	76·15	75·89	75·68	75·38	75·18	74·88	74·63	74·37	74·18	82
88	77·08	76·82	76·56	76·30	76·05	75·79	75·64	75·28	75·08	83
84	78·00	77·74	77·48	77·22	76·96	76·70	76·45	76·19	75·94	84
85	78·93	78·67	78·40	78·14	77·88	77·62	77·36	77·10	75·84	85
86	79.88	79.69	79·82	79.08	78·80	78.53	78·27	78.00	77·74	86
87	80.79	80.52	80·25	79.98	79·71	79.44	79·18	78.91	78·65	87
88	81.72	81.44	81·17	80.90	80·63	80.86	80·09	79.82	79·55	88
89	82.65	82.87	82·09	81.82	81·55	81.27	81·00	80.72	80·46	89
90	83.57	83.30	83·02	82.74	82·46	82.18	81·91	81.63	81·36	90
91	84·50	84·22	83.94	83.66	88:38	88.09	82·82	82·54	82·26	91
92	85·43	85·15	84.86	84.58	84:29	84.01	83·78	83·44	83·17	92
93	86·38	86·08	86.79	85.50	85:21	84.92	84·84	84·35	84·07	93
94	87·28	87·00	86.71	86.42	86:13	85.83	85·55	85·26	84·98	94
96	88·21	87·93	87.63	87.34	87:04	86.75	86·46	86·17	85·88	9č
96	89·14	88-85	98·55	88·26	87.98	87.56	87:37	87.07	86.78	96
97	90·07	89-78	89·48	89·18	88.87	88.57	88:28	87.98	87.69	97
98	91·00	90-70	90·40	90·09	89.79	89.48	89:19	88.89	88.59	98
99	91·93	91-63	91·32	91·01	90.71	90.40	90:10	89.79	89.50	99
100	92·86	92-56	92·24	91·93	91.62	91.31	91:01	90.70	90.40	100

TABLE 20-Continued. II. Table for reducing the

Deduct from the barometric pressure 1 mm, for temperature between 0° and 12° for the expansion

								_				
	760	710	712	714	716	718	720	722	724	726	728	760
	1 2	0.934 1.868	0.937	0.940 1.879	0.942 1.884	0.945	0.947 1.895	0.950	0·953 1·905	0.955	0-958 1-916	1 2
	3	2.803	2.810	2.818	2.826	2.834	2.842	2.850	2.858	2.866	2.874	3
	4	3.738	3.747	3.758	3.768	3.779	3.789	3.800	3.810	3.821	3.832	4
	5	4.672	4.885	4.697	4.711	4.724	4.736	4.760	4.763	4.777	4.790	5
	6	5.607	5.621	5.837	5.653	5.669	5.684	5.700	5.716	5 732	5.747	6
	8	6.540 7.474	6.558 7.494	6.577	6.595	8.614	6.631	6-650	6.668	6-637	6.706	7
	ĝ	8.409	8.431	7.516 8.458	7·537 8·479	7·558 8·503	7·578 8·526	7·600 8·550	7.621 8.573	7:642 8:598	7.663 8.621	8 9
	10	9.34	9.87	9.40	9.42	9.45	9.47	9.50	9.53	9.55	9.58	10
	11	10-28	10.31	10.84	10.88	10-39	10.42	10.45	10.48	10.51	10.54	11
	12 13	11.21	11.24	11.27	11.30	11.34	11:37	11.40	11.43	11.46	11.20	12
j	14	12.14	12.18	12·21 13·16	12·24 13·19	12·28 13·23	12·31 13·26	12·35 13·80	12·38 13·34	12.41	12.45	13
	15	14.02	14.06	14.10	14.13	14.17	14.21	14.25	14.29	13·37 14·33	13·41 14·37	14 15
			'			1		11 20		14 30	17 01	10
	16	14.95	14.99	15.03	15.07	15.11	15.15	15.20	15.24	15-28	15.33	18
1	17 18	15.88 16.82	15·93 16·87	15.98 16.92	18·02 16·96	16·06 17·01	16·10 17·06	16.15	16.19	16.53	16.28	17
1	19	17.76	17.81	17.86	17.90	17.95	18.00	17·10 18·05	17·15 18·10	17·19 18·15	17·24 18·21	18 19
	20	18.68	18.74	18.79	18.84	18.90	18-95	19.00	19.05	19.11	19.16	20
	21	19.62	19-68	19.73	19.78	19.84	19-90	19.95	20.00	20.06	20 12	21
1	22 23	20.55	20.61	20.67	20·72 21·66	20.78	20·84 21·79	20.90	20·96 21·91	21.01	21.07	22
١	24	22.43	22-49	22.55	22.61	21·73 22·68	22.74	21.85	22.86	21·97 22·92	22.03	23 24
	25	23.35	23.42	23.49	28.55	23.62	23.69	28.75	23.81	23.88	23.95	25
	26	24.29	24.36	24.48	24.50	24.57	24.64	24.70	24.77	24 83	24-90	26
1	27 28	25·28 26·18	25·30 26·28	25.87	25·44 26·37	25·51 26·45	25·58 26·53	25·65 26·60	25·72 26·67	25·79 26·74	25.86	27
ı	29	27.10	27.17	27.24	27.81	20.40	27.48	27.55	27.62	26.74	26·82 27·73	28 29
ı	30	28-03	28.10	28.18	28.26	28.34	28.42	28.50	28.58	28-66	28.74	30
	31 32	28·97 29·90	29·04 29·98	29·12 30·06	29·20 30·14	29-29 30-23	29·37 30·32	29·45 80·40	29·53 30·48	29.82	29.70	31
١	33	30.83	30.91	31.00	31.08	31.17	31.26	81.85	30°48 31°43	30·57 31·52	30·68 31·61	32 33
١	34	81.77	31.85	81.94	32.03	32.12	82.21	82-30	82.39	32.48	32.57	84
l	85	32.71	32.79	32.88	32.97	33.07	89.16	33.25	33.84	88-44	38-53	35
1	86	33 64	38.79	33 82	33-91	34.01	84.10	34.20	84-29	84.39	84.49	36
İ	87	34.57	34.66	34.76	84.86	34.96	35.02	35.15	85-25	85.35	35.45	37
ļ	3 8	35·50 36·44	85·60 86·54	85·70 36·64	35·80 36·74	85.90	86·00 86·95	85.10	86.20	86.30	36.40	36
!	40	37.38	87.48		37.68	36·85 37·79	87.89	87·05 86·00	37·15 38·10	37·26 33·21	37·37 38·32	89 40
	41	38-31	88-41		38-62	38.74	38-84	38.95	89.05	39.17	89-28	41
	42 43	39·23 40·13	39·35 40·29		39.57		89-79	39.90	40.01	40.12	40-28	42
1	44	41.11		41.84		40.62 41.58	40.78 41.68	40.85	40·95 41·91	41.08	41.19	43
	45	42.05	42.16				42.63	42.75		42·03 42·99	42·16 48·11	44 45
	46 47	42.98 48.91									44.08	46
	48	44.84									45.08	47
	49										45 98 46 94	48 49
	50	46.72	45.85	46-97	47·11	47-24					47.90	50
_			!		1		_			1		-

volumes of gases to a pressure of 760 mm.

C., and 2 mm. between 13° and 19° C., 3 mm. between 20° and 25° C., to compensate of mercury.

760	710	712	714	716	718	720	722	724	726	728	76
61	47.66	47.79	47-92	48.05	48.18	48.31	48-45	48.59	48.73	48.86	51
52	48.53	48.72	48.85	48.99	49.13	49.26	49.40	49.54	49.68	49.82	52
53	49.52	49.56	49.79	49.93	50.07	50.21	50.35	50.48	50.64	50.78	58
54	50.45	50.59	50.73	50.87	51.01	51.15	51.30	51.44	51.59	51.73	54
65	51.33	61.53	51.67	51.82	51.96	52.10	52.25	52.39	62.54	52-69	55
66	62:32	52.47	52.61	52.78	52.91	6 3·0 5	53.20	58.35	58-50	58.66	66
57	53-25	63.41	68.65	58.70	5 3 -85	54.00	54.15	54.30	54.45	54.60	57
58	54.19	54.34	64.49	54.64	54.79	54.94	55.10	55.25	55.41	65.56	58
59	55.13	55.28	65.48	55.59	55.74	56.89	66.05	66.21	56.37	58.52	59
60	56.07	56.22	66.87	56.63	66.69	56.84	57.00	57.16	57.32	67.47	60
61	57:00	57.15	57:31	57.47	57.63	67.79	67-95	58-11	58-27	58.48	61
62	67.93	58.09	58.25	58-41	58.58	58.74	58-90	59.06	59.23	59.39	62
63	58.87	59.03	59.19	59-35	59.52	59.68	59.85	60.01	60.18	60-35	68
64	59.80	59.96	60 13	60.30	60.47	60.68	60.80	60.97	61.14	61.30	64
65	60.74	60.90	61.07	61.24	61.41	61.58	61.75	61.92	62.09	62.26	65
66	61.67	61.84	62.01	62.18	52·3 5	62.52	62.70	62.87	63.05	63.22	66
67	62.60	62.77	62.96	63.12	68.30	63.47	6 3 *65	63.82	64.00	64.18	67
58	68.64	63.71	63.89	64.06	64.24	64.42	64.60	64.78	64.96	65.18	68
69	64.47	64.65	64.83	66.01	65.19	65 37	65 56	65.78	65.91	66.09	69
70	65.40	63.28	65.77	65-95	66.14	66.32	66.60	66.68	66-87	67.05	70
71	66.84	66-52	66.71	66 89	67-08	67-26	67.45	67-63	67.82	68-01	71
72	57.27	67.46	67.65	67.83	63.02	68-21	58.40	68.59	68.78	68.97	72
78	68.20	68.39	68.68	68.77	63.97	69:16	69.35	69.54	69.73	69.92	73
74	69 14	69.33	59 5 3	69.72	69.92	70.11	70:30	70.49	70-69	70.88	74
75	70.07	70.27	70.47	70.66	70.86	71.05	71.25	71-44	71.64	71.84	76
76	71.01	71.21	71.41	71.60	71.80	72.00	72-20	72.40	72-60	72.80	76
77	71 94	72.14	72 34	72.54	72.75	72.95	73.15	78.35	73.55	73.75	77
78	72.87	73 07	73.28	73.48	73 69	73.89	74 10	74 30	74.51	74.71	78
79	73.80	74.01	74.22	74.42	74 63	74.84	75.05	75 25	75.46	76.67	79
80	74.74	74.94	75-16	75.87	75.68	75.78	76.00	76.21	76.42	76.63	80
81	75.67	75 88	76.10	76 31	76.63	76.74	76.95	77 16	77:37	77.58	81
82	76.60	76.82	77.04	77.25	77.47	77 68	77.90	78.11	78:33	78.54	82
83	77.64	77.76	77.98	78.19	78 41	78.63	78.85	70.07	79 28	79.50	83
84	78.47	78.69	78.91	79.18	79.35	79.57	79.80	80.02	80.24	80.46	84
85	79.41	79.63	79.88	80.08	80.31	80.23	80.75	80.97	81.19	81.41	85
86	80.34	80.57	80-80	81.02	81.25	81.47	81.70	81 92	82.15	82.37	86
87	81.28	81.60	81.74	81.96	82.19	82.42	82.66	82.87	83.10	83.33	87
88	82.21	82-44	82-68	82.90	83.13	88.86	83.60	83*83	84.06	84 20	88
89	83.15	83-33	88.62	83.85	84.08	84.31	84.55	84.78	85.02	85.25	89
90	84.09	84.81	84.56	84.79	85.03	85.26	85.20	85.73	85-98	86.21	90
91	85.02	85.25	85.50	85.78	85.98	86.21	86-45	86 69	86 93	87.17	91
92	85.05	86.19	86.44	86.68	86.92	87.18	87.40	87.64	87 89	88.18	92
93	86.89	87.12	87.38	87.62	87.87	88.11	88.85	88.59	88.84	80.08	93
94	87.82	88.06	88.32	88.66	88.81	89.05	89.30	89.54	89.80	90.04	94
95	88.76	89.01	89-26	89.50	89.75	90.00	90.25	90.50	90.75	91.00	95
96	89.69	89.94	90.20	90.45	90.70	90.95	91.20	91.45	91.70	91.95	96
97	90.62	90.87	91.13	91.38	91.64	91.89	92.15	92.40	92.66	92.91	97
98	91.56	91.82	92.07	92.33	92.59	92.84	83.10	98.85	93.62	93.87	98
99	92.49	92.75	93.01	98.26	93.53	93.79	94 05	94.81	94.57	94.88	99
	98.42	93.68	98.95	94.21	94.47	94 74	95-00	95.26	95.58	95.79	100

44 THE TECHNICAL CHEMISTS' HANDBOOK

TABLE 20-Continued. II. Table for reducing the

760	730	732	734	736	738	740	742	744	746	748	760
1	0.961	0.963	0.966	0.968	0.971	0.974	0.976	0.979	0.982	0.984	1
2	1.921	1.926	1.932	1.937	1.942	1.947	1.953	1.958	1.963	1.968	2
3	2.882	2.889	2.898	2.905	2.913	2.921	2.929	2.937	2.945	2.953	3
4	3.842	3.852	3.864	3.874	3.884	3.895	3.905	3.916	3.926	3.937	4
5	4.803	4.816	4.830	4.842	4.855	4.868	4.882	4.895	4.908	4.921	5
6	5·763	6·779	5·796	5·810	5·826	5·842	5·858	5.874	5·890	5·905	6
7	6·724	8·742	6·762	6·779	8·797	6·818	8·834	8.853	6·871	6·889	7
8	7·684	7·705	7·728	7·747	7·768	7·790	7·810	7.832	7·853	7·874	8
9	8·645	8·668	8·693	8·718	8·739	8·763	8·767	8.811	8·834	8·858	9
10	9·61	9·83	9·66	9·68	9·71	9·74	9·76	9.79	9·82	9·84	10
11	10·57	10.59	10.62	10.65	10.68	10.71	10.74	10·77	10·80	10·82	11
12	11·53	11.56	11.59	11.62	11.65	11.68	11.71	11·75	11·78	11·81	12
13	12·49	12.52	12.55	12.59	12.62	12.68	12.69	12·73	12·76	12·79	13
14	13·45	13.48	13.52	13.56	13.59	13.63	13.66	13·70	13·74	13·78	14
15	14·41	14.44	14.48	14.52	14.56	14.60	14.64	14·69	14·73	14·77	15
18	15.87	15:41	15:45	15·49	15·53	15.58	15.82	15.67	15.71	15.75	16
17	16.33	16:37	16:41	16·46	18·50	18.55	16.80	16.65	16.69	16.73	17
18	17.29	17:33	17:38	17·43	17·47	17.52	17.57	17.62	17.67	17.72	18
19	18.25	18:29	18:35	18·40	18·45	18.50	18.55	18.60	18.65	18.70	19
20	19.21	19:26	19:32	19·87	19·42	19.47	19.58	19.58	19.68	19.68	20
21	20·17	20·22	20·28	20·34	20·39	20:44	20·50	20.58	20·61	20.68	21
22	21·13	21·19	21·25	21·31	21·36	21:42	21·48	21.54	21·59	21.85	22
23	22·09	22·15	22·21	22·27	22·33	22:39	22·45	22.51	22·57	22.84	23
24	23·05	23·11	23·18	23·24	23·30	23:36	23·43	23.50	23·58	23.83	24
25	24·01	24·07	24·14	24·21	24·27	24:34	24·41	24.48	24·54	24.61	25
28	24.97	25.04	25·11	25·18	25·24	25·31	25.88	25·46	25·52	25·59	26
27	25.93	26.00	26·07	26·14	26·21	26·28	26.36	26·43	26·50	26·58	27
28	26.89	26.98	27·04	27·12	27·18	27·26	27.33	27·41	27·48	27·56	28
29	27.85	27.92	28·00	28·08	28·15	28·23	28.31	28·39	28·47	28·55	29
80	28.82	28.89	28·97	29·05	29·13	29·21	29.29	29·37	29·45	29·53	30
81	29·78	29·86	29.94	30·02	30·10	30·18	30·26	30·35	30·43	30·51	31
82	30·74	30·82	30:91	80·99	31·07	31·15	31·24	31·33	31·41	31·50	32
33	31·70	31·78	31.87	31·96	32·04	32·13	32·21	82·30	32·39	32·48	33
34	\$2·66	32·75	32.84	32·93	33·01	83·10	83·19	33·28	33·37	33·46	34
35	33·62	33·71	33.80	33·89	33·98	34·07	34·17	84·27	34·36	84·45	35
36	34·58	34.67	34·77	34.86	84·95	35·05	35·15	35·25	35·34	85·43	36
37	35·54	35.83	35·73	35.83	85·92	36·02	36·12	36·22	36·32	36·42	37
38	36·50	36.60	36·70	36.80	86·90	37·00	37·10	37·20	37·30	87·40	38
39	37·47	37.57	87·87	37.77	87·87	37·97	38·07	38·18	38·28	38·39	39
40	88·42	38.52	38·84	38.74	88·84	\$8·95	39·05	39·18	39·26	39·37	40
41	39·38	99·48	39.60	89.71	39·81	89·92	40.02	40·14	40·24	40·38	41
42	40·34	40·44	40.56	40.88	40·78	40·89	41.00	41·12	41·22	41·34	42
43	41·30	41·41	41.53	41.84	41·75	41·86	41.97	42·10	42·20	42·32	48
44	42·27	42·38	42.50	42.62	42·73	42·84	42.95	43·07	43·18	43·30	44
45	48·22	48·34	43.46	43.58	43·69	43·81	43.93	44·06	44·17	44·29	45
46	44.18	44:30	44·42	44.54	44.68	44.78	44.90	45.08	45·15	45·27	48
47	45.15	45:28	45·39	45.52	45.64	45.76	45.88	46.01	46·18	46·26	47
48	48.10	48:23	46·36	48.49	46.81	48.73	46.85	46.99	47·12	47·24	48
49	47.08	47:19	47·32	47.44	47.57	47.70	47.83	47.97	48·10	48·23	49
50	48.03	48:18	48·80	48.42	48.55	48.68	48.82	48.95	49·08	49·21	50

volumes of gases to a pressure of 760 mm.—Continued.

760	780	732	734	786	788	740	742	744	746	748	760
51	48.99	49·12	49.26	49.89	49.52	49.65	49.79	49.98	50.06	50·19	61
52	49.96	50·08	50.22	50.86	50.49	60.68	60.77	50.91	61.04	51·18	52
58	50.91	61·05	51.19	51.83	51.46	51.60	61.75	51.89	52.02	52·16	68
64	51.87	52·01	52.16	52.30	52.44	52.58	62.72	52.87	53.01	58·15	54
55	52.88	52·98	68.13	63.27	58.41	53.56	63.70	53.86	63.99	54·14	55
56	53·79	53.94	54.09	54·28	54.87	54·52	54.68	54.83	54.97	65·11	56
57	64·75	54.90	55.06	55·20	55.36	55·50	55.65	55.80	55.95	66·10	57
58	55·71	55.86	56.02	66·17	56.82	56·47	66.63	56.78	56.98	57·08	58
59	56·67	56.83	66.99	57·14	57.29	57·44	57.60	57.76	57.92	58·07	59
60	57·63	57.79	57.95	58·10	58.26	58·42	58.53	58.74	58.90	59·05	60
61	58.59	58·75	58.91	59·07	59·23	69-89	59·56	69.72	59.88	60.04	61
62	59.55	59·72	59.88	60·04	60·20	60:36	60·63	60.70	60.86	61.02	62
63	60.51	60·68	60.85	61·01	61·17	51:34	61·51	61.68	61.84	62.00	63
64	61.47	61·64	61.81	61·98	62·15	62:32	62·49	62.66	62.82	62.09	64
65	62.43	62·60	62.77	62·94	63·11	63:28	63·46	63.64	68.81	68.98	65
66	63·39	63.57	68.74	63-91	64·08	64·26	64·44	64-62	64·79	64.96	66
67	64·35	64.53	64.71	64-88	65·05	65·23	65·41	65-59	66·77	65.94	67
68	65·31	65.50	65.58	65-85	66·02	66·20	66·38	66-58	66·74	66.92	68
69	66·27	66.45	66.64	65-82	67·00	67·18	67·87	67-55	67·73	67.91	69
70	67·24	67.42	67.61	67-79	67·97	68·16	58·34	68-53	68·71	68.89	70
71	68·20	68·89	68.58	68.76	68.94	69·13	69.82	69·51	69·69	69.88	71
72	69·16	69·35	69.64	69.73	69.02	70·11	70.30	70·49	70·68	70.86	72
78	70·12	70·81	70.51	70.60	70.88	71·08	71.27	71·47	71·66	71.85	78
74	71·08	71·28	71.48	71.66	71.85	72·05	72.25	72·45	72·64	72.83	74
75	72·04	72·24	72.44	72.68	72.82	76·02	78.22	78·42	78·62	73.82	75
76	73.00	73·20	73:40	78·50	73·80	74·00	74·20	74·40	74·60	74·80	76
77	78.96	74·17	74:37	74·57	74·77	74·97	75·18	75·89	75·59	75·79	77
78	74.93	75·12	75:33	75·58	76·74	75·95	76·16	76·37	76·57	76·77	78
79	75.88	76·09	76:80	76·50	76·71	76·92	77·13	77·34	77·55	77·75	79
80	76.84	77·05	77:27	77·47	77·68	77·90	78·10	78·82	78·53	78·74	80
81	77.60	78·02	78·28	78·44	76.65	78·87	79.08	79-30	79·51	79·72	81
82	78.75	78·98	79·20	79·41	79.62	79·84	80.06	80-28	80·50	80·71	82
83	79.72	79·94	80·16	80·38	80.60	80·82	81.04	81-26	81·48	81·60	83
84	80.68	80·90	81·12	81·34	81.56	81·79	82.01	82-24	82·46	82·68	84
85	81.64	81·87	82·10	82·31	82.53	82·76	82.99	83-22	83·44	83·65	85
86	82.60	82·88	83·06	83·28	83·50	83·73	83.97	84·20	84·42	84.64	86
87	83.56	83·79	84·02	84·25	84·46	84·71	84.94	85·17	85·40	85.62	87
88	84.52	84·76	85·00	85·22	85·45	85·68	85.92	86·15	86·38	86.61	88
89	85.48	86·72	85·98	86·19	86·42	86·66	86.89	87·13	87·86	87.59	89
90	86.45	86·68	86·93	87·15	87·39	87·63	87.87	68·11	88·34	88.58	90
91	87:41	87.65	87.89	88·12	88·36	88.61	88 86	89·09	89.88	89.56	91
92	88:37	88.61	88.86	89·09	89·33	89.58	89 82	90·07	90.81	90.56	92
93	89:33	89.57	89.82	90·06	90·30	90.55	90 80	91·05	91.29	91.58	98
94	90:29	90.54	90.79	91·09	91·27	91.63	91 78	92·08	92.27	92.51	94
95	91:25	91.50	91.75	92·00	92·25	92.50	92 76	93·00	93.25	03.50	95
96	92·21	92·46	92·72	02·97	98·22	93·47	93.78	93·98	94·28	94·48	96
97	98·17	93·43	93·68	93·98	94·19	94·45	94.71	04·96	95·22	96·47	97
98	94·18	94·39	94·85	94·90	95·16	95·42	95.68	96·94	96·20	96·45	98
99	95·09	95·35	95·61	95·87	96·13	96·89	96.65	96·92	97·18	97·48	99
100	96·06	96·82	96·58	96·84	97·11	97·37	97.63	97·89	98·16	98·42	100
		<u> </u>		<u>' — — </u>	<u> </u>	<u> </u>					

TABLE 20-Continued. II. Table for reducing the

760	750	752	754	756	758	762	764	766	768	770	760
1	0.987	0.989	0.992	0.995	0.997	1.003	1.005	1.008	1.011	1.013	1
2	1.974	1.979	1.984	1.989	1.995	2.005	2.011	2.016	2.021	2.926	2
8	2.960	2.968	2.976	2.984	2-992	3.097	3.016	3.024	8.052	8.039	3
4	3.947	3 958	8 968	8.979	8.990	4.010	4.021	4.032	4.042	4.052	4
5	4.934	4.947	4.960	4-974	4-987	5.013	5.026	5.040	5.053	5.066	5
6	5.921	5.997	5.952	5.968	5-984	6.016	6.032	6.047	6.063	6.079	6
8 1	6.908 7.894	6.926 7.916	6·944 7·936	6·968	6·982 7·979	7·018 8·021	7·037 8·042	7·055 8·063	7·974 8·984	7·092 8·106	7 8
9	8-881	8-995	8.929	8.952	8.977	9.023	9.048	9.071	9.095	9-119	👸
10	9.87	9.89	9.92	9-95	9.97	10.03	10.05	10.08	10.11	10.13	10
11	10.85	10.88	10.91	10.94	10.97	11.08	11.06	11.09	11.12	11.14	11
12	11 84	11.87	11 90	11.94	11.97	12.04	12.07	12:10	12.13	12 16	12
13	12.83	12.86	12.89	12.98	12.96	13.04	13.07	13.10	18.14	13.17	13
14 15	13.82 14.81	13·85 14·84	13·85 14·87	13·92 14·92	13·96 14·96	14·04 15·04	14·07 15·08	14·11 15·12	14·15 15·16	14·17 15·19	14 15
	1										
16 17	15·79 16·78	15.83 16.82	15·87 16·36	15·91 16·91	15·95 16·95	16·05 17· 9 5	16. 9 9 17. 9 9	16·13 17·14	16·17 17·18	16·21 17·22	16 17
18	17.77	17.81	17.85	17.90	17.95	18.05	18.10	18:15	18.19	18.23	18
19	18.75	18.80	18.85	18-90	18-95	19.05	19.10	19.15	19-20	19.25	19
20	19.74	19·7 9	19.84	19.89	19.95	20.05	20.11	20.16	20.21	20.26	20
21	20.72	29.77	20.83	20.89	20.94	21.05	21.11	21.17	21.22	21.27	21
22	21.71	21.76	21.82	21.88	21.94	22.06	22.12	22.18	22.23	22.28	22
23 24	22.70	22·75 23·74	22.81	22.88	22.94	28·06 24·06	23.12	25·16 24·19	23.24	23.39	23
25	24.67	24.73	24.80	24.87	24.98	25.06	25.13	25.50	25 26	25.32	25
26	25.66	25.72	25.79	25.86	25.93	26.06	26.14	26.21	26:27	26:34	26
27	26.65	26.71	26.78	26.86	26.93	27.07	27.15	27.22	27.28	27:35	27
28	27.63	27.70	27.77	27.85	27.92	28 07	28.15	28-28	28.29	28:66	28
29 80	28·62 29·60	28.69	28.76	28.84	28-92	29.07	29.16	29-24	29.30	29.37	29
80		29.68	29.76	29.84	29-92	80-07	30.16	50-24	30-32	30.39	30
81	30-59	30.67	30 75	30.84	30.92	61.08	31.17	31.25	31.33	81.41	31
32 33	81.58 82.56	81.66	81.74	31.83	31.92	32.08	82.17	32.26	82.84	32.42	82
84	83.55	82·65 33·64	82·73 83·73	82·82 38·82	32.91	33·98 34·09	38.18	33·27 54·28	33·35 34·86	38·43 34·45	88
85	34.54	34.63	84.72	84.82	84.91	35.09	35.19	35.28	85.37	35.46	35
80	85.52	35.62	85.71	85-81	85.91	86-09	36-19	36-29	80.38	36-47	B6
87	36.51	36.61	36.71	86.81	86.99	87-09	87.20	37:30	37.39	37.49	87
38	37.50	87-60	87.70	87.80	87.90	38.10	88.20	38-30	38.40	38.50	88
89 40	38·49 39·47	88·59 89·58	39·68	88.80	38.90	39·10 40·10	39·21 40·21	39·31 40·82	89·41 40·42	89·51 40·52	40
41	40.46	40.66	40.67	40.79			_		-		41
42	41.44	41.55	41.86	41.78	40.89	41.11	41.22	41.33	41.43	41.54	42
43	42.48	42.54	42.66	42.78	42.89	43.11	43.23	43.35	43.45	48.56	48
44	48.42	48.53	43.65	48.77	43.88	44.12	44.28	44.85	44.46	44.58	44
45	44.40	44.52	44.64	44.76	44.88	45.12	45.24	45.86	45.47	45.59	45
46	45.39	45.51	45.03	45.76	45.88	46.12	46.24	46.86	46.48	46.60	46
47 48	46.88	46.50	46.63	46.76	46.88	47.12	47·25 48·25	47.88	47·49 48·51	47.61	47
	48.35	48-48	48.61	48.74	48.87	49.13	49.26	49.40	49.62	49.64	48
49	1 20 00										49

volumes of gases to a pressure of 760 mm.—Continued.

760	750	752	754	756	758	762	764	768	768	770	760
61	60.89	60·46	50.60	50·74	50 87	61·14	61·27	51·41	51-54	51.67	51
52	61.82	51·45	51.59	61·73	51 87	62·14	52·28	62·42	52-65	52.68	52
53	52.80	52·44	52.58	62·78	52 87	58·14	53·28	53·42	53-56	53.70	58
54	53·29	53·43	58·67	58·72	53.86	64·14	54·28	54·48	54.57	64·72	54
55	54·28	64·42	54·58	64·71	54.88	65·15	55·29	65·44	65.58	65·73	55
56	55·26	55·41	55.66	55·71	56.86	56·15	56·29	66·45	66-59	56.74	56
57	56·25	56·40	66.56	56·70	56.85	57·15	57·30	67·45	57-60	57.76	57
58	67·24	57·39	57.64	67·69	67.85	58·15	58·80	68·46	68-61	68.77	68
59	58·22	58·38	58.53	58·69	68.85	59·18	59·31	59·47	59-62	69.78	59
60	59·21	59·37	59.52	59·68	59.84	60·16	60·82	60·47	60-63	80.79	60
61	60-20	60·36	60.52	60-68	60.84	61·16	61·32	81·48	61.64	81·81	61
62	61-19	61·35	61.51	61-67	61.84	62·16	62·33	62·49	62.65	62·82	62
69	62-17	62·34	62.50	62-67	62.83	63·17	63·33	68·50	68.67	69·84	63
64	63-16	63·39	63.49	68-66	63.89	64·17	64·34	64·51	64.68	64·85	64
65	64-16	64·92	64.49	64-66	64.83	86·17	65·34	65·61	66.69	65·86	65
66	65·19	65:81	65·48	65·65	65·82	86·17	66·35	68·52	68·70	66.88	66
67	66·12	66:30	66·47	66·64	66·82	67·18	67·85	67·58	67·71	67.69	67
63	67·10	67:29	67·46	67·64	67·82	68·18	68·86	68·54	68·72	68.90	68
69	68·09	68:28	68·45	68·63	68·82	69·18	69·36	69·54	69·78	69.91	69
70	69·08	69:26	69·44	69·63	69·82	70·18	70·87	70·55	70·74	70.92	70
71	70·07	70-25	70·48	70·62	70·81	71·19	71.87	71·56	71·75	71·94	71
72	71·05	71-24	71·48	71·62	71·81	72·19	72.38	72·57	72·76	72·95	72
73	72·04	72-23	72·42	72·61	72·81	78·19	73.38	78·57	73·77	78·97	78
74	73·03	73-22	78·41	78·61	78·80	74·19	74.39	74·68	74·78	74·98	74
75	74·01	74-21	74·40	74·60	74·80	75·20	76.39	75·59	75·79	75·99	75
76	75·00	75-20	76-40	75.60	75·80	76·20	76:40	76-60	76·80	77·01	78
77	75·99	76-19	76-99	76.59	76·79	77·20	77:40	77-60	77·81	78·02	77
78	76·97	77-18	77-98	77.58	77·79	78·20	78:41	78-61	78·82	79·09	78
79	77·98	78-17	78-37	78.58	78·79	79·21	70:41	79-62	79·83	80·04	79
80	78·94	79-16	79-86	79.58	79·79	80·21	80:42	80-68	80·84	81·06	80
81	79·98	80·15	80:35	80·57	80·79	81·21	81·42	81·84	81·85	82·07	81
82	80·92	81·14	81:35	81·56	81·78	82·21	82·43	82·65	82·87	88·09	82
83	81·91	82·13	82:34	82·56	82·78	88·22	83·44	83·66	83·88	84·10	83
84	82·90	83·12	83:84	63·56	83·78	94·22	84·44	84·66	84·89	85·11	84
85	83·88	84·11	84:83	84·55	84·78	85·22	85·45	85·67	85·90	86·13	85
86 87 89 89	84·87 85·85 86·84 87·82 88·81	86·10 86·08 87·07 88·06 89·05	85·82 86·81 87·80 88·29 89·29	85·55 86·54 87·64 88·53 89·52	85·78 86·77 87·77 88·77 89·77	80·22 87·23 88·23 89·28 90·23	86:48 87:46 88:47 89:47 90:48	86.67 87.68 88.69 89.70 90.71	88·91 87·92 88·98 89·94 90·95	87·14 88·15 89·17 90·18 01·19	88 87 88 89 90
91	89·80	90·04	90·28	90·52	90·76	91·24	91·48	91.72	91.96	92·21	91
92	90·79	91·08	91·27	91·51	91·76	92·24	92·49	92.73	92.97	98·22	92
98	91·77	92·02	92·26	92·51	92·76	98·24	93·49	98.74	98.09	94·28	98
94	92·78	98·01	93·26	98·60	98·75	94·24	94·49	94.74	94.99	95·24	04
95	98·74	94·00	94·25	94·50	94·75	95·25	95·50	95.75	96.00	96·26	95
96	94·78	94·98	95·24	95·49	95·75	96·25	96·51	98.76	97·01	97·27	98
97	95·72	95·97	96·28	96·49	96·76	97·25	97·51	97.77	98·02	98·29	97
98	96·70	96·96	97·22	97·48	97·74	98·25	98·52	98.77	99·08	99·80	98
99	97·69	97·95	98·21	98·48	98·74	99·26	99·52	99.76	100·04	100·81	99
100	98·68	98·95	99·21	99·47	99·74	100·26	100·58	100.79	101·05	101·82	100
•		<u></u>									

TABLE 21.—FACTORS FOR REDUCING A TEMPERATURE

0° Centigrade, and 760 millimetres, or 32°

						Ü				
Cent	igrade.	0-0.	1.1.	2-2.	3.3.	4-4.	6-6.	6-7.	7.8.	8-9.
Fahr	renheit.	32°.	34°.	36°.	38°.	40°.	42°.	44°.	46°.	48°.
1n. 27·5 27·6 27·7 27·8 27·9	Milli- metres. 898.5 701.9 793.6 706.1 708.6	-9191 -9224 -9258 -9291 -9325	-9154 -9185 -9221 -9254 -9288	•9116 •9149 •9183 •9215 •9249	-9079 -9112 -9145 -9179 -9212	*9043 *9076 *9109 *9142 *9174	-9007 -9039 -9072 -9105 -9138	-8972 -9095 -9037 -9070 -9192	-8936 -8969 -9091 -9034 -9067	-8899 -8932 -8964 -8996 -9029
28·0	711-2	•9358	-9321	•9282	•9244	•9208	•9170	•9135	•9099	*9061
28·1	713-7	•9391	-9354	•9315	•9278	•9241	•9203	•9167	•9131	*9093
28·2	716-3	•9425	-9387	•9348	•9310	•9273	•9236	•9200	•9164	*9125
28·3	718-8	•9458	-9421	•9382	•9344	•9306	•9289	•9233	•9197	*9158
28·4	721-3	•9491	-9454	•9415	•9377	•9839	•9301	•9265	•9229	*9190
28·5	723·9	-9525	•9487	•9448	·9410	·9372	•9334	-9298	·9262	·9223
28·6	726·4	-9558	•9520	•9481	·9443	·9405	•9367	-9331	·9294	·9255
28·7	728·9	-9592	•9554	•9514	·9476	·9438	•9400	-9364	·9327	·9287
28·8	731·5	-9625	•9587	•9547	·9509	·9471	•9432	-9396	·9359	·9320
28·9	734·0	-9659	•9620	•9580	·9542	·9504	•9465	-9429	·9392	·9352
29·0	786·6	-9692	•9654	-9618	•9675	•9536	•9498	-9462	•9424	9885
29·1	739·1	-9725	•9687	-9647	•9608	•9569	•9531	-9494	•9457	9417
29·2	741·6	-9759	•9720	-9680	•9640	•9602	•9563	-9527	•9489	9449
29·3	744·2	-9792	•9753	-9718	•9674	•9635	•9596	-9559	•9522	9481
29·4	746·7	-9826	•9787	-9746	•9707	•9668	•9629	-9592	•9554	9514
29·5	749·3	•9859	•9820	•9779	·9740	•9701	·9662	*9624	9587	·9546
29·6	751·8	•9893	•9853	•9812	·9778	•9733	·9694	*9657	9619	·9578
29·7	754·3	•9926	•9887	•9845	·9808	•9786	·9727	*9690	9652	·9611
29·8	756·9	•9959	•9920	•9879	·9839	•9800	·9760	*9722	9684	·9643
29·9	759·4	•9093	•9954	•9912	·9872	•9832	·9793	*9755	9717	·9676
30·0 30·1 30·2 30·3 80·4	762·0 764·5 787·0 769·6 772·1	1:0026 1:0080 1:0098 1:0126 1:0160	1.0020 1.0053 1.0086 1.0120	9945 9978 1-0011 1-0044 1-0078	·9905 ·9938 ·9971 1·0004 1·0087	•9865 •9898 •9931 •9964 •9997	•9826 •9858 •9891 •9924 •9957	-9788 -9820 -9858 -9885 -9918	-9749 -9782 -9814 -9846 -9379	•9708 •9740 •9773 •9805 •9837
80·6	774·7	1.0194	1.0153	1.0111	1.0070	1.0030	·9989	-9950	-9911	9870
30·6	777·2	1.0227	1.0186	1.0144	1.0103	1.0063	1·0922	-9983	-9944	9902
80·7	779·7	1.0260	1.0220	1.0177	1.0136	1.0096	1·9955	1-0016	-9976	9935
80·8	782·3	1.0294	1.0253	1.0210	1.0169	1.0128	1·0087	1-0048	1-0009	9967
30·9	784·8	1.0327	1.0286	1.0243	1.0202	1.0164	1·0129	1-0081	1-9041	1 9000
31·0	787·4	1.0860	1.0319	1.0276	1.0235	1.0194	1·9158	1-0114	1-0074	1 0032

GIVEN VOLUME OF GAS TO NORMAL AND PRESSURE.

Fahrenheit, and 29.92 inches barometric pressure.

Cent	igrade.	10.0.	11·1.	12.2.	18.3.	14.4.	15.6.	16.7.	17.8.
Fahr	enheit.	50°.	52°.	64°.	56°.	58°.	60°.	62°.	64°.
In. 27·5 27·6 27·7 27·8 27·9	Milli- metres. 698.5 701.0 703.6 706.1 708.6	*8867 *8900 *8982 *8964 *8998	*8882 *8864 *8897 *8928 *8960	*8797 *8829 *8861 *8898 *8925	*8763 *8795 *8827 *8859 *8890	*8728 *8760 *8792 *8823 *8855	*8696 *8726 *8758 *8790 *8821	·8661 ·8693 ·8724 ·8756 ·8787	-8628 -8660 -8691 -8722 -8754
28·0	711·2	•9029	*8992	•8957	-8922	*8887	*8853	-8819	·8785
28·1	713·7	•9060	*9025	•8989	-8954	*8919	*8884	-8850	·8816
28·2	716·3	•9093	*9067	•9021	-8986	*8951	*8916	-8862	·8848
28·3	718·8	•9125	*9089	•9053	-9018	*8988	*8948	-8913	·8879
26·4	721·3	•9157	*9121	•9085	-9050	*9014	*8979	-8945	·8911
28·5	723·9	•9169	·9153	·9117	·9082	·9046	·9011	-8976	-8942
28·6	725·4	•9222	·9186	·9149	·9114	·9077	·9048	-9003	-8973
28·7	728·9	•9254	·9218	·9181	·9145	·9109	·9074	-9089	-9005
28·8	731·5	•9286	·9250	·9213	·9177	·9141	·9106	-9071	-9086
28·9	734·0	•9318	·9282	·9245	·9209	·9173	·9188	-9102	-9067
29·0	786·6	•9351	·9314	·9277	-9241	•9205	•9169	•9134	•9099
29·1	789·1	•9883	·9346	·9309	-9278	•9236	•9201	•9165	•9180
29·2	741·6	•9415	·9378	·9341	-9305	•9268	•9233	•9197	•9162
29·8	744·2	•9448	·9410	·9878	-9886	•9300	•9264	•9228	•9198
29·4	746·7	•9480	·9443	·9405	-9368	•9832	•9296	•9260	•9224
29.5	749·3	•9512	·9475	•9437	·9400	9363	-9328	·9291	9256
29.6	751·8	•9544	·9506	•9469	·9432	9895	-9359	·9328	9287
29.7	754·8	•9577	·9589	•9501	·9464	9427	-9390	·9354	9318
29.8	756·9	•9609	·9571	•9588	·9496	9459	-9422	·9386	9350
29.9	759·4	•9641	·9608	•9565	·9528	9490	-9454	·9417	9381
80·0	762·0	•9673	-9635	·9597	-9560	•9622	•9486	9449	·9418
80·1	764·5	•9706	-9667	·9629	-9591	•9554	•9517	9480	·9444
30·2	767·0	•9738	-9700	·9661	-9623	•9536	•9549	9512	·9475
30·8	769·0	•9770	-9731	·9698	-9655	•9617	•9580	9548	·9507
30·4	772·1	•9802	-9764	·9725	-9687	•9649	•9612	9575	·9538
30.5	774·7	•9835	·9796	•9757	•9719	•9681	9843	9606	-9569
30.6	777·2	•9867	·9828	•9789	•9751	•9712	9675	9688	-9601
30.7	779·7	•9899	·9830	•9821	•9782	•9744	9707	9669	-9632
30.8	782·8	•9931	·9892	•9863	•9816	•9776	9788	9701	-9664
30.9	784·8	•9963	·9924	•9885	•9846	•9807	9770	9782	-9695
31.0	787·4	•9998	·0956	•9917	•9878	•9840	9801	9764	-9726

TABLE 21—Continued.

Cent	igrade.	18-9.	20.	21·1.	22.2.	23.8.	24-4.	25.6.	26-7.
Fahr	enheit.	66°.	68°.	70°.	72°.	74°.	76°.	78°.	80°.
In. 27·5 27·6 27·7 27·8 27·9	Milli- metres. 698·5 701·0 703·6 706·1 708·6	-8595 -8626 -8658 -8689 -8720	*8563 *8594 *8625 *8656 *8687	*8580 *8561 *8592 *8623 *8664	*8498 *8529 *8560 *8591 *8622	-8466 -8497 -8528 -8559 -8589	*8435 *8465 *8496 *8527 *8557	-8403 -8434 -8464 -8496 -8525	-8372 -8403 -8433 -8463 -8494
28·0	711·2	·8761	*8718	*8685	*8653	-8620	-8588	*8556	*8524
28·1	713·7	·8789	*8750	*8716	*8684	-8651	-8619	*8587	*8555
28·2	716·3	·8814	*8781	*8747	*8714	-8682	-8649	*8617	*8585
28·3	718·8	·8845	*8812	*8778	*8745	-8713	-8680	*8648	*8616
28·4	721·8	·8976	*8848	*8809	*8776	-8743	-8711	*8678	*8646
28·6	723·9	*8908	*8874	*8840	-8807	-8774	*8741	*8709	-8677
28·8	726·4	*8939	*8905	*8872	-8838	-8805	*8772	*8739	-8707
28·7	728·9	*8970	*8936	*8903	-8869	-8836	*8803	*8770	-8738
28·8	731·5	*9002	*8968	*8984	-8900	-8866	*8833	*8800	-8768
28·9	784·0	*9088	*8999	*8965	-3931	-8897	*8864	*8831	-8798
29·0	736·6	9064	9030	*8996	*8962	*8928	*8895	*8862	*8829
29·1	739·1	9095	9061	*9027	*8993	*8959	*8925	*8892	*8859
29·2	741·8	9127	9092	*9058	*9028	*8990	*8956	*8923	*8890
29·3	744·2	9158	9123	*9089	*9054	*9020	*8987	*8958	*8920
29·4	746·7	9189	9154	*9120	*9085	*9051	*9017	*8984	*8951
29·5	749·8	•9220	·9186	9161	*9118	-9082	·9048	-9014	*8981
29·6	751·8	•9252	·9217	9182	*9147	-9113	·9079	-9045	*9012
29·7	754·8	•9283	·9248	9218	*9178	-9144	·9109	-9076	*9042
29·8	756·9	•9814	·9279	9244	*9209	-9174	·9140	-9106	*9072
29·9	759·4	•9345	·9310	0276	*9240	-9205	·9171	-9137	*9103
50·0	782·0	•9877	•9841	•9306	•9271	•9256	-9201	*9167	·9183
30·1	764·5	•9408	•9872	•9357	•9302	•9267	-9282	*9198	·9164
30·2	767·0	•9489	•9403	•9368	•9358	•9297	-9263	*9228	·9194
30·3	769·6	•9470	•9435	•9329	•9363	•9828	-9293	*9259	·9225
80·4	772·1	•9502	•9466	•9430	•9894	•9859	-9324	*9259	·9255
30·5	774·7	•9583	•9497	•9461	•9425	·9390	•9355	·9320	*9286
30·6	777·2	•9564	•9528	•9492	•9456	·9421	•9385	·9351	*9816
30·7	779·7	•9595	•9559	•9523	•9487	·9451	•9416	·9381	*9846
30·8	782·3	•9627	•9590	•9554	•9518	·9482	•9447	·9412	*9877
30·9	784·8	•9658	•9621	•9585	•9549	·9613	•9477	·9442	*9407
31·0	787·4	•9689	•9658	•9616	•9580	·9544	•9508	·9478	*9438

TABLE 21a.—VOLUMES OF WATER AT DIFFER-ENT TEMPERATURES. (Rossetti.)

Temp.		Temp.		Temp.	
0 1 2 3 4 5 6 7 8 9 10 11 12 13	1 0.999947 0.999908 0.999885 0.999877 0.999883 0.999903 0.999986 1.000048 1.000124 1.000213 1.000314 1.000429	14 15 16 17 18 19 20 21 22 23 24 25 30 35	1 ·000556 1 ·000695 1 ·000846 1 ·001010 1 ·001184 1 ·001370 1 ·001567 1 ·001776 1 ·001995 1 ·002225 1 ·002465 1 ·002715 1 ·004064 1 ·005697	40 45 50 55 60 65 70 75 80 85 90 95	1:007531 1:009541 1:011766 1:014100 1:016590 1:019302 1:022246 1:025440 1:028581 1:031894 1:035397 1:039094 1:042986

TABLE 22.—REDUCTION OF WATER PRESSURE TO MERCURIAL PRESSURE.

aq.	Hg.	aq.	Hg.	aq.	Hg.	aq.	Hg.	aq.	Hg.
1	0.07	23	1.70	45	3.32	67	4.94	89	6:57
2	0.15	24	1.77	46	3.39	68	5.02	90	6.64
2 3	0.22	25	1.84	47	3.47	69	5.09	91	6.72
4	0.30	26	1.92	48	3.54	70	5.17	92	6.79
4 5	0.37	27	1.98	49	3.62	71	5.24	93	6.86
6	0.44	28	2.07	50	3.69	72	5.31	94	6.94
7	0.52	29	2.14	51	3.76	73	5.39	95	7.01
8	0.59	30	2.21	52	3.84	74	5.46	96	7.08
9	0.66	31	2.29	53	3.91	75	5.54	97	7.16
10	0.74	32	2.36	54	3.99	76	5.61	98	7.23
11	0.81	33	2.44	55	4.06	77	5.68	99	7.31
12	0.89	34	2.51	56	4.13	78	5.76	100	7.38
13	0.96	35	2.58	57	4.21	79	5.83	200	14 76
14	1.03	36	2.66	58	4.28	80	5.90	300	22.14
15	1.12	37	2.73	59	4.35	81	5.98	400	29.52
16	1.18	38	2.80	60	4.43	82	6.05	500	36-90
17	1.26	39	2.88	61	4.50	83	6.13	600	44.28
18	1.33	40	2.95	62	4.58	84	6.20	700	51.66
19	1.40	41	3.03	63	4.65	85	6.27	800	59.04
20	1.48	42	3.10	64	4.72	86	6.35	900	66.42
21	1.55	43	3.17	65	4.80	87	6.42	1000	73.80
22	1.62	44	3.25	66	4.87	88	6.49		

TABLE 23.—TENSION OF AQUEOUS VAPOUR

Between -20° and +118° C. in Millimetres Mercury. (Magnus.)

т.	mm.	T.	mm.	т.	mm.
- 20°	0.916	+15°	12:677	+50°	92.0
19	0.999	16	13.519	51	96.6
18	1.089	17	14.409	52	101.5
17	1.186	18	15.351	53	106.6
16	1.290	19	16.345	54	111-9
1 **	1 200	1.5	10 949	94	111 9
15	1.403	20	17:396	55	117.4
14	1.525	21	18.505	56	123.1
13	1.655	22	19:675	57	129.1
12	1.796	23	20.909	58	135 • 3
11	1.947	24	22 211	59	141.8
	1 0 1 7	1 1	22 211	33	1410
10	2.109	25	23.582	60 ′	148.6
9	2.284	26	25.026	61	155.6
8	2.471	27	26.547	62	162.9
7	2.671	28	28.148	63	170.5
6	2.886	29	29.832	64	178.4
				V-	1,01
5	3.110	30	31.602	65	186.6
4	3:361	31	33.5	66	195 1
3 2	3.624	32	35.4	67	204.0
2	3.900	33	37.5	68	213.2
1	4.205	34	39.6	69	222.7
0	4.525	35	41.9	70	232.6
+1	4.867	36	44.3	71	242.9
2	5.231	37	46.8	72	253.5
3	5.619	38	49.4	73	264.6
4	6.032	39	52.1	74	276.0
	1		Ÿ	'-	2,00
5 6 7	6.471	40	55.0	75	287.9
6	6.939	41	58.0	76	300.2
7	7.436	42	61.1	77	312.9
8	7.964	43	64.4	78	326.1
9	8.525	44	67:8	79	339.8
	i	-	1		000
10	9.126	45	71.4	80	353 9
11	9.756	46	75.2	81	368 6
12	10.421	47	79.1	82	383.7
13	11.130	48	83.2	83	399.4
14	11.882	49	87.5	84	415.6
		-			
	<u> </u>	·		<u> </u>	

TABLE 23-Continued.

T.	mm.	T.	mm.	T.	mm.
+85° 86 87 88	432·3 449·6 467·5 486·0 505·0	+97° 98 99 100 101	681·7 707·0 733·1 760·0 787·7	+109° 110 111 112 113	1041:3 1077:3 1114:3 1152:3 1191:4
90 91 92 93 94	524.8 545.1 566.1 587.8 610.2	102 103 104 105 106	816·3 845·7 876·0 907·1 939·2	114 115 116 117 118	1231.7 1273.0 1315.5 1359.1 1403.9
95 96	633·3 657·1	107 108	972·3 1006·3		

TABLE 24.—TENSION OF AQUEOUS VAPOUR FOR TEMPERATURES FROM 40° C.

Temperature Centigrade.	Tension in mm. of Mercury.	Pressure in atmospheres.	Presenre per eq.cm. in kilos.
+ 40°	54 .906	0.072	0.07465
45	71.391	0.094	0.09706
50	91 .982	0.121	0.12505
55	117.478	0.154	0.15972
60	148.791	0.196	0.20323
65	186.945	0.246	0.25417
70	233.093	0.306	0.31692
75	288:517	0.380	0.39227
80	354 643	0.466	0.48217
85	433.041	0.570	0.58877
90	525.450	0.691	0.71440
95	633.778	0.834	0.86168
100	760.00	1.000	1.03330
105	906.41	1.193	1.23236
110	1075:37	1.415	1.46210
115	1269.41	1.673	1.72592
120	1491.28	1.962	2.02755
125	1743.88	2.294	2.37098
130	2030.28	2.671	2.76037
135	2353·7 3	3.097	3.20013

TABLE 24—Continued.

Temperature Centigrade.	Tension in mm. of Mercury.	Pressure in atmospheres.	Pressure per sq.cm. in kilos.
+140°	2717.63	3.575	3.69490
145	3125.55	4.112	4.24950
150	3581.23	4.712	4.86904
155	4088.56	5.380	5.55881
160	4651.62	6.120	6.32434
165	5274 • 54	6.940	7.17127
170	5961.66	7.844	8.10547
175	6717:43	8.838	9.13302
180	7546.39	9.929	10.2601
185	8453.23	11.122	11.4930
300	0449-70	30.404	30.0000
190	9442.70	12.424	12.8383
195	10519.73	13.841	14.3025
200	11688-96	15.380	15.8923
205	12955 66	17.047	17.6145
210	14324.80	18.848	19.4760
215	15801.33	20.791	21.4835
220	17390:00	22.881	23.6439
225	19097.04	25.127	25 9643
230	20926.40	27.534	28.4515
Temperature	Tension in inches	Pressure	Pressure in 1bs. per
Fahrenheit.	of Mercury.	in atmospheres.	square inch.
100°	1.918	-064	•941
110	2.577	•086	1.267
120	3.427	114	1.676
130	4.502	•150	2.205
140	5.858	196	2.883
150	7:546	•252	3.705
160	9:628	322	
			4.734
170	12.18	*407	5.984
180	15.27	*510	7.498
	19:01	635	9.336
190			
	23.46	•784	11.53
190	23·46 29·92	*784 1*000	11.53 14.706
190 200 212			
190 200	29.92	1.000	14.706

TABLE 24—Continued.

Temperature Fahrenheit.	Tension in inches of Mercury.	Pressure in atmospheres.	Pressure in 1be per square inch.
250°	60.81	2.032	29.87
260	$72 \cdot 27$	2.415	35.20
270	85.41	2.855	41.97
280	100.4	3.356	49.34
290	117.5	3.927	57.78
800	136.8	4.572	67:22
310	158.6	5.301	77.94
320	183.1	6.120	89.98
330	210.5	7.035	103.4
340	241.1	8.058	118.5
350	275.0	9.198	135.2
360	312.6	10.45	153.6
370	354.0	11.83	173.9
380	399.6	13.35	196.3
390	449.6	15.02	220.8
400	504.4	16.86	247.9
410	563.9	18.84	277.0
420	628 - 8	21.01	309.9
430	699 2	23.37	343.6
440	775:3	25.91	380.9

TABLE 25.—TENSION OF AQUEOUS VAPOUR IN INCHES OF MERCURY FROM 1° TO 100° F.

Temperature Fahrenheit.	Inches of Mercury.	Temperature Fahrenheit.	Inches of Mercury.
1°	.046	11°	071
2	•048	12	.074
3	•050	13	•078
4	•052	14	.082
5	· 054	15	.086
6	•057	16	.090
7	•060	17	094
8	•062	18	•098
ğ	.065	19	.103
10	•068	20	108

56

TABLE 25—Continued.

Temperature Fahrenheit.	Inches of Mercury.	Temperature Fahrenheit.	Inches of Mercury.	
21°	·113	61°	•537	
22	·118	62	•556	
23	•123	63	•576	
24	129	64	•596	
25	•135	65	·617	
26	•141	66-	•639	
27	·147	67	•661	
28	·153	68	*685	
29	•160	69	•708	
30	•167	70	•733	
31	·174	71	·759	
32	•181	72	•785	
33	•188	73	.812	
34	196	74	*840	
35	204	75	-868	
36	•212	76	·89 7	
37	•220	77	•927	
3,8	•229	78	•958	
39	238	79	-990	
40	247	80	1.023	
41	257	81	1.057	
42	•267	82	1.092	
43	•277	83	1.128	
44	•288	84	1.165	
45	299	85	1.203	
46	•311	86	1.242	
47	*323	87	1.282	
48	•335	88	1.323	
49	'348	89	1.366	
50	•361	90	1.401	
51	•374	91	1.455	
52	•388	92	1.501	
53	•403	93	1.548	
54	•418	94	1.596	
55	•433	95	1.646	
56	•449	96	1.697	
57	•465	97	1.751	
58	•482	98	1.806	
59	•500	99	1.862	
60	·518	100	1 004 .	

TABLE 26.—BOILING POINT OF WATER AT DIFFERENT BAROMETRIC PRESSURES.

Barometric	Boiling	Barometric	Boiling
Pressure.	Point.	Pressure.	Point.
mm. 710 715 720 725 730 735 740	98·11 98·30 98·49 98·69 98·88 99·07 99·26	mm. 745 750 755 760 765 770	99 44 99 63 99 82 100 00 100 18 100 37 100 55

TABLE 27.—SPECIFIC HEATS.

(a) Of Solids and Liquids.

Aluminium		0.2220	Iron (cast).	0.1050
Alcohol .		0.547	(wrought).	0.1081
Antimony.		0.0495	Lead	0.0309
Ashes .		0.20	Limestone (marble) .	0.21
Bismuth .		0.0303	Mercury	0.0334
Brass		0.0917	Nickel	0.109
Bricks .		0.22	Oil (lubricating) .	0.40
Cement .		0.19	Platinum . '	0.0324
Carbon (wood)	0.1653	Sandstone	0.22
(graph	iite .	0.1604	Slag	0.18
	ond) .	0.1042	Silver	0.0559
Copper .		0.0936	Steel	0.1070
Glass (for the	mometers	0.1988	Sulphur	0.1764
		0.20	Sulphuric acid	0.332
		0.20	Tin	0.0552
Gold		0.0316	Zinc	0.0932
	•			

(b) Of Gases and Vapours for Constant Pressures between the Temperatures of 0° and 200° C. (Langen and Regnault.)

		Cal. per 1 cb.m.		Cal. per 1 kg.	Cal. per 1 cb.m.
Oxygen Nitrogen Hydrogen	0.2158 0.2459 3.452	0.3082 0.3082 0.3082	Methane Ethylene Sulphur dioxide .	0.2466 0.5930 0.4040 0.1544 0.4542	0·4241 0·5053 0·4413

TABLE 28.—HEATING EFFECTS.

(a) Definitions.

A metrical gram-calorie (cal.) is the quantity of heat required to raise the temperature of 1 gram of water 1°C. The kilogram-calorie = 1000 cal.

The normal calorie is that which raises 1 gram water of 14.5° to 15.5° C.

The British heat unit is the quantity of heat required to raise the temperature of 1 pound of water from 32° to 33° Fahr., and is = 252 gram-calories. This unit is required only where the absolute values of the heat units are considered. Usually the question is only of relative values—e.g., grams or pounds of fuel on the one hand, against grams or pounds of water on the other. For these comparisons the simple proportion of British heat units to gram-calories=5:9 is used, as the unit of fuel weight is the same as that of the water, and only the degrees Centigrade and Fahrenheit differ as above. 1 British heat unit is, therefore, $= \frac{\pi}{2} = 0.5556$ gram-calorie.

- 1 Joule (j) = 10 million ergs = 0.2391 gram-calorie.
- 1 Gram-calorie = 4.183 j.
- $1 J = 1000 j = 239 \cdot 1 cal. = 10^{10} erg.$

(b) Calorific Value of Fuels.

(The data given are the *upper* heating values, *i.e.*, they are referred to the combustion of hydrogen to liquid water as found in the calorimeter.)

,	1	net. cal.		met. cal.
Ether		9,000	Petroleum residue	. 10,500
Alcohol		7,100	Petroleum .	. 11,000
Lignite-tar oil .		9,950	Fatty oils	. 9,300
Wood , .		4,100	Tallow	. 8.370
Methyl alcohol.		5,300	Beeswax	. 9,000
Charcoal (C to CO _o)		8,000	Cellulose	. 4,200
(C to CO)		2,300		,

(c) Calorific Value of Gases.

	Weight.		Calories urnt to	Calories met. when	per cub.
	Molec.	Liquid Water.	Steam.	Liquid Water.	Steam.
$Hydrogeu, H_2$	2 16 28 78 128 28	69.0 213.5 334.8 788.0 1258.4 68.4	58·1 192·1 313·4 755·9 1230·6 68·4	3064 9565 14,999 35,302 56,376 3064	2585 8606 14,060 33,864 55,131 3064

TABLE 29.—AIR COMPRESSION.

The following table is compiled with a view to facilitate calculations of problems connected with the application of compressed gases. The table is strictly correct only for air, but is applicable also to other gases, such as lime-kiln gases. The table relates to 1 cub. foot of atmospheric air measured at 60° F. and 29.92 inches barometric pressure, and shows the volume, temperature, and pressure after adiabatic compression; also the height of a column of water which the compressed gas will just balance, and the power required to compress the air in foot-pounds (33,000 ft.-lbs. per minute = 1 indicated horse-power), and the mean pressure on the air piston.

Final Pressure lbs. per sq. in. above Atmosphere.	Column of Water the Gas will balance.	Volume of compressed Air.	Temperature after Compression.	Mean Pressure on Pieton.	Foot-pounde of Work per cub. foot atmosph. air.
Lbe. 10 12 14 16 18 20 22 24 26 28 30 32 34 36 38 40	Feet. 23·12 27·75 32·37 37·00 41·62 46·25 50·87 55·50 69·37 74·00 78·62 83·25 87·87 92·50	Cnb. feet. 0.692 0.655 0.622 0.593 0.567 0.544 0.523 0.504 0.486 0.469 0.454 0.428 0.416 0.404 0.394	Degrees F. 144-5 158-1 171-0 184-0 196-0 207-3 218-3 228-6 239-0 249-0 258-2 267-5 276-4 285-3 298-5 301-8	Lbs. per sq. in. 8 23 9 58 10 86 12 08 13 23 14 35 15 42 16 45 17 43 18 39 19 32 20 21 21 07 21 92 22 74 23 53	1186-8 1387 1564 1739 1907 2066 2220 2368 2510 2647 2782 2910 3084 3156 3275 3389

In Metrical Units.

Final Preesure above 1 atm. per sq.cm.	Column of Water the Gas will balance.	Volume of I cub.m. air after Com- pression.	Temperature after Compression.	Mean Pressure on Piston.	Work per I cub.m. in metre-kg.
Kg. 0·703 0·844 0·984 1·125 1·266	m. 7.05 8.44 9.87 11.28 12.69	cub.m. 0·692 0·655 0·622 0·593 0·567	°C. 62·5 70·1 77·2 84·4 91·1	Kg. per sq.cm. 0·579 0·674 0·764 0·849 0·930	5,789 6,769 7,633 8,488 9,307

TABLE 29-Continued.

Final Pressure above 1 atm. per sq.cm.	Column of Water the Gas will balance.	Volume of 1 cub.m. air after Com- pression.	Temperature after Compression.	Mean Pressure on Piston.	Work per 1 cub.m. iu metre-kg.
Kg.	- m.	cub.m.	°C.	Kg.persq.cm.	
1.406	14.10	0.544	97.4	1.009	9,791
1.547	15.50	0.523	103.5	1.084	10,835
1.687	16.91	0.504	109.2	1.157	11,557
1.828	18:32	0.486	115.9	1.226	12,251
1.969	19.74	0.469	120.6	1.293	12,919
2.109	21.14	0.454	125.7	1.358	13,573
2.250	22.55	0.440	130.8	1.421	14,203
2.391	. 23.96	0.428	135.8	1.481	14,808
2.531	25:37	0.416	140.7	1.541	15,403
2.374	26.78	0.404	145.4	1.599	15,984
2.812	28.19	0.394	149.9	1.654	16,541

TABLE 30.—EXPLOSIVE MIXTURES OF GASES AND AIR. (Eitner.)

		ŀ	Volumes of Gas.	Volumes of Air.
Acetylene			3.5-52.2	96.5-47.8
Hydrogen			9.5-66.3	90.5-33.7
Carbon monoxide .			16.6-74.8	83.4-25.2
Ethylene		. i	4.2-14.5	95.8-85.5
Methane		. 1	6.2-12.7	93.8-87.3
Coal-gas	•		8.0-19	92.0-81
Benzene vapour		.	2.7- 6.3	97.3-93.7
Petroleum spirit vapour			2.5- 4.8	97 5-95 2
Ether		.	2:9- 7:5	97.1-92.5

TABLE 31.—PROPERTIES OF THE LIQUEFIED GASES WHICH OCCUR IN COMMERCE.

By Dr A. Lange.

							.mm 0	tare.	.81		.4	Conc	Conditione of transit on German Railways.	uo
	Spec	Specific gravity at	wity	Vapo (a	Vapour tension (atm.) at	sion t	ot bas °0 ts .ga I mulov asg s =	Critical tempera	Critical pressu	Bolling point at mm. pressur	Melting poin	Prescribed space for 1 kg, sub- stance.	to dest laiomO a da sissesev add to stusserq	Repetition of the feat required in
	%.	15°.	30°.	٥.	15.	30°.	Litres.	ည့်	Atm.	ů.	Ď.	Litres.	Atm.	Yrs.
Nitrous oxide . 0.937 0.870	0.937	0.870	:	36.1	49.8	0-89	206	35.4	75	- 87 -9	- 102	1.34	180	4
Carbon dioxide	0.947	0.947 0.864 0.732		35.4	52.2	73.8	206	31.1	73	- 78.2	- 57	1.34	190	4
Sulphur dioxide 1.435 1.396 1.356	1.435	1.396	1.356	1.5	2.7	4.5	342	155.4	6.82	- 10.1	- 76	8.0	12	62
Chlorine* .	1.468	1.468 1.426 1.380	1.380	3.7	5.8	8.7	316	146	93.5	- 33:6	- 102	8.0	22	83
Ammonia .	0.634	0.634 0.614 0.592	0.592	4.2	7.1	11.4	1313	130	115	- 38.5	- 75	1.86	30	4
Phosgen	1.432	:	:	:	:	:	:	:	:	+8.2	:	8.0	30	63
Hydrogen .	:	:	:	:	:	:	:	- 234.5	20	- 252	:	:	(1½ times	4
Oxygen	:	:	:	:	:	:	:	-118	20	-183	:	:	the niming by pressure	4
	* F(or Chlo	rins, co	mpare	also t	he stat:	sments o	For Chlorins, compare also the statements of Knietsch in the special part of this book	in the	special p	art of th	is book.		

TABLE 32.—ELECTRICAL UNITS.

1. The unit of quantity, the coulomb, is that quantity of current which precipitates 1:118 mg. silver from a solution of silver nitrate.

2. The unit of current, the ampere, is that current which conveys

1 coulomb through the circuit in 1 second.

1 ampere-hour is = the quantity of current which gives per hour 1 ampere, or per n hours, $\frac{1}{n}$ amperes = 3600 coulombs.

- 3. The unit of resistance, the ohm, is equal to the resistance of a column of mercury at 0° C. of a sectional area of 1 × 1 mm., 106.3 cm. long, possessing a mass of 14.4251 grams. Other units in use are the Siemens unit=0.944 ohm, and the British Association unit (B.A.U.) =0.989 ohm.
- 4. The unit of electromotive force, the volt, is the force which in a conductor with a resistance of I ohm gives a current = 1 ampere.

Electromotive force of a Daniell cell = 1.12 volts. Bunsen cell = 2 volts.

Clark cell = 1.4328 volts. ,, ,, Weston cell = 0.0186 volt. ,, lead storage cell = $2\cdot 1-1\cdot 9$ volts.

The farad is the capacity of a condenser in which a charge of I

coulomb produces a difference of potential of 1 volt.

6. A watt or volt-ampere is the amount of work produced during 1 second by a current of 1 ampere under an electromotive force of 1 It is = 1 metre-kilogram per second = 0.102 m·kg.; hence 1 9.81

horse-power = 735.5 watts. The British Board of Trade Unit is = 1000

watt hours. 1 kilowatt (kw) = 1000 watts = 1.36 horse-power.

A current of 1 ampere, at a resistance of w ohms, produces during t seconds a quantity of heat = 0.239 wt gram-calorie. 1 cal. = 4.19joules.

TABLE 33.—ELECTRO-CHEMICAL EQUIVALENTS.

The separation of a gram equivalent requires 96,540 coulombs = 26.86 ampere hours. 1 ampere hour is capable of yielding:

	Grams.		Grams.
Silver	4.0228	Chlorins	. 1-8223
Copper (from solutions of cupric salts)	1.1852	Bromine	2.982
Zinc	1.219	Iodins	4.7828
Nickel	1.0941	Oxygen	. 0.2983
Bydrogen	0.0376	Potassium chlorate	. 0.7618
Alnminium	0.3369	Potassium hydroxide	. 2.094
Lead	8*862	Sodium hydroxids	. 1.494
Gold	2.4512	,	
Potassium	1.4580		±
Magnesium	0.4534		
Platinom	3.6395		1
Mercury	3.7290		1
Tin	2.2183		

TABLE 34.—MATHEMATICAL TABLES.

Circumference and area of circles, squares, cubes, square and cube roots.

n	πn	$\pi \frac{n^2}{4}$	n ²	n^3	\sqrt{n}	$\sqrt[3]{n}$
1.0	3.142	0.7854	1.000	1.000	1.0000	1.0000
1.1	3.456	0.9503	1.210	1.331	1.0488	1.0323
1.2	3.770	1.1310	1.440	1.728	1.0955	1.0627
1.3	4.084	1.3273	1.690	2.197	1.1402	1.0914
1.4	4.398	1.5394	1.960	2.744	1.1832	1.1187
1.5	4.712	1.7672	2.250	3.375	1.2247	1.1447
1.6	5.027	2.0106	2.560	4.096	1 2649	1.1696
1.7	5.341	2.2698	2.890	4.913	1.3038	1.1935
1.8	5.655	2.5447	3.240	5.832	1.3416	1.2164
1 1.9	5.969	2.8353	3.610	6.859	1.3784	1.2386
2.0	6.283	3.1416	4.000	8.000	1.4142	1.2599
2.1	6.597	3.4636	4.410	9.261	1.4491	1.2806
2.2	6.912	3.8013	4.840	10.648	1.4832	1.3006
2.3	7.226	4.1548	5.290	12.167	1.5166	1.3200
2.4	7.540	4.5239	5.760	13.824	1.5492	1.3389
2.5	7.854	4.9087	6.250	15.625	1.5811	1.3572
2.6	8.168	5 3093	6.760	17.576	1.6125	1.3751
2.7	8.482	5 7256	7.290	19.683	1.6432	1.3925
2.8	8.797	6.1575	7.840	21.952	1.6733	1.4095
2.9	9.111	6.6052	8.410	24.389	1.7029	1.4260
3.0	9.425	7.0686	9.00	27.000	1.7321	1.4422
3.1	9.739	7.5477	9.61	29.791	1.7607	1.4581
3.2	10.053	8.0425	10.24	32.768	1.7889	1.4736
3.3	10.367	8.5530	10.89	35.937	1.8166	1.4888
3.4	10.681	9.0792	11.56	39.304	1.8439	1.5037
3.5	10.996	9.6211	12.25	42.875	1.8708	1.5183
3.6	11.310	10.179	12.96	46.656	1.8974	1.5326
3.7	11.624	10.752	13.69	50.653	1.9235	1.5467
3.8	11.938	11.341	14.44	54.872	1.9494	1.5605
3.9	12.252	11.946	15.21	59.319	1.9748	1.5741
4.0	12.566	12:566	16.00	64.000	2.0000	1.5874
4.1	12.881	13.203	16.81	68.921	2.0249	1.6005
4.2	13.195	13.854	17.64	74.088	2.0494	1.6134
4.3	13.509	14.522	18.49	79·507	2.0736	1.6261
4.4	13.823	15.205	19.36	85.184	2.0976	1.6386
4.5	14 137	15.904	20:25	91.125	2.1213	1.6510
4.6	14.451	16.619	21.16	97:336	2.1448	1.6631
4.7	14.765	17.349	22.09	103.823	2.1680	1.6751

TABLE 34—Continued.

]	_n ²		-		
n	πn	$\frac{\pi}{4}$	n^2	n^3	\sqrt{n}	$\sqrt[3]{n}$
		•				·
4.8	15.080	18.096	23.04	110.592	2.1909	1.6869
4.9	15.394	18.857	24.01	117.649	2.2136	1.6985
5.0	15.708	19.635	25.00	125.000	2.2361	1.7100
5.1	16.022	20.428	26.01	132.651	2.2583	1.7213
5.2	16.336	21.237	27.04	140.608	2.2804	1.7325
5.3	16.650	22.062	28.09	148.877	2.3022	1.7435
5.4	16.965	22.902	29.16	157.464	2.3238	1.7544
5.5	17.279	23.758	30 ·25	166:375	2.3452	1.7652
5.6	17.593	24.630	31.36	175.616	2.3664	1.7758
5.7	17.907	25.518	` 32·49	185.193	2.3875	1.7863
5.8	18.221	26.421	33.64	195.112	2.4083	1.7967
5.9	18.535	27:340	34.81	205:379	2.4290	1.8070
6.0	18.850	28.274	36.00	216-000	2.4495	1.8171
6.1	19.164	29.225	37.21	226.981	2.4698	1.8272
6.2	19.478	30.191	38.44	238.328	2.4900	1.8371
6.3	19.792	31.173	39.69	250.047	2.5100	1.8469
6.4	20.106	32.170	40.96	262.144	2.5298	1.8566
6.5	20.420	33.183	42.25	274 625	2.5495	1.8663
6.6	20.735	34.212	43.56	287.496	2.5691	1.8758
6.7	21.049	35.257	44.89	300.763	2.5884	1.8852
6.8	21.363	36.317	46.24	314.432	2.6077	1.8945
6.9	21.677	37:393	47.61	328.509	2.6268	1.9038
7.0	21.991	38.485	49.00	343.000	2.6458	1.9129
7.1	22.305	39.592	50.41	357.911	2.6646	1.9920
7.2	22.619	40.715	51.84	373.248	2.6833	1.9310
7.3	22.934	41.854	53.29	389.017	2 7019	1.9399
7.4	23.248	43.008	54.76	405.224	2.7203	1.9487
7.5	23.562	44.179	56.25	421.875	2.7386	1.9574
7.6	23.876	45.365	57.76	438 976	2.7568	1.9661
7.7	24.190	46 566	59.29	456.533	2.7749	1.9747
7.8	24.504	47.784	60.84	474.552	2.7929	1.9832
7.9	24.819	49.017	62.41	493.039	2.8107	1 9916
8.0	25.133	50.266	64.00	512.000	2.8284	2.0000
8.1	25.447	51.530	65.61	531.441	2.8461	2.0083
8.2	25.761	52.810	67.24	551.368	2.8636	2.0165
8.3	26.075	54.106	68.89	571.787	2.8810	2.0247
8.4	26.389	55.418	70.56	592.704	2.8983	2.0328
	<u> </u>	<u> </u>	<u></u>	<u> </u>	<u> </u>	<u> </u>

TABLE 34--Continued.

n	π <i>n</i> Ο	$\pi \frac{n^2}{4}$	n^2	n^3	\sqrt{n}	$\sqrt[3]{n}$
8.5	26:704	56.745	72.25	614.125	2.9155	2.0408
8·6	27.018	58.088	73·96	636.056	2.9326	2 0488
8·7	27.332	59.447	75·69	658.503	2.9496	2 0567
8·8	27.646	60.821	77·44	681.472	2.9665	2 0646
8.9	27.960	62.211	79.21	704.969	2.9833	2.0724
9·0	28·274	63.617	81.00	729:000	3.0000	2.0801
9·1	28·588	65.039	82.81	753:571	3.0166	2.0878
9·2	28·903	66.476	84.64	778:688	3.0332	2.0954
9·3	29·217	67 ·929	86·49	804 ·357	3.0496	2·1029
9·4	29·531	69 ·398	88·36	830 ·584	3.0659	2·1105
9·5	29.845	70.882	90 • 25	857·375	3.0822	2·1179
9·6	30.159	72.382	92 • 16	884·736	3.0984	2·1253
9·7	30.473	73.89	94 • 09	912·673	3.1145	2·1327
9.8	30·788	75:430	96.04	941·192	3·1305	2·1400
	31·102	76:977	98.01	970·299	3·1464	2·1472
10.0	31.416	78.540	100.00	1000.000	3·1623	2·1544
10.1	31.730	80.119	102.01	1030.301	3·1780	2·1616
10.2	32.044	81.713	104.04	1061.208	3·1937	2·1687
10·3	32·358	83·323	106.09	1092·727	3·2094	2·1757
10·4	32·673	84·949	108.16	1124·864	3·2249	2·1828
10.5	32·987	86.590	110 · 25	1157.625	3·2404	2·1897
10.6	33·301	88.247	112·36	1191.016	3·2558	2·1967
10.7	33·615	89.920	114 · 49	1225.043	3·2711	2·2036
10·8	33·929	91.609	116 64	1259·712	3·2863	2·2104
10·9	34·243	93.313	118 81	1295·029	3·3015	2·2172
11·0	34.558	95·033	121.00	1331:000	3·3166	2·2239
11·1	34.872	96·769	123.21	1367:631	3·3317	2·2307
11·2	35.186	98·520	125.44	1404:928	3·3466	2·2374
11·3	35.500	100·29	127·69	1442·897	3·3615	2·2441
11·4	35.814	102·07	129·96	1481·544	3·3754	2·2506
11.5	36·128	103.87	132·25	1520·875	3·3912	2·2572
11.6	36·442	105.68	134·56	1560·896	3·4059	2·2637
11.7	36.757	107.51	136·89	1601·613	3·4205	2·2702
11.8	37.071	109.36	139·24	1643·032	3·4351	2·2766
11.9	37.385	111.22	141·61	1685·159	3·4496	2·2831
12·0	37·699	113·10	144·00	1728:000	3·4641	2·2894
12·1	38·013	114·99	146·41	1771:561	3·4785	2·2957
12.2	38.327	116.90	148.84	1815 848	3.4928	2.3021

TABLE 34—Continued.

n	πn Ο	$\pi \frac{n^2}{4}$	n ²	n ³	\sqrt{n}	\sqrt{n}
12·3	38.642	118·82	151·29	1860·867	3.5071	2:3084
12·4	38.956	120·76	153·76	1906·624	3.5214	2:3146
12·5	39·270	122.72	156:15	1953·125	3.5355	2·3208
12·6	39·584	124.69	158:76	2000·376	3.5496	2·3270
12·7	39·898	126.68	161:29	2048·383	3.5637	2·3331
12.8	40·212	128.68	163·84	2097·152	3·5777	2·3392
	40·527	130.70	166·41	2146·689	3·5917	2·3453
13.0	40.841	132.73	169.00	2197.000	3.6056	2:3513
13.1	41.155	134.78	171.61	2248.091	3.6194	2:3573
13.2	41.469	136.85	174.24	2299.968	3.6332	2:3633
13.3	41.783	138.93	176.89	2352.637	3.6469	2:3693
13.4	42.097	141.03	179.56	2406.104	3.6606	2:3752
13·5	42·412	143·14	182·25	2460·375	3.6742	2·3811
13·6	42·726	145·27	184·96	2515·456	3.6878	2·3870
13·7	43·040	147·41	187·69	2571·353	3.7013	2·3928
13·8	43·354	149·57	190·44	2628·072	3.7148	2·3986
13·9	43.668	151.75	193.21	2685·619	3.7283	2·4044
14·0	43.892	153.94	196.00	2744·000	3.7417	2·4101
14·1	44.296	156.15	198.81	2803·221	3.7550	2·4159
14·2	44.611	158.37	201.64	2863·288	3.7683	2·4216
14·3	44.925	160.61	204.49	2924·207	3.7815	2·4272
14·4	45·239	162·86	207·36	2985·984	3·7947	2·4329
14·5	45·553	165·13	210·25	3048·625	3·8079	2·4385
14·6	45·867	167·42	213·16	3112·136	3·8210	2·4441
14·7	46·181	169·72	216·09	3176·523	3·8341	2·4497
14·8	46·496	172·03	219·04	3241·792	3·8471	2·4552
14·9	46·810	174·37	222·01	3307·949	3·8600	2·4607
15·0	47·124	176·72	225·00	3375·000	3.8730	2·4662
15·1	47·438	179·08	228·09	3442·951	3.8859	2·4717
15·2	47·752	181·46	231·04	3511·808	3.8987	2·4772
15·3	48·066	183·85	234·09	3581·577	3.9115	2·4825
15·4	48.381	186·27	237·16	3652·264	3·9243	2·4879
15·5	48.695	188·69	240·25	3723·875	3·9370	2·4933
15·6	49.009	191·13	243·36	3796·416	3·9497	2·4986
15·7	49.323	193·59	246·49	3869·893	3·9623	2·5039
15·8	49.637	196:07	249·64	3944·312	3·9749	2·5092
15·9	49.951	198:56	252·81	4019·679	3·9875	2·5146

TABLE 34—Continued.

n	π n Ο	$\begin{array}{c c} \pi \frac{n^2}{4} \\ \bullet \end{array}$	n^2	n ³	\sqrt{n}	$\sqrt[3]{n}$
16·0	50.265	201.06	256.00	4096-000	4.0000	2.5198
16·1	50.580	203.58	259.21	4173-281	4.0125	2.5251
16·2	50.894	206.13	262.44	4251-528	4.0249	2.5303
16·3	51.208	208.67	265.69	4330-747	4.0373	2.5355
16·4	51.522	211.24	268.56	4410-944	4.0497	2.5406
16.5	51.836	213.83	272·25	4492·125	4.0620	2.5458
16.6	52.150	216.42	275·56	4574·296	4.0743	2.5509
16.7	52.465	219.04	278·89	4657·463	4.0866	2.5561
16.8	52.779	221.67	282·24	4741·632	4.0988	2.5612
16.9	53.093	224.32	285·61	4826·809	4.1110	2.5663
17:0	53·407	226.98	299.00	4913·000	4·1231	2·5713
17:1	53·721	229.66	292.41	5000·211	4·1352	2·5763
17:2	54·035	232.35	295.84	5088·448	4·1473	2·5813
17:3	54·350	235.06	299.29	5177·717	4·1593	2·5863
17:4	54·664	237.79	302.76	5268·024	4·1713	2·5913
17:5	54.978	240.53	306·25	5359·375	4·1833	2.5963
17:6	55.292	243.29	309·76	5451·776	4·1952	2.6012
17:7	55.606	246.06	313·29	5545·233	4·2071	2.6061
17:8	55.920	248.85	316·84	5639·752	4·2190	2.6109
17:9	56.235	251.65	320·41	5735·339	4·2308	2.6158
18.0	56.549	254·47	324.00	5832.000	4·2426	2.6207
18.1	56.863	257·30	327.61	5929.741	4·2544	2.6256
18.2	57.177	260·16	331.24	6028.568	4·2661	2.6304
18.3	57.491	263·02	334.89	6128.487	4·2778	2.6352
18.4	57.805	265·90	338.56	6229.504	4·2895	2.6400
18.5′	58·119	268·80	342·25	6331·625	4·3012	2.6448
18.6	58·434	271·72	345·96	6434·856	4·3128	2.6495
18.7	58·748	274·65	349·69	6539·203	4·3243	2.6543
18.8	59·062	277·59	353·44	6644·672	4·3459	2.6590
18.9	59·376	280·55	357·21	6751·269	4·3474	2.6637
19·0	59.690	283.53	361·00	6859·000	4·3589	2.6684
19·1	60.004	286.52	364·81	6967·871	4·3703	2.6731
19·2	60.319	289.53	368·64	7077·888	4·3818	2.6777
19·3	60.633	292.55	372·49	7189·057	4·3942	2.6824
19·4	60.947	295.59	376·36	7301·384	4·4045	2.6869
19·5	61·261	298·65	380·25	7414·875	4·4159	2.6916
19·6	61·575	301·72	384·16	7529·536	4·4272	2.6962
19·7	61·889	304·81	388·09	7642·373	4·4385	2.7008

TABLE 34—Continued.

n	πn	$\pi \frac{n^2}{4}$	n^2	n³	\sqrt{n}	$\sqrt[3]{n}$
19.8	62.204	307.91	392.04	7762:392	4.4497	2.7053
19.9	62.518	311.03	396.01	7880.599	4.4609	2.7098
20.0	62.832	314.16	400.00	8000.000	4.4721	2.7144
20.1	63·146 63·460	317·31 320·47	404·01 408·04	8120·601 8242·408	4.4833	2·7189 2·7234
20.3	63.774	323.66	412.09	8365.427	4.5055	2.7279
20.4	64.088	326.85	416.16	8489.664	4.5166	2.7324
20.5	64.403	330.06	420.25	8615.125	4.5277	2.7368
20.6	64.717	333.29	424.36	8741.816	4.5387	2.7413
20.7	65.031	336.54	428-49	8869.743	4.5497	2.7457
20.8	65.345	339.80	432.64	8998-912	4.5607	2.7502
20.9	65.659	343.07	436.81	9129:329	4.5716	2.7545
21.0	65.973	346.36	441.00	9261.000	4.5826	2.7589
21.1	66.288	349.67	445.21	9393-931	4.5935	2.7633
21.3	66.602 66.916	352.99	449·44 453·69	9528·128 9663·597	4.6043	2.7676
21.4	67.230	356·33	457.96	9800.344	4·6152 4·6260	2.7763
21.5	67.544	363.05	462:25	9938:375	4.6368	2.7806
21.6	67.858	366.44	466.56	10077.696	4.6476	2.7849
21.7	68.173	369.84	470.89	10218:313	4.6583	2.7893
21.8	68.487	373.25	475.24	10360-232	4.6690	2.7935
21.9	68.801	376.69	479.41	10503.459	4.6797	2.7978
22.0	69.115	380.13	484.00	10648.000	4.6904	2.8021
22.1	69.429	383.60	488-41	10793.861	4.7011	2.8063
22.3	69·743 70·058	387·08 390·57	492·84 497·29	10941·048 11089·567	4·7117 4·7223	2.8105 2.8147
22.4	70 038	394.08	501.76	11239.424	4.7329	2.8189
22.5	70.686	397.61	506.25	11390.625	4.7434	2.8231
22·6 22·7	71.000	401.15	510.76	11543.176	4.7539	2.8273
22.8	71.314	404.71	515·29 519·84	11697·083 11852·352	4.7644	2·8314 2·8356
22.9	71.942	411.87	524.41	12008-989	4.7854	2.8397
23.0	72.257	415.48	529.00	12167.000	4.7958	2.8438
23.1	72.571	419.10	533.61	12326:391	4.8062	2.8479
23.2	72.885	422.73	538.24	12487 168	4.8166	2 8521
23.3	73.199	426.39	542.89	12649 337	4.8270	2.8562
23.4	73.513	430.05	547:56	12812.904	4.8373	2.8603
		<u> </u>	1	i	1	

TABLE 34—Continued.

n	πn	$\pi \frac{n^2}{4}$	n^2	n^3	\sqrt{n}	$\sqrt[3]{n}$
23.5	73.827	433.74	552 25	12977 875	4.8477	2.8643
23.6	74.142	437.44	556.96	13144 256	4.8580	2.8684
23.7	74.456	441.15	561.69	13312.053	4.8683	2.8724
23.8	74.770	444.88	566.44	13481 272	4.8785	2.8765
23.9	75.084	448 63	571-21	13651.919	4.8888	2.8805
24.0	75.398	452.39	576.00	13824.000	4.8990	2.8845
24.1	75.712	456.17	580.81	13997.521	4.9092	2.8885
24.2	76.027	459.96	585.64	14172 • 488	4.9192	2.8925
24.3	76.341	463 77	590.49	14348 907	4.9295	2.8965
24.4	76.655	467.60	595.36	14526.784	4.9396	2.9004
24.5	76.969	471.44	600-25	14706.125	4.9497	2.9044
24.6	77:283	475.29	605 16	14886.936	4.9598	2.9083
24.7	77.597	479.16	610.09	15069-223	4.9699	2.9123
24.8	77.911	483.05	615.04	15252.992	4.9799	2.9162
24.9	78.226	486.96	620.01	15438 249	4.9899	2.9201
25.0	78.540	490.87	625.00	15625.000	5.0000	2.9241
25.1	78.854	494.81	630.01	15813-251	5.0099	2.9279
25.2	79.168	498.76	635 04	16003.008	5.0199	2.9318
25.3	79.482	502.73	640.09	16194.277	5.0299	2.9356
25.4	79-796	506.71	645.16	16387.064	5.0398	2.9395
25.5	80.111	510.71	650.25	16581.375	5.0497	2.9434
25.6	80 425	514.72	655.36	16777 216	5.0596	2.9472
25.7	80.739	518.75	660.49	16974.593	5.0695	2.9510
25.8	81.053	522.79	665.64	17173.512	5.0793	2.9549
25.9	81.367	526.85	670.81	17373.979	5.0892	2.9586
26.0	81.681	530.93	676.00	17576.000	5.0990	2.9624
26.1	81.996	535.02	681.21	17779.581	5.1088	2.9662
26.2	82.310	539.13	686.44	17984 728	5.1185	2 9701
26.3	82.624	543.25	691.69	18191 447	5.1283	2.9738
26.4	82.938	547.39	696.96	18399 744	5.1380	2.9776
26.5	83.252	551.55	702-25	18609.625	5.1478	2.9814
26.6	83.566	555.72	707.56	18821 096	5.1575	2.9851
26.7	83.881	559.90	712.89	19034.163	5.1672	2.9888
26.8	84.195	564.10	718.24	19248.832	5.1768	2.9926
26.9	84.509	568 32	723.61	19465.109	5.1865	2.9963
27.0	84 823	572.56	729.00	19683.000	5.1962	3.0000
27.1	85.137	576.80	734.41	19902.511	5.2057	3.0037
27.2	85.451	581.07	739.84	20123.648	5.2153	3.0074

TABLE 34—Continued.

n	π n Ο	$\frac{n^2}{4}$	n^2	n^3	\sqrt{n}	$\sqrt[3]{n}$
27·3	85·765	585°35	745·29	20346·417	5·2249	3·0111
27·4	86·080	589°65	750·76	20570·824	5·2345	3·0147
27.5	86·394	593·96	756·25	20796 ·875	5·2440	3.0184
27.6	86·708	598·29	761·76	21024 ·576	5·2535	3.0221
27.7	87·022	602·63	767·29	21253 ·933	5·2630	3.0257
27.8	87·336	606·99	772·84	21484 ·952	5·2725	3.0293
27·9	87.650	611·36	778·41	21717·639	5·2820	3.0330
28·0	87.965	615·75	784·00	21952·000	5·2915	3.0366
28·1	88.279	620·16	789·61	22188·041	5·3009	3.0402
28·2	88.593	624·58	795·24	22425·768	5·3103	3.0438
28·3	88.907	629·02	800·89	22665·187	5·3197	3.0474
28·4	89·221	633·47	806 • 56	22906·304	5·3291	3.0510
28·5	89·535	637·94	812 • 25	23149·125	5·3385	3.0546
28·6	89·850	642·42	817 • 96	23393·656	5·3478	3.0581
28·7	90·164	646·93	823 • 69	23639·903	5·3572	3.0617
28·8	90·478	651 · 44	829·44	23887·872	5·3665	3.0652
28·9	90·792	655 · 97	835·21	24137·569	5·3758	3.0688
29·0	91·106	660 · 52	841·00	24389·000	5·3852	3.0723
29·1	91.420	665.08	846·81	24642·171	5·3944	3.0758
29·2	91.735	669.66	852·64	24897·088	5·4037	3.0794
29·3	92.049	674.26	858·49	25153·757	5·4129	3.0829
29·4	92.363	678.87	864·36	25412·184	5·4221	3.0864
29.5	92.677	683·49	870-25	25672·375	5.4313	3.0899
29.6	92.991	688·13	876-16	25934·336	5.4405	3.0934
29.7	93.305	692·79	882-09	26198·073	5.4497	3.0968
29.8	93.619	697·47	888-04	26463·592	5.4589	3.1003
29.9	93.934	702·15	894-01	26730·899	5.4680	3.1038
30·0 30·1 30·2 30·3	94.248 94.562 94.876 95.190 95.504	706·86 711·58 716·32 721·07 725·83	900·00 906·01 912·04 918·09 924·16	27000·000 27270·901 27543·608 27818·127	5·4772 5·4863 5·4954 5·5045	3-1072 3-1107 3-1141 3-1176
30·4 30·5 30·6 30·7 30·8	95.819 96.133 96.447 96.761	730.62 735.42 740.23 745.06	930°25 936°36 942°49 948°64	28094·464 28372·625 28652·616 28934·443 29218·112	5.5136 5.5226 5.5317 5.5407 5.5497	3·1210 3·1244 8·1278 3·1312 3·1346
30.9	97.075	749.91	954-81	29503.629	5.5587	3.1380

TABLE 34—Continued.

n	πn Ο	$\pi \frac{n^2}{4}$	n ²	n ³	\sqrt{n}	$\sqrt[3]{n}$
31·0 31·1 31·2	97·389 97·704 98·018	754·77 759·65 764·54	961·00 967·21 973·44	29791·000 30080·231 30371·328	5·5678 5·5767	3·1414 3·1448
31·3 31·4	98·332 98·646	769·45 774·37	979·69 985·96	30664·297 30959·144	5.5857 5.5946 5.6035	3·1481 3·1515 3·1549
31.5	98.960	779·31	992·25	31255·875	5.6124	3·1582
31.6	99.274	784·27	998·56	31554·496	5.6213	3·1615
31.7	99.588	789·24	1004·89	31855·013	5.6302	3·1648
31.8	99.903	794·23	1011·24	32157·432	5.6391	3·1681
31.9	100.22	799·23	1017·61	32461·759	5.6480	3·1715
32·0	100.53	804·25	1024.00	32768·000	5.6569	3·1748
32·1	100.85	809·28	1030.41	33076·161	5.6656	3·1781
32·2	101.16	814·33	1036.84	33386·248	5.6745	3·1814
32·3	101.47	819·40	1043.29	33698·267	5.6833	3·1847
32·4	101.79	824·49	1049.76	34012·224	5.6921	3·1880
32.5	102·10	829.58	1056:25	34328·125	5.7008	3·1913
32.6	102·42	834.69	1062:76	34645·976	5.7056	3·1945
32.7	102·73	839.82	1069:29	34965·783	5.7183	3·1978
32.8	103·04	844.96	1075:84	35287·552	5.7271	3·2010
32.9	103·36	850.12	1082:41	35611·289	5.7358	3·2043
33·0	103.67	855·30	1089.00	35937:000	5.7447	3·2075
33·1	103.99	860·49	1095.61	36264:691	5.7532	3·2108
33·2	104.30	865·70	1102.24	36594:368	5.7619	3·2140
33·3	104.62	870·92	1108.89	36925:037	5.7706	3·2172
33·4	104.93	876·19	1115.56	37259:704	5.7792	3·2204
33.5	105.24	881·41	1122·25	37595·375	5.7879	3·2237
33.6	105.56	886·68	1128·96	37933·056	5.7965	3·2269
33.7	105.87	891·97	1135·69	38272·753	5.8051	3·2301
33.8	106.19	897·27	1142·44	38614·472	5.8137	3·2332
33.9	106.50	902·59	1149·21	38958·219	5.8223	3·2364
34·0	106.81	907·92	1156.00	39304·000	5.8310	3·2396
34·1	107.13	913·27	1162.81	39651·821	5.8395	3·2424
34·2	107.44	918·63	1169.64	40001·688	5.8480	3·2460
34·3	107.76	924·01	1176.49	40353·607	5.8566	3·2491
34·4	108.07	929·41	1183.36	40707·584	5.8751	3·2522
34·5	108:38	934·82	1190·25	41063·525	5·8736	3·2554
34·6	108:70	940·25	1197·16	41421·736	5·8821	3·2586
34·7	109:01	945·69	1204·09	41781·923	5·8906	3·2617

TABLE 34—Continued.

n	π n Ο	$\pi \frac{n^2}{4}$	n^2	n ⁸	\sqrt{n}	$\sqrt[3]{n}$
34·8	109·33	951·15	1211:04	42144·192	5·8991	3·2648
34·9	109·64	956·62	1218:01	42508·549	5·9076	3·2679
35·0	109·96	962·11	1225·00	42875 000	5.9161	3·2710
35·1	110·27	967·62	1232·01	43243 551	5.9245	3·2742
35·2	110·58	973·14	1239·04	43614 208	5.9326	3·2773
35·3	110·90	978·68	1246·09	43986·977	5-9413	3·2804
35·4	111·21	984·23	1253·16	44361·864	5-9497	3·2835
35.5	111.53	989.80	1260 · 25	44738·875	5.9581	3·2866
35.6	111.84	995.38	1267 · 36	45118·016	5.9665	3·2897
35.7	112.15	1000.98	1274 · 49	45499·293	5.9749	3·2927
35.8	112.47	1006.60	1281 · 64	45882·712	5.9833	3·2958
35.9	112.78	1012.23	1288 · 81	46268·279	5.9916	3·2989
36·0	113·10	1017 88	1296.00	46656 000	6.0000	3·3019
36·1	113·41	1023 54	1303.21	47045 881	6.0083	3·3050
36·2	113·73	1029 22	1310.44	47437 928	6.0166	3·3080
36·3	114·04	1034 91	1317.69	47832 147	6.0249	3·3111
36·4	114·35	1040 62	1324.96	48228 544	6.0332	3·3141
36.5	114.67	1046·35	1332·25	48627·125	6.0415	3 3171
36.6	114.98	1052·09	1339·56	49017·896	6.0497	3 3202
36.7	115.30	1057·84	1346·89	49430·863	6.0580	3 3232
36.8	115.61	1063·62	1354·24	49836·032	6.0663	3 3262
36.9	115.92	1069·41	1361·61	50243·409	6.0745	3 3292
37·0	116.24	1075 21	1369.00	50653.000	6.0827	3·3322
37·1	116.55	1081 03	1376.41	51064.811	6.0909	3·3352
37·2	116.87	1086 87	1383.84	51478.848	6.0991	3·3382
37·3	117.18	1092 72	1391.29	51895.117	6.1073	3·3412
37·4	117.50	1098 58	1398.76	52313.624	6.1155	3·3442
37.5	117.81	1104·47	1406 · 25	52734·375	6·1237	3·3472
37.6	118.12	1110·36	1413 · 76	53157·376	6·1318	3·3501
37.7	118.44	1116·28	1421 · 29	53582·633	6·1400	3·3531
37.8	118.75	1122·21	1428 · 84	54010·152	6·1481	3·3561
37.9	119.07	1128·15	1436 · 41	54439·939	6·1563	3·3590
38·0	119 38	1134·11	1444.00	54872.000	6:1644	3:3620
38·1	119 69	1140·09	1451.61	55306.341	6:1725	3:3649
38·2	120 01	1146·08	1459.24	55742.968	6:1806	3:3679
38·3	120 32	1152·09	1466.89	56181.887	6:1887	3:3708
38·4	120 64	1158·12	1474.56	96623.104	6:1967	3:3737

TABLE 34-Continued.

n	πn Ο	$\pi \frac{n^2}{4}$ \bullet	n^2	n³	\sqrt{n}	$\sqrt[3]{n}$
38.5	120 •95	1164·16	1482·25	57066 ·625	6.2048	3·3767
38.6	121 •27	1170·21	1489·96	57512 ·456	6.2129	3·3797
38.7	121 •58	1176·28	1497·69	57960 ·603	6.2209	3·3825
38.8	121 •80	1182·37	1505·44	58411 ·072	6.2289	3·3854
38.9	122 •21	1188·47	1513·21	58863 ·869	6.2370	3·3883
39·0	122.52	1194·59	1521:00	59819 000	6.2450	3·3912
39·1	122.84	1200·72·	1528:81	59776 471	6.2530	3·3941
39·2	123.15	1206·87	1536:64	60236 288	6.2610	3·3970
39·3	123.46	1213·04	1544:49	60698 457	6.2689	3·3999
39·4	123.78	1219·22	1552:36	61162 984	6.2769	3·4028
39.5	124.09	1225·42	1560 • 25	61629.875	6.2849	3.4056
39.6	124.41	1231·63	1568 • 16	62099.136	6.2928	3.4085
39.7	124.72	1237·86	1576 • 09	62570.773	6.3008	3.4114
39.8	125.04	1244·10	1584 • 04	63044.792	6.3087	3.4142
39.9	125.35	1250·36	1592 • 01	63521.199	6.3166	8.4171
40.0	125.66	1256.64	1600.00	64000·000	6·3245	3·4200
40.1	125.98	1262.93	1608.01	64481·201	6·3325	3·4228
40.2	126.29	1269.23	1616.04	64964·808	6·3404	3·4256
40.3	126.61	1275.56	1624.09	65450·827	6·3482	3·4285
40.4	126.92	1281.90	1632.16	65939·264	6·3561	3·4313
40.5	127 ·23	1288.25	1640 · 25	66430·126	6·3639	3·4341
40.6	127 ·55	1294.62	1648 · 36	66923·416	6·3718	3·4370
40.7	127 ·86	1301.00	1656 · 49	67419·143	6·3796	3·4398
40.8	128 ·18	1307.41	1664 · 64	67917·312	6·3875	3·4426
40.9	128 ·49	1313.82	1672 · 81	68417·929	6·3953	3·4454
41.0	128·81	1320·25	1681.00	68921 000	6·4031	3·4482
41.1	129·12	1326·70	1689.21	69426 531	6·4109	3·4510
41.2	129·43	1333·17	1697.44	69934 528	6·4187	3·4538
41.3	129·75	1339·65	1705.69	70444 997	6·4265	3·4566
41.4	130·06	1346·14	1713.96	70957 944	6·4343	3·4594
41.5	130·38	1352.65	1722:25	71473·375	6.4421	3·4622
41.6	130·69	1359.18	1730:56	71991·296	6.4498	3·4650
41.7	131·00	1365.72	1738:89	72511·719	6.4575	3·4677
41.8	131·32	1372.28	1747:24	73034·632	6.4653	3·4705
41.9	131·63	1378.85	1755:61	73560·059	6.4730	3·4733
42·0	131·95	1385·44	1764·00	74088·000	6.4807	3·4760
42·1	132·26	1392·05	1772·41	74618·461	6.4884	3·4788
42·2	132·58	1398·67	1780·84	75151·448	6.4961	3·4815

TABLE 34-Continued.

n	πn	$\pi \frac{n^2}{4}$	n^2	n^3	\sqrt{n}	$\sqrt[3]{n}$
42.3	132.89	1405:31	1789:29	75686.967	6.5038	3.4843
42.4	133 20	1411.96	1797.76	76225:024	6.5115	3.4870
42.5	133.52	1418.63	1806.25	76765-625	6.5192	3.4898
42.6 42.7	133.83 134.15	1425·31 1432·01	1814·76 1823·29	77308·776 77854·483	6.5345	3·4925 3·4952
42.8	134 46	1438.72	1831.84	78402.752	6.5422	3.4980
42.9	134.77	1445.45	1840.41	78953-589	6.5498	3.5007
43.0	135.09	1452-20	1849.00	79507.000	6.5574	3.5034
43.1	135.40	1458.96	1857.61	80062-991	6.5651	3.5061
43.2	135.72	1465.74	1866.24	80621.568	6.5727	3.5088
43.3	136.03	1472.54	1874.89	81182.737	6.2803	3.5115
43.4	136.35	1479:34	1883.56	81746.504	6.5879	3.5142
43.5	136.66	1486-17	1892.25	82312-875	6.5954	3.5169
43.6	136.97	1493.01	1900.98	82881 856	6.6030	3.5196
43.7	137.29	1499.87	1909.69	83453.453	6.6106	3.5223
43·8 43·9	137·60 137·92	1506·74 1513·63	1918·44 1927·21	84027·672 84604·519	6.6182	3.5250 3.5277
	100.00					
44.0	138.23	1520.53	1936:00	85184.000	6.6333	3.5303
44.1	138·54 138·86	1527·45 1534·39	1944·81 1953·64	85766·121 86350·888	6.6408	3·5330 3·5357
44.3	139.17	1541.34	1962:49	86938-307	6.6558	3.5384
44.4	139.49	1548.30	1971.36	87528:384	6.6633	3.5410
44.5	139.80	1555.28	1980.25	8 81 21 ·125	6.6708	3:5437
44.6	140.12	1562.28	1989-16	88716.536	6.6783	3.5463
44.7	140.43	1569.30	1998.09	89314.623	6.6858	3.5490
44.8	140.74	1576.33	2007:04	89915:392	6.6933	3.5516
44.9	141.06	1583:37	2016 01	90518.849	6.7007	3.5543
45.0	141.37	1590.43	2025.00	91125.000	6.7082	3.5569
45 1	141.69	1597.51	2034.01	91733-851	6.7156	3.5595
45.2	142.00	1604.60	2043.04	92345 408	6.7231	3.5621
45·3 45·4	142·31 142·63	1611·71 1618·83	2052·09 2061·16	92959·677 93576·664	6.7305	3·5648 3·5674
101	112 00		2001 10	20010 004	3 1019	3 301 1
45.5	142.94	1625.97	2070.25	94196.375	6.7454	3.5700
45.6	143.26	1633.13	2079:36	94818.816	6.7528	3.5726
45·7 45·8	143.57 143.88	1640·30 1647·48	2088·49 2097·64	95443·993 96071·912	6.7602	3.5752
45.9	144.20	1654.68	2106.81	96702.579	6.7676	3·5778 3·5805
				00.0000	*****	3 5 5 5 6 6

TABLE 34—Continued.

		1		· · · · · · · · · · · · · · · · · · ·	T-	
	πn	$\pi \frac{n^2}{4}$				· —
n	0	. 4	n^2	n^3	\sqrt{n}	$\sqrt[3]{n}$
		•			<u>_</u> .	
10.0			0170.00	25000.000	0.7000	0.7000
46.0	144.51	1661 90	2116.00	97336.000	6.7823	3.5830
46.1	144-83	1669.14	2125.21	97972.181	6.7897	3.5856
46.2	145.14	1676.39	2134.44	98611.128	6.7971	3.5882
46.3	145.46	1683.65	2143.69	99252.847	6.8044	3.5908
46.4	145.77	1690.93	2152.96	99897:344	6.8117	3.5934
46.5	146.08	1698 23	2162 25	100544 625	6.8191	3.5960
46.6	146.40	1705 54	2171.56	101194.696	6.8264	3.5986
46.7	146.71	1712 87	2180.89	101847.563	6.8337	3 6011
46.8	147.03	1720.21	2190.24	102503-232	6.8410	3.6037
46.9	147:34	1727.57	2199.61	103161.709	6.8484	3.6063
47.0	147.65	1734 94	2209 00	103823 000	6.8556	3.6088
47.1	147.97	1742.34	2218 41	104487 111	6 8629	3.6114
47 2	148.28	1749 74	2227.84	105154.048	6 8702	3.6139
47.3	148.60	1757 16	2237 29	105823 817	6.8775	3.6165
47.4	148.91	1764.60	2246.76	106496.424	6.8847	3.6190
47.5	149:23	1772.05	2256.25	107171 875	6.8920	3.6216
47.6	149.54	1779.52	2265 76	107850.176	6.8993	3.6241
47.7	149 85	1787 01	$2275 \cdot 29$	108531 333	6.9065	3.6267
47.8	150.17	1794.51	2284 84	109215 352	6.9137	3.6292
47.9	150.48	1802:03	2294 41	109902:239	6.9209	3.6317
48.0	150.80	1809.56	2304.00	110592.000	6.9282	3.6342
48.1	151.11	1817:11	2313.61	111284 641	6.9354	3.6368
48.2	151.42	1824.67	2323 24	111980.168	6.9426	3.6393
48.3	151.74	1832.25	2332 89	112678 587	6 9498	3 6418
48.4	152.05	1839.84	2342.56	113379 904	6.9570	3.6443
48.5	152:37	1847-45	2352.25	114084.125	6.9642	3.6468
48.6	152.68	1855.08	2361 96	114791 256	6.9714	3.6493
48.7	153.00	1862.72	2371 69	115501.303	6.9785	3.6518
48.8	153:31	1870.38	2381.44	116214-272	6 9857	3.6543
48.9	153.62	1878.05	2391 21	116930.169	6.9928	3 6568
49.0	153.94	1885.74	2401.00	117649 000	7.0000	3.6593
49.1	154.25	1893.45	2410.81	118370 <i>•</i> 771	7.0071	3.6618
49.2	154.57	1901.17	2420.64	119095.488	7.0143	3.6643
49.3	154.88	1908 90	2430.49	119823-157	7.0214	3 6668
49.4	155.19	1916.65	2440.36	120553.784	7.0285	3 6692
49.5	155.51	1924.42	$2450 \cdot 25$	121287:375	7 0356	3.6717
49.6	155.82	1932-21	2460.16	122023 936	7.0427	3 6742
49.7	156.14	1940.00	2470.09	122763.473	7.0498	3.6767
,						

TABLE 34-Continued.

n	πп	$\pi \frac{n^2}{4}$	n^2	n ³	\sqrt{n}	$\sqrt[3]{n}$
	0	•			~76	\\\ \"\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\
49.8	156.45	1947 82	2480.04	123505 992	7.0569	3.6791
49.9	156.77	1955.65	2490.01	124251 499	7.0640	3.6816
50·0 51·0	157.08 160.22	1963·50 2042·82	2500.00 2601.00	125000·000 132651·000	7·0711 7·1414	3.6840 3.7084
52.0	163.36	2123.72	2704.00	140608:000	7.2111	3.7325
53.0	166.50	2206.19	2809.00	148877.000	7.2801	3.7563
54.0	169.64	2290.22	2916.00	157464.000	7.3485	3.7798
55.0	172.78	2375.83	3025.00	166375.000	7.4162	3.8030
56·0 57·0	175.93 179.07	2463·01 2551·76	3136.00 3249.00	175616.000 185193.000	7·4833 7·5498	3.8259
58.0	182.21	2642.08	3364.00	195112.000	7.6158	3.8485 3.8709
59.0	185.35	2733.97	3481.00	205379.000	7.6811	3.8930
60.0	188-49	2827:44	3600·00	216000.000	7.7460	3.9149
61.0	191.63	2922.47	3721 .00	226981.000	7.8102	3.9365
62.0	194.77	3019.07	3844.00	238328 000	7.8740	3.9579
63.0 64.0	197·92 201·06	3117·25 3216·99	3969·00 4096·00	250047·000 262144·000	7 · 9373 8 · 0000	3.9791
		1		202144 000	8-0000	4.0000
65.0	204.20	3318.31	4225-00	274625.000	8.0623	4.0207
66.0	207·34 210·48	3421 ·20 3525 ·66	4356.00 4489.00	287496:000	8 1240	4.0412
68-0	213.63	3631.69	4624.00	300763·000 314432·000	8·1854 8·2462	4.0615 4.0817
69.0	216.77	3739.29	4761.00	328509.000	8.3066	4.1016
70.0	219.91	3848 • 46	4900.00	343000.000	8.3666	4.1213
71.0	223.05	3959.20	5041.00	357911.000	8 4261	4.1408
72.0	226·19 229·33	4071·51 4185·39	5184.00 5329.00	373248·000 389017·000	8.4853	4.1602
74.0	232.47	4300.85	5476.00	405224.000	8.5440 8.6023	4.1793
1						
75·0 76·0	235·62 238·76	4417·87 4536·47	5625.00 5776.00	421875.000	8.6603	4.2172
77.0	241.90	4656.63	5929:00	438976 000 456533 000	8·7178 8·7750	4.2358 4.2543
78.0	245.04	4778.37	6084.00	474552.000	8.8318	4.2727
79.0	248.18	4901.68	6241.00	493039.000	8.8882	4.2908
80.0	251.32	5026-56	6400.00	512000.000	8.9443	4.3089
81.0	254.47	5153.01	6561.00	531441.000	9.0000	4 3267
82·0 83·0	257·61 260·75	5281·03 5410·62	6724.00 6889.00	551368·000 571787·000	9.0554	4.3445
84.0	263.89	5541.78	7056.00	592704.000	9·1104 9·1652	4·3621 4·3795
		5512 ,0		552, 54 556	1002	# 0199

TABLE 34-Continued.

n	π n	$\pi \frac{n^2}{4}$ \bullet	n^2	n^3	\sqrt{n}	$\sqrt[3]{n}$
85.0 86.0 87.0 88.0 89.0 90.0 91.0 92.0 93.0 94.0	267·03 270·17 273·32 276·46 279·60 282·74 285·88 289·02 292·17 295·31	5674·50 5808·81 5944·69 6082·13 6221·13 6361·74 6503·89 6647·62 6792·92 6792·92	7225 00 7396 00 7569 00 7744 00 7921 00 8100 00 8281 00 8464 00 8649 00 8836 00	614125 · 000 636056 · 000 658503 · 000 681472 · 000 704969 · 000 729000 · 000 753571 · 000 804357 · 000 8305584 · 000	9·2195 9·2736 9·3274 9·3808 9·4330 9·4868 9·5394 9·5917 9·6437 9·6954	4·3968 4·4140 4·4310 4·4480 4·4647 4·4814 4·4979 4·5144 4·5307
95.0 96.0 97.0 98.0 99.0	298·45 301·59 304·73 307·87 311·02	7088·23 7238·24 7389·83 7542·98 7697·68 7854·00	9025 00 9216 00 9409 00 9604 00 9801 00	857375·000 884736·000 912673·000 941192·000 970299·000	9*6954 9*7468 9*7980 9*8489 9*8995 9*9499	4 5468 4 5629 4 5789 4 5947 4 6104 4 6261 4 6416

Approximately $\sqrt{a^2 \pm b} = a \pm \frac{b}{2a}$ and $\sqrt[3]{a^3 \pm b} = a \pm \frac{b}{3a^2}$

TABLE 35.—FORMULÆ FOR MENSURATION OF AREAS AND SOLID CONTENTS.

1.—Triangle.

Area = $\frac{1}{2}$ × base × height.

If all the sides, a, b, c, are known and half their sum is represented by s, so that $s = \frac{a+b+c}{2}$ then

$$A = \sqrt{s(s-a)(s-b)(s-c)}$$

2.-Circle.

Area of circle, if d = diameter, r = radius, and $\pi = 3.14159$

$$\mathbf{A} = \frac{\pi}{4}d^{2} = r^{2}\pi \cdot \cdot \cdot \left(\frac{\pi}{4} = 0.7854\right)$$
$$d = 1.12838\sqrt{\mathbf{A}}$$

Area of segment of circle of an arc of a^0

$$\mathbf{A} = \left(\frac{a}{180}\pi - \sin a\right) \frac{r^2}{2}$$

Or, if d is the diameter and h the height of segment, calculate $\frac{h}{d}$ and find the value x, in the following table, corresponding to $\frac{h}{d}$; the square of the diameter multiplied by x, gives the area of the segment.

Area of segment = xd^2 .

<u>h</u>	x	_ <u>h</u>	x	<u>h</u>	æ	<u>h</u>	x
·01 ·02 ·03 ·04 ·05 ·06 ·07 ·08 ·09 ·10 ·11 ·12	00133 00375 00687 01054 01924 02417 02944 03501 04087 04701 05338 06000	14 15 16 17 18 19 20 21 22 23 24 25 26	**06688 **07387 **08111 **08854 **09613 **10390 **11182 **11990 **12811 **13646 **14495 **15355 **16226	27 28 29 30 31 32 33 34 35 36 37 38	-17109 -18002 -18905 -19817 -21667 -22603 -23547 -24498 -25455 -26418 -27386 -28359	•40 •41 •42 •43 •44 •45 •46 •47 •48 •49 •50	-29337 -30319 -31304 -32293 -33284 -34278 -35274 -36272 -37270 -38270 -39270

3.—Cone and Pyramid.

Solid content: $S = \frac{1}{3}$ base \times height.

Area of convex surface of right cone: When s = side of cone $= \sqrt{r^2 \times h^2}$, where r = radius of base and h = height of cone, the area of convex surface will be

$$A = \pi rs.$$

4.—Cylinder.

Area of convex surface $A = 2\pi rh$.

Content of cylinder $S = base \times height.$

5.-Sphere.

Convex surface $A = 4\pi r^2 = 12.56636r^2$.

Surface of segment $A = 2\pi rh$, h =height of segment.

Solid content of sphere $S = \frac{4}{3} r^3 \pi = 4.1888 r^3$.

Solid content of sphere $S = \frac{1}{6}\pi d^3 = 0.5236d^3$.

Radins

$$r = 0.62035 \sqrt[3]{\text{content.}}$$

Content of segment of sphere: If a is the radius of the sectional area, h the height of the segment, and r the radius of the sphere,

$$S = \frac{1}{6}\pi h(3a^2 + h^2)$$
$$= \frac{1}{3}\pi h^2(3r - h).$$

Solid content of spherical zone: If a and b are the respective radii of the two terminal surfaces, and h the height,

$$S = \frac{1}{6}\pi h(3a^2 + 3b^2 + h^2).$$

TABLE 36.—WEIGHTS AND MEASURES OF DIFFERENT COUNTRIES.

- 1. Metric System (compulsory in France, Germany, Austria, the Netherlands, Belgium, Luxemburg, Switzerland, Italy, Greece, Turkey, Roumania, Spain, Portugal, and most of the South American Republics; optional in Great Britain, the United States, and Russia).
 - 1 metre (m.) = 443.296 Paris lignes = 3.280899 English feet = 3.18620Prussian feet=1.00000301 mètres des archives.
 - 1 kilometre (km.)=10 hectometres (hm.)=0.6214 English mile = 0.1328 Prussian mile = 0.9375 Russian verst = 0.5390 nautical mile = 0.1347 geographical mile (15 to 1 degree of longitude).
 - 1 lieue (France)=1 myriametre=10 km.
 - 1 German mile = 7½ km. = 0.996 Prussian mile = 4.66 Euglish miles.
 - 1 hectare (ha.)=100 ares (a.)=10,000 sq.m.=0.01 sq.km.=2.471English acres.
 - 1 litre (\tilde{l} .)=0.001 cb.m.=1000 c.cm.=0.2201 gallon.
 - 1 hectolitre (hl.)=0.1 cb.m. = 100 l. = 22.01 gallons.
 - 1 kilogram (kg.)=1000 g.=weight of 1 litre of water at +4° C. =2 German and Swiss pounds (zollpfund)=0.999999842 kilogram prototype = 2.2046 pounds avoirdupois = 1.7857 Austrian pounds=2.3511 Swedish pounds=2.4419 Russian pounds.

 - 1 gram (g.)=15 432 grains (English). 1 quintal=100 kg.=196 84 lbs. avoirdupois=1 cwt. 3 qrs. 0 84 lb.
 - 1 metrical ton=1000 kg. =0.9842 English ton=1.023 American short tons (at 2000 lbs.).

TABLE 36—Continued.

2. Great Britain and Ireland.

```
1 foot = 0.3047943 m.
```

1 inch = 25.3995 mm.

1 yard = 3 feet = 0.9143835 m.

1 fathom = 2 yards = 1.829 m.

1 rod (pole, perch) = $5\frac{1}{2}$ yards = 5.029109 m.

1 statute mile=8 furlongs=320 poles=1760 yards=5280 feet =1.6093 kilometre (km.).

1 nautical mile = $\frac{1}{10}$ th degree (at the equator).

6082.66 feet = 1854.96 m.

1 acre = 4 roods = 160 poles = 0.40467 ha. = 43560 square feet = 4047square metres.

1 square mile = 640 acres = 258.989 ha.

1 gallon = 4 quarts = 8 pints = 277.274 cubic inches = 4.536 litres.

1 cubic foot = 1728 cubic inches = 28.3153 l.

1 cubic inch = 16.3862 c.cm.

1 quarter=8 bushels=32 pecks=64 gallons=2.903 hl.

1 bushel = 8 gallous = 0.3628 hl.

1 fluid ounce = $\frac{1}{20}$ th pint = 28.35 c.cm.

1 pound avoirdupois (lb.) = 16 ounces (oz.) = 7000 grains = 0.4535926

1 ounce avoirdupois = $437\frac{1}{2}$ grains = 28.35 g.

1 gallon = 10 lbs. water = 70.000 grains = 4.535926 kg. water.

1 hundredweight (cwt.)=4 quarters (qr.)=8 stones=112 lbs. =50.8024 kg.

1 ton = 20 cwt. = 2240 lbs. = 1016.648 kg.

Apothecaries' Weight.

1 pound troy=12 ounces troy=96 drams=288 scruples=5760 grains = 373.24195 g.

1 ounce troy = 8 drams = 24 scruples = 480 grains = 31.1035 g.

I ounce troy (for gold and precious stones)=20 pennyweight (dwt.) = 480 grains = 31.1035 g.

1 pennyweight (\overline{d} wt.)=1 552 g.

1 grain (common to avoirdupois and troy weight) = 0.06479895 g.

3. Austria (old measures and weights, now abolished for the metric system).

1 foot = 0.316102 m., at 12 inches of 12 lines each.

3 ruthen = 5 klafter = 30 feet = 360 zoll.1 meile = 4000 klafter = 7586.455 m.

1 maass=1.415 l.

1 eimer = 40 maass = 160 seidel.

1 metze = 61.4995 l.

1 Wiener pfund = 560.012 g.

1 centner=5 stein=100 pfund=3200 loth.

4. Denmark and Norway employ, as unit of measure, the Prussian foot, as unit of weight the units of the metrical system, viz., kilos, etc.

TABLE 36-Continued.

- 5. Prussia (old system, now abolished for the metric system).
 - 1 foot (Rhenish foot)=12 zoll (inches)=144 linien=0.313853 m.
 - 1 ruthe = 12 fuss = 3.76624 m.
 - 1 lachter (fathom) = 80 zoll = 2.09326 m.
 - 1 meile = 24,000 fuss = 7532.5 m.
 - 1 morgen = 180 square ruthen = 0.2553 ha.
 - 1 quart = 64 cubic inches = $\frac{1}{2\pi}$ cubic foot = 1.14503 l.
 - 1 scheffel = 16 Metzen = 48 quarts = 0.54961 hl.
 - 1 tonne=4 scheffel=2.19846 hl.
 - 1 klafter = 108 cubic fuss = 3:3389 cb.m.
 - 1 schachtruthe = 144 cubic fuss = 4.4519 cb.m.
 - 1 schachtruthe = 144 cubic russ = 4.4519 ct 1 pfund = 30 loth = 300 quentchen = 500 g.
 - 1 centner=100 pfund=50 kg. (Formerly 1 pfund=32 loth =467.711 g.; 1 centner=110 pfund.)

6. Russia.

- 1 foot=1 English foot.
- $1 \operatorname{sashehn} = 7 \operatorname{feet} = 3 \operatorname{arshin} = 12 \operatorname{tchetvert} = 48 \operatorname{vershok} = 2 \cdot 13357 \text{ m}.$
- 1 verst=500 sashehn=1066.78 m.
- 1 dessatine = 2400 square sashehns = 10925 m.
- 1 vedro=10 krushky (stoof)=12.299 l.
- 1 tchetvert=1 osmini=4 payok=8 tchetverik=209.9 l.
- 1 pound=32 loth=96 solotnik=9216 doli=0.9028 Eng. lb. =409.531 g.
- 1 berkovets = 10 pud = 400 pounds = 163.81 kg.
- 1 pud = 40 pounds = 36.112 Eng. lb. = 16.3805 kg.

7. Sweden.

- 1 foot=10 zoll (inches)=100 lines = 0.97408 Eng. foot=0.296901 m.
- 1 famn (fathom)=3 alnar (ells)=6 feet=5.58445 Eng. feet =1.7814 m.
- 1 mile = 6000 fathoms = 6.6417 Eng. statute miles = 10.6884 km.
- 1 kanne = 100 cubic inches = 6.57694 Eng. gallon = 2.617 l.
- 1 skålpund = 100 korn (at 100 art) = 0.9378 Eng. lb. = 425.3395 g.
- 1 centner = 100 skalpund.
- 1 skipspund = 20 liespund = 400 skålpund.
- 8. Switzerland. Metrical measure and weight. The following are sometimes still employed:—
 - 1 fuss = 0.3000 m. = 0.9843 Eng. foot.
 - 1 juchart = 36 are = 0.88956 Eng. acre.
 - 1 maass = 1.51 l.
 - 1 sanm = 100 maass = 151 L
- 9. United States. Weights and measures as in Great Britain, but instead of the "long ton" (gross ton) of 2240 lbs., more frequently the "short ton" (net ton) of 2000 lbs. = 907 1852 kg. = 0.89285 long ton, is employed.
 - The U.S. gallon differs from the British gallon; it is=3.7854 litres. For timber, the measure is the "cord"=4×4×8 feet =128 cubic feet=about 2½ cubic metres.

TABLE 36—Continued.

10. South America (Bolivia, Chile, Colombia, Ecuador, Guatemala, Honduras, Nicaragua, Peru, San Salvador, Venezuela)-1 quintal = 46.0093 kg.

Argentina				1	quintal	l = 45.9367	kg.
Brazil				1	٠,,	=58.752	,,
Paraguay				1	31	=46.008	,,
Urnguay	_	_	_	1		=45.94	

Square Feet, Square Metre.

1 square metre (sq.m.)=10.764 square feet (English and Russian) =10.008 square feet (Austrian)=10.152 square feet (Prussian and Danish)=11.344 square feet (Swedish).

1 square foot (English and Russian) = 0.09290 square metre.

Cubic Feet, Cubic Metre.

1 cubic	metre (c	b.m.])=35·316 c	ubic feet	(English and Russian).
1	,,	,,	=31.66		(Austrian).
1	,,	,,	=32.346	,,	(Prussian and Danish).
1			=38.209		(Swedish).

1 cubic foot (English and Russian) = 0.028315 cubic metre.

1 Kilogram per Running Metre

- =0.6719 English pound per running foot.
- =0.6277 zollpfund per Prussian foot.

1 English pound per 1 English foot = 1.4882 kg. per running metre.

1 Kilogram per Square Centimetre (for steam pressure)

- =14.223 English pounds per square inch.
- =13.681 zollpfund per Prussian square inch.
- = 13.878 zollpfund per Austrian square inch.

HORSE-POWER (per second).

Kgm.	Austria.	Prussia.	England.	Sweden.	Russia.
	Foot-pounds.	Foot-pounds.	Foot-pounds.	Foot-pounds.	Foot-pounds.
75	474·53	477·93	542·47	593·90	600·85
76:041	481·11	484·56	550	602·14	609·19

75 kilogram-metres taken as unit.

550 English foot-pounds taken as unit.

= 1 Admiralty horse-power per second; or, 33,000 foot-pounds per minute.

TABLE 37.—TABLES FOR REDUCING ENGLISH TO METRICAL WEIGHTS AND MEASURES, AND VICE VERSA.

Reduction of Metrical Measure to English Measure.

Metre. Sq.m. Cub.m.	Feet.	Inches.	Square feet.	Square inches.	Cubic feet.	Cubic inches.
1	3·2809	39·3706	10.7642	1550.05	35·3161	61026·2
2	6·5618	78·7412	21.5284	3100.09	70·6322	122052·4
3	9·8427	118·1118	32.2926	4650.13	105·9483	183078·6
4	13·1235	157·4824	43.0568	6200.18	141·2644	244104·9
5	16·4044	196·8530	53.8210	7750.23	176·5805	305131·1
6	19.6853	236·2237	64.5852	9300:27	211.8966	366157·3
7	22.9662	275·5943	75.3494	10850:31	247.2126	427183·5
8	26.2471	314·9649	86.1136	12400:36	282.5287	488209·7
9	29.5280	354·3355	96.8778	13950:40	317.8448	549235·9

English Feet = Metres.

Ft.	0.	1.	2.	8.	4.	6.	6.	7.	8.	9.
0	0.0000	0 3048	0.6096	0.9144	1·2192	1.5240	1.8233	2·1336	2:4384	2·7482
10	3.0479	3.3527	3.6575	8.9623	4·2671	4.5719	4.8767	5·1815	5:4863	5·7911
20	6.0959	6.4007	6.7055	7.0103	7·3151	7.6199	7.9247	8·2295	8:5342	8·8390
30	9.1438	9.4486	0.7584	10.058	10·363	10.663	10.978	11·277	11:582	11·887
50 60 70	12·192 15·240 18·288 21·386	12·497 15·645 18·592 21·640	15.849 18.897 21.945	13·106 16·154 19·202 22·250	13·411 16·459 19·507 22·555	16.764 19.812 22.860	14.021 17.068 20.116 28.164	14·325 17·373 20·421 23·469	17.678 20.726 23.774	14.935 17.983 21.031 24.079
80	24·384	24.688	24.993	25·298	25.603	26.908	26·211	26.517	26.882	27·127
90	27·432	27.786	28.041	28·346	28.651	28.955	29·260	29.565	29.870	30·175
100	30·479	30.784	31.089	81·394	31.699	32.003	32·308	32.618	32.918	83·223
110	33·527	33.832	34.137	34·442	84.747	35.051	35·356	35.661	35.966	36·271
120	36·575	36.880	87·185	37·490	37·795	88·099	38·404	38·709	39·014	39 318
130	89·623	39.928	40·233	40·538	40·842	41·147	41·452	41·757	42·062	42 366
140	42·671	42.976	43·281	43·586	43·800	44·195	44·500	44·805	45·110	45 414
150	45.719	46.024	46.329	46.634	46.988	47.243	47.548	47.853	48·158	48.462
160	48.767	49.072	49.377	49.642	49.986	50.291	50.596	50.901	61·205	61.610
170	51.815	52.120	52.425	52.729	53.084	63.339	63.664	63.943	54·268	54.668
180	54.863	55.168	65.473	65.777	56.082	66.367	56.692	66.907	57·801	57.606
190	57.911	58.216	58.521	68.826	69.130	69.435	69.740	60.045	60·349	60.654

English Inches = Millimetres.

Inch.	Millimetres.	Inches.	Millimetres.	Inches.	Millimetres.
54 152 16 16 18 14 12	0·39 0·79 1·59 3·17 6·35 12·70	1 2 3 4 5 6	25·4 50·8 76·2 101·6 127·0 152·4	7 8 9 10 11 12	177·8 203·2 228·6 254·0 279·4 304·8

English Square Feet = Square Metres.

Sq. ft.	0.	1.	2.	3.	4.	5.	6.	7.	8.	9.
0	0.0000	0.0929	0 1858	0-2787	0.3716	0.4645	0.5574	0.6503	0.7432	0-836
10	0.9290	1.0219	1.1148	1.2077	1.3006	1.3935	1.4864	1.5793	1.6722	1.765
20	1.8580	1.9509	2.0438	2.1367	2.2296	2.3225	2.4154	2.5083	2.6012	2.694
80	2.7870	2.8799	2.9728	3.0657	3.1586	3-2515	3.3444	3.4373	3.5302	3.623
40	3.7160	3.8089	3.9018	3.9947	4.0876	4.1805	4.2734	4.3663	4.4592	4.552
60	4.6450	4.7379	4.8308	4.9237	5.0166	5.1095	5-2024	5.2953	5.3882	5.481
60	5.5740	5.6669	5.7598	5.8527	5.9456	6.0386	6.1314	6.2243	6.3172	6.410
70	6.5030	6.5959	6 6888	6.7817	6 8746	6.9675	7.0604	7.1533	7.2462	7.339
80	7-4320	7.5249	7.6178	7.7107	7.8036	7.8965	7.9894	8.0823	8.1752	8.268
90	8.3610	8.4539	8.5468	8.6397	8.7326	8.8255	8.9184	9.0113	9.1042	9-197

English Square Inches = Square Centimetres.

Sq. ins.	0.	1.	2.	3.	4.	5.	6.	7.	8.	9.
0	0.0000	6.4514	12.903	19:354	25.805	32-257	38.708	45:160	51.611	58-069
10	64.514	70.965	77.416	83-868	90.319	96.771	103.22	109 67	116.12	122.5
20	129.03	135.48	141.93	148.38	164.83	161.28	167.74	174 19	180.64	187.0
30	193.54	199-99	206-44	212.90	219.85	225.80	232-25	238.70	245.15	251 6
40	258-05	264-61	270-96	277.41	283-86	290.31	296.76	303.21	309.67	318.1
50	322-57	329-02	335-47	341.92	348.37	354-83	361-28	367.78	374.18	380-6
80	337 08	393-58	399.98	406.44	412.89	419.34	425.79	432.24	438.69	445 1
70	451.60	458.06	464.50	470.95	477.40	483-85	490.30	496-76	503.21	509.6
80	516-11	522.56	625.01	535.46	541.91	543.37	554.82	561.27	667.72	574.1
90	580.62	587.07	693.53	699.98	808-48	812.88	619.33	625.78	632-23	638-6

English Cubic Feet = Cubic Metres.

Cub. ft.	0.	1.	2.	3.	4.	6.	6.	7.	8.	9.
0	0.0000	0.0283	0.0566	0.0849	0·1183	0·1416	0·1699	0·1982	0·2265	0-2548
10	0.2832	0.3115	0.3398	0.8681	0·8964	0·4247	0·4580	0·4814	0·5097	0-5880
20	0.5663	6.5946	0.6229	0.6513	0·6796	0·7079	0·7362	0·7645	0·7928	0-8211
3 0	0.8494	0.8778	0.9061	0.9344	0·9627	0·9910	1·0194	1·0477	1·0750	1-1048
40	1.1326	1.1609	1.1892	1.2176	1·2459	1·2742	1·3025	1·3308	1·3591	1-8875
50	1:4158	1:4441	1.4724	1.5007	1.5290	1.5573	1.6857	1.6140	1.6423	1.6706
60	1:6989	1:7272	1.7655	1.7889	1.8122	1.8405	1.8688	1.8971	1.9254	1.9588
70	1:9621	2:0104	2.0387	2.0670	2.0953	2.1236	2.1520	2.1803	2.2086	2.2369
80	2:2652	2:2935	2.8219	2.3502	2.3785	2.4068	2.4351	2.4684	2.4917	2.5201
90	2:5484	2:5767	2.6050	2.6383	2.6616	2.6900	2.7183	2.7466	2.7749	2.6032

English Cubic Inches = Cubic Centimetres.

Cub. in.	0.	1.	2.	3.	4.	5.	б.	7.	6.	9.
							i		i -	
. 0	0.0000	16.386	32.772	49-159	65.545	81.931	98-317	114.70	131.09	147.48
10	163.86	180.25	196.63	213.02	229.41	245.79	262.18	278.56	294.95	311.34
20	327.72	344.11	360-60	376 88	393.27	409-65	426.04	442.43	458.81	475.20
80	491.59	507.97	524.86	540.74	557:18	573.52	589.90	606-29	522.67	639.06
40	655*45	671.83	688-22	704.61	720-99	787-38	758.76	770-15	786.54	802.92
50	819-31	835-69	852-08	868-47	884.85	901-24	917-63	934.01	950-40	966.78
60	983.17	999.56	1015.9	1032-3	1048.7	1065-1	1081.5	1097.9	1114.3	1180.6
70	1147-0	1163.4	1179 8	1196.2	1212.6	1229.0	1245.3	1261.7	1278-1	1294.5
80	1310.9	1327-3	1343.7	1360-1	1376.4	1392.8	1409-2	1452.6	1440.9	1458-4
90	1474.8	1491-1	1507.5	1523.9	1540-3	1556-7	1573-1	1589.5	1605.8	1622-2
	l									

English Pounds = Kilograms.

Lbs.	0.	1.	2.	3.	4.	ő.	6.	7.	8.	9.
0	0.0000	0·4536	0·9072	1·3506	1.8144	2·2680	2.7216	8·1751	3.6287	4.0623
10	4.5359	4·9895	5·4431	5·8967	6.3503	6·8039	7.2675	7·7111	8.1647	6.6183
20	9.0719	9·5264	9·9790	10·433	10.866	11·340	11.798	12·247	12.701	-18.154
80	13.608	14·061	14·515	14·969	16.422	15·876	16.329	16·788	17.237	17.690
40	18.144	18·597	19·051	19·504	19.958	20·412	29.865	21·319	21.772	22.226
50	22.660	23·138	23·587	24·040	24.494	24·948	25.401	25·855	26.308	25.762
60	27.216	27·669	28·128	28·576	29.030	29·464	29.937	30·391	30.844	31.296
70	31.751	32·205	32·659	83·112	88.566	34·019	34.473	34·927	35.350	35.884
80	36.287	36·741	37·195	37·648	88.102	38·555	39.009	39·468	39.916	40.370
99	40.823	41·277	41·781	42·184	42.638	43·091	43.545	43·996	44.452	44.906

English Tons = Kilograms.

Tons.	0.	1.	2.	3.	4.	5.	6.	7.	8.	9.
0	0-0000	1016	2032	3048	4064	5080	6096	7112	\$129	9145
10	10161	11177	12193	13209	14225	15241	16257	17273	18289	19305
20	20321	21337	22353	23369	24386	25402	26418	27434	28450	29466
30	30482	31498	32514	33530	34546	35562	36578	37594	38610	39627
40	40643	41659	42675	43691	44707	45723	46739	47755	48771	49787
50	50803	51819	52835	53851	54868	55884	56900	57916	58932	69948
60	60964	61980	62996	64012	65028	66044	67060	68076	69092	70108
70	71125	72141	73157	74173	75189	76205	77221	78237	79253	80269
80	81285	82302	83317	84333	85346	86366	87382	88398	89414	90430
90	91446	92246	93478	94494	95510	96526	97642	98558	99574	100590

English Grains = Grams.

Grains.	0.	1.	2.	3.	4.	5.	6.	7.	8.	9.
10 20 30 40 50 60 70 80 90	0 •648 1•296 1•944 2•692 3•240 3•888 4•536 6•184 5•832	*065 *713 1.361 2.009 2.657 3.305 3.953 4.601 5.249 6.897	1296 1428 2.074 2.721 3.369 4.018 4.666 6.314 5.962	194 1842 1.490 2.138 2.786 3.434 4.082 4.730 5.378 6.026	259 907 1.555 2.203 2.851 3.499 4.147 4.795 6.443 6.091	324 -972 1·620 2·268 2·916 3·564 4·212 4·860 6·508 6·156	389 1.037 1.685 2.333 2.981 3.629 4.277 4.925 5.573 6.221	·454 1·102 1·749 2·397 3·045 3·693 4·341 4·989 5·637 6·286	518 1·166 1·814 2·462 3·110 8·758 4·406 5·054 5·702 6·350	-583 1·231 1·879 2·527 3·175 3·823 4·471 5·119 5·767 6·415

Grams = English Grains.

Grams.	0.	1.	·2.	·3.	-4.	-5.	·6.	·7.	*8.	.9.
0	0	1·543	2.086	4·629	6·172	7:716	9·259	10·802	12:345	13·803
1	15:432	16·975	13.518	20·061	21·604	29:148	24·691	26·234	27:777	29·320
2	30:864	32·407	33.950	35·493	87·036	38:580	40·123	41·666	43:209	44·752
3	46:296	47·839	49.382	50·925	52·468	54:012	55·555	57·098	58:641	60·184
4	61:728	63·271	64.814	66·375	67·900	69:444	70·987	72·530	74:073	75·616
5	77:160	78·703	80.248	81·789	83·332	84:876	86·419	87·962	89:505	91·048

```
1 English pound (lb.) per sq. foot = 4.883 kg. per sq. metre (sq.m.).

1 ,, ,, sq. inch = 0.07031 kg. per sq.m.

1 ,, ton per sq. inch = 158 kg. per sq.cm.

1 ,, pound per cub. foot = 16.02 gm. per litre.

1 kilogram per sq. metre = 0.2048 lb. per sq. foot.

1 English grain per gallon = 0.014286 gm. per litre.

1 ,, ,, English cub. foot = 2.287 gm. per cub. metre.

1 grm. per litre = 70 grains per gallon = 0.06243 lb. per cub. foot.

1 metre-kilogram (mkg.) = 7.235 foot-pounds.

1 foot-pound = 0.1382 mkg.
```

TABLE 38.—WEIGHT OF SHEET METALS.

1 foot-pound per cub. foot = 4.8807 mkg. per cub. met.

Weight of a Superficial Foot.

Tbick- ness.	Wrought Iron.	Cast Iron.	Steel.	Copper.	Brass.	Lead.	Zinc.
Inch.	Lb.						
	2.53	2·34	2·55	2·89	2.73	3.71	2·34
	5.05	4·69	5·10	5·78	5.47	7.42	4·69
	7.58	7·03	7·66	8·67	8 20	11.13	7·03
	10.10	9·38	10·21	11·76	10.94	14.83	9·38
	12.63	11·72	12·76	14·45	13.67	18.54	11·72
327 B 19 9 B 15B	15·16 17·68 20·21 22·73 25·27	14.06 16.41 18.75 21.09 23.44	15:31 17:87 20:42 22:97 25:52	17:34 20:23 23:13 26:02 28:91	16:41 19:14 21:88 24:61 27:34	22·25 25·96 29·67 33·38 37·08	14.06 16.41 18.75 21.09 23.44
16343678567	27·79	25·78	28·07	31·80	30.08	40.79	25.78
	30·31	28·13	30·63	34·69	32.81	44.50	28.13
	32·84	30·47	33·18	37·58	35.55	48.21	30.47
	35·87	32·81	35·73	40·47	38.28	51.92	32.81
	37·90	35·16	38·28	43·36	41.02	55.63	35.16
	40·42	37·50	40·83	46·25	43.75	59.33	37.50

TABLE 89. COINAGE OF DIFFERENT COUNTRIES.


							Exact Value in		
Austria						£	8.	d.	
1 Vereins Thaler (=1 form	ıer Pr	ussia	n Tha	ler)		0	2	11.24	
1 Gulden = 100 Neukreuze	r .			• '	•	0	1	11.49	
1 Maria Theresia Thaler					•	0	4	1 46	
1 Dukaten	••	.:	٠,,	•		0	9	4.78	
4 Gulden Gold=10 Francs	; 8 G	ılden	Gold	= 20	Frai	ıcs			
Belgium = France.									
Brazil									
1 Milreis=1000 Reales .						0	2	3.48	
1 Milicis - 1000 Reales .	•	•	•	•	•	v	•	9 40	
Chili—									
1 Peso=100 Centavos						0	3	11:58	
11 cso=100 Ochidavos ,	•	•	•	•	•	U	J	11 00	
Denmark-									
1 Rigsbankdaler=6 Marks	s — 90 S	Skilli	nos			0	2	2.67	
1 Krone=100 Oere	, — 50 1	-	ugs	:	•	ŏ	í	0.83	
11110110 1101 0010	•	•	•	•	•	•	-	0 00	
East India—									
1 Rupee=16 Annas .						0	1	4	
•									
Egypt-									
1 Bag of Gold = 30,000 Pia	stres					273	2	10	
1 Piastre=40 Para		•				0	0	2.5	
France									
1 Franc=100 Centimes						0	0	9.516	
The 20-Franc piece contai	ns 5·8	065 g	. fine	gold		0	15	10.31	
The 5-Franc piece contains	s 22 · 5	g. fir	ie silv	ver	•	0	3	11 58	
German Empire—									
1 Mark = 100 Pfennig			٠.	٠.		0	-	11.748	
The 20 Mark piece contain					•	0	19	6.96	
The 5-Mark piece contains	i 20 g.	nne	suver	•	•		•	•••	
Great Britain—									
	7,200		na c	Ja		1		^	
1 Pound Sterling contains 1 Shilling contains 5.231 g	1 0229 fine	silver	ue go	лu	•	1 0	0 1	0	
			•	•	•	J	•	U	

TABLE 39-Continued.

Trachma								Ex	act V	alue in
Italy— 1 Lira=1 Franc (=France) 0 0 9·516 Japan— 1 Gold Yen 0 4 1 Mexico— 1 Piastre (Peso, Mexican Dollar)=8 Reales=100	Greece—							£	8.	d.
1 Lira=1 Franc (=France)	1 Drachma=100 Lepta	=1 l	Franc	c (= I	ranc	:e).	•	0	0	9.516
Japan— 1 Gold Yen	Italy—									
Mexico	1 Lira=1 Franc (=Fran	ace)						0	0	9.516
Mexico— 1 Piastre (Peso, Mexican Dollar)=8 Reales=100 Cents	Japan-									
1 Piastre (Peso, Mexican Dollar)=8 Reales=100	1 Gold Yen	•						0	4	1
Cents	Mexico-									
Cents	1 Piastre (Peso, Mexic	an I	Dolla	r)=8	Rea	les=	100			
Netherlands— 1 Guilder=100 Cents	Cents		•	., .			•	0	4	3.5
1 Guilder=100 Cents	1 Doblon=16 Piastres	•	•	•	•	•	•	3	8	8
1 Willems d'Or	Netherlands									
Norway— 1 Krone=100 Oere							•	0		
Norway— 1 Krone=100 Oere		•	•	•			•			
1 Krone=100 Oere	1 Ducat	•	•	•	•	•	•	0	9	4.2
1 Species Daler=120 Skillings 0 4 5 43 Persia— 1 Toman=10 Keran 0 9 0 31 1 Rupee Silver 0 1 6 2 Peru— 1 Sol (Peso)=10 Dineros=100 Centavos 0 3 11 58 Portugal— 1 Milreis (in accounts)	Norway									
Persia— 1 Toman = 10 Keran		•					•			
1 Toman=10 Keran	1 Species Daler=120 Sk	cillin	ıgs	٠	•	•	•	0	4	5.43
1 Rupee Silver	Persia—									
Peru— 1 Sol (Peso)=10 Dineros=100 Centavos										
1 Sol (Peso)=10 Dineros=100 Centavos	1 Rupee Silver .	•	٠	•	•	•	•	0	1	6.2
Portugal— 1 Milreis (in accounts)										
1 Milreis (in accounts)	1 Sol (Peso)=10 Dinero	s=1	00 C	entav	os	•	•	0	3	11.28
1 Milreis (silver)	Portugal—									
1 Milreis (silver)	1 Milreis (in accounts)							0	4	6.75
Roumania-	1 Milreis (silver) .							_	_	
	1 Tostao=100 Reis	•	•	•	•	•	٠	0	0	4.8
1 Piastre=1 Franc (France) 0 0 9.516	Roumania-									
	1 Piastre=1 Franc (Fra	nce)		•	•			0	0	9.516

TABLE 39—Continued.

	E	xact v	alue in
Russia	£	8.	d.
1 Silver Rouble = 100 Kopeks	0	3	2.06
1 Half-Imperial = 5 Rouble Gold = 5.9987 g. fine gold 1 Paper Rouble	0	$\frac{16}{2}$	4·61 7·7
i raper mouble	U	4	1-1
Servia—			
1 Dinar=1 Franc (=France)	0	0	9:516
	•	٠	0 010
Spain			
1 Peseta=1 Franc (=France)	0	0	9.516
1 Duro (Spanish Dollar)=2 Escudos=5 Pesetas		_	
=20 Reales	0	3	11.58
Sweden—			
1 Kronor = 100 Oere	0	ì	0.83
I Intoloi = 100 Ocic , , , , , ,	v	1	0.00
Switzerland = France.			
Turkey			
1 Piastre=40 Para=120 Asper ,	0	0	2.1
1 Turkish Pound (Yuslik) ,	0	18	1
United States—			
1 Dollar=10 Dimes=100 Cents	0	4	1.15
1 Eagle=10 Dollars=15.0463 g. fine gold , .	2	1	1.16



I. FUEL AND FURNACES.

A.—Fuel.

Should be tested in the case of lignite, peat, coal, coke. Refer

to the Appendix as to sampling.

1. Moisture.—Heat 100 to 200 g. of coal to 110° (not above), for two hours, preventing access of air as much as possible. At a higher temperature the result might be too high, owing to escape of volatile matters, or too low, owing to a partial oxidation. The sample should be broken up quickly into pieces not smaller than a bean, otherwise too much water would evaporate during the process. Lignite and peat are heated to 100° for five or six hours, and repeatedly weighed, till no further diminution of weight takes place. Coke is heated to 110° for two hours.

All other tests are made with air-dried material. The average sample is weighed before taking the samples for the tests; it is then spread out in a thin layer and allowed to lie in ordinary dry air for forty-eight hours. It is then weighed again, and the results obtained with such air-dried fuel are calculated on the

original (undried) material.

2. Residual Coke (Fixed Carbon).—One g. of finely powdered coal is placed in a platinum crucible at least 11 in. deep, weighing from 20 to 30 g., provided with a tightly fitting cover. The crucible should then be heated by means of an ordinary Bunsen burner, the flame of which should not be less than 7 in, high. should be supported on a triangle of thin platinum wire, and it should be so placed that the space between the bottom of the crucible and the top of the burner is 25 to 3 in. The heating ought not to last longer than a few minutes, but must be continued as long as any appreciable quantity of inflammable matter The surface of the crucible cover should then be clean, but its lower side should be covered with carbon. If the flame be smaller, or the crucible be supported by a stout wire triangle, the yield of coke will be too high. The results should always be calculated upon coal or coke free from ash, in order to render them comparative. Good coal for reverberatory furnaces should yield from 60 to 70 per cent. of coke.

3. Ash.—This estimation is very simple for lignite or peat; coke requires a very high temperature; coal which cakes presents most difficulties. The latter must be powdered very finely, and heated up gradually, so that the volatile matters may escape before the powder can form a cake. If an analysis is only occasionally required, 2 to 5 g. of finely ground coal is heated in a platinum crucible, which is fitted in a hole into a stoneware

slab, or, better, in asbestos board (Fig. 1). This is placed in a slanting position on a tripod stand. The slab serves to separate the air required for oxidation from the gases of the burner, and greatly hastens the combustion, which is thus completed in two hours, whereas without the slab it frequently remains incomplete even after eight or ten hours' heating. It is not advisable to use a blowpipe, because the chance of mechanical loss is thereby greatly increased. If determinations have to be made frequently, it is preferable to effect the combustion in a muffle furnace, or still more quickly in a platinum boat placed in a heated porcelain tube, through which a current of oxygen is passed. When using the latter, the coal or coke should be broken into small pieces, and not ground fine, or else the oxygen does not come sufficiently into contact with the lower strata.

Where frequent tests have to be made, several platinum dishes can be placed in a muffle at the same time. It is best to cover the dishes

or boats at first by a mica plate and to remove this only when the gases have been driven off, after which the ignition is continued, until no more black spots are visible and the weight

remains constant.



4. Sulphur (Eschka's method).—
Mix 0.5 to 1 g. of the finely ground coal
with 1½ times its weight of an intimate mixture of 2 parts of well-burnt
magnesia and 1 part of anyidnes
ture is made in a platinum arrivals by

sodium carbonate. The mixture is made in a platinum crucible by means of a glass rod, and the crucible, without putting on the cover, is heated in an inclined position, in such manner that only its lower portion attains a red heat. This is most conveniently done by placing it in an asbestos board, provided with a hole, as shown in Fig. 1. The combustion of the sulphides to sulphates should be promoted by frequent stirring with a thick platinum wire; it will be finished in about an hour, during which time the grey colour of the mixture mostly passes into yellow, red, or The calcined mass is covered with hot water, and bromine water is added until the liquid shows a slight yellow colour. heat the whole to boiling, decant the liquid through a filter, and wash the residue with hot water. Add hydrochloric acid to the aqueous solution, boil till all the bromine has been removed and the liquid has been decolorised, and add a solution of barium chloride, drop by drop, always at a boiling heat, until the precipitation is complete. If the magnesia or the sodium carbonate employed are not quite free from sulphates, these must be separately estimated and the amount deducted from the total sulphur found. Even if the gas employed for heating the crucible should contain a notable quantity of sulphur, there is no error caused by this, if the products of combustion are kept away from the contents of the crucible by the asbestos shield as shown in

the figure. One part BaSO₄ indicates 0.1374 part S.

5. The calorific power of fuel can be estimated by ascertaining the percentage of carbon and hydrogen, according to the ordinary methods of elementary analysis, and calculating the results according to Dulong's formula. In the case of coal it is necessary to take account of the volatile sulphur—that is, that which is determined by heating in a current of oxygen, passing the gases through neutralised hydrogen peroxide, and titrating the sulphuric acid formed. If the percentage of C, H, and (volatile) S, and that of the moisture (W), is known, the percentage of the oxygen is expressed by the equation:—

$$O = 100 - (C + H + S + W + ash)$$
.

The nitrogen contained in the coal may be neglected. The calorific power of the coal, expressed in gram-calories, is then

$$=81 \text{ C} + 290 \left(\text{H} - \frac{\text{O}}{8} \right) + 25 \text{ S} - 6 \text{ W}.$$

A direct estimation of the heating power of fuel can be made by means of the calorimetric bomb, of which a description is given in *Tech. Meth.*, vol. i., p. 254.

B.—Furnaces.

1. Chimney Gases.—In these, CO₂, O, CO, and N (the latter by difference) are most conveniently estimated by the Orsat apparatus, shown in Fig. 2. This consists of a gas-burette, A, connected with the water-filled level-bottle B by means of a rubber tube. A is filled to the zero point with water, and by lowering B gas is aspirated, either from the supply tube C or from the absorption pipettes, D, E, F. The gas is forced into each of these pipettes by opening its special tap and raising B. For reading the volume of gas in A, the bottle B must be held in such a position that the level of water is the same in A and B.

The absorption pipettes are charged as follows:—Tube D receives 110 c.c. of caustic potash solution of specific gravity 1'20 to 1'28. This absorbs CO₂, and can serve for a long time. Tube E serves for absorbing the oxygen by means of very thin sticks of phosphorus, kept under water. This tube, when not in use, should be protected from the light by a covering of black paper. Any tarry matters getting into this tube render the phosphorus inactive, and must therefore be kept out by filtering the gas before entering into C, through asbestos, cotton-wool, or other suitable material. The absorption of the oxygen by the phosphorus only

sets in at 16° C., better at 18° C. In case the room is at a lower temperature, the vessel E must be cautiously warmed up by a spirit-lamp. In tube F the carbon monoxide is absorbed. For this purpose a solution is prepared by shaking up in a closed bottle 250 g. cuprous chloride with a solution of 250 g. ammonium chloride in 750 c.c. water. When completed, a spiral of copper wire, reaching from top to bottom, is introduced into the stock bottle. This bottle is always kept well closed when

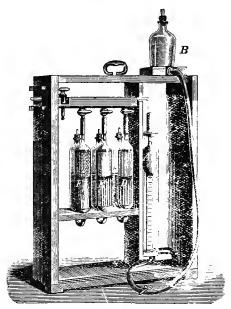


Fig. 2.

not in use. Before charging tube F, 3 vols. of the solution from the stock bottle are mixed with 1 vol. liquor ammoniæ, specific gravity 0.905. One c.c. of this mixture ought to absorb 16 c.cm. CO, but this requires prolonged shaking. The reagent in F must be frequently renewed; if this is neglected, it may even yield up some CO to gases containing too little of it. The reagent in F also absorbs ethylene, but this gas does not occur in chimney gases. Since the solution in F also absorbs oxygen, the latter must always be removed before employing pipette F.

For daily use it is mostly sufficient to test merely for CO₂, by

means of the caustic potash solution in pipette D.

Checking the working of Furnaces.—The estimation of CO_2 in the chimney gases, if combined with an observation of temperature, admits of checking both the efficiency of a furnace or boiler and the daily work of the firemen, according to a formula worked out by Lunge (Zsch. f. angew. Chem., 1889, p. 240). A consecutive number, say from 10 to 15 tests for CO_2 , are made by an Orsat apparatus in the flue leading from the furnace to the chimney, and the mean volume percentage of CO_2 found is called n. At the same time, a thermometer with very long stem, tightly inserted in the testing hole in such manner that its bulb is well within the flue, but that the scale can be read off outside, is observed at frequent intervals, and the mean temperature of the gases is called t', that of the air outside t. c is the specific heat of a cubic metre of CO_2 , expressed in gram-calories; c' that of N or O (see below). The total volume of exit gases produced by the combustion of 1 kg. of carbon burnt on the grate is

=1.854+1.854 $\left(\frac{100-n}{n}\right)$ cubic metres, and the loss of heat in the

exit gases, expressed in gram-calories :-

L=1.854
$$(t'-t)$$
 $c+1.854$ $(t'-t)$ $\left(\frac{100-n}{n}\right)$ c' .

The loss, expressed in per cent. of the heat theoretically given out by the carbon, is:—

100 L 8080

The value of c' may be assumed for all temperatures=0.31; that of c varies with the temperature, and must be taken as follows:—

If t' is b	elow	150° C.,	c = 0.41.
,, b	etween	150-200°	= 0.43.
,,	,,	200-250°	=0.44.
••	99	250-300°	=0.45.
••	•••	300-350°	= 0.46.


Note.—The observations of n and t' must be made several times in succession, and the average value taken as final. For accurate investigations several series of tests must be made at different times of the day.

Instruments have been devised for a continuous approximate check of the percentage of CO₂ in chimney gases, such as Arndt's

Œconometer.

2. Gas from Producers (Generators).—In producer gas usually only CO₂ and CO are estimated by means of Orsat's apparatus, as described, p. 95. Any ethylene present in the producer gas would

be absorbed and estimated together with the CO. Hydrogen can be estimated in the residue from absorbing CO₂, CO, C₂H₄, and O, by mixing it with a measured volume of air, and passing the mixture over gently heated platinum or palladium asbestos.* The estimation is most conveniently done in Lunge's modification of Orsat's apparatus, Fig. 3. The indicating letters correspond to those in Fig. 2, but there is an additional U-tube, G, connected with a capillary, H, of refractory glass. H contains platinum or

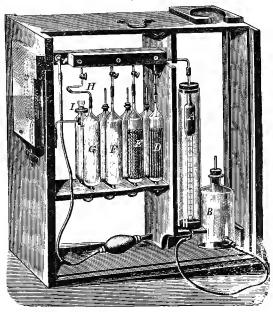


F10. 3.

palladium asbestos and can be heated by the small spirit lamp I, turning on a pivot. The U-tube G is filled with water. The gas freed from $\mathrm{CO}_2, \mathrm{CO}, \mathrm{C}_2\mathrm{H}_4$, and O (if this be present) is mixed in the gas-burette A with as much air as the space will allow, and

^{*} This can be obtained ready-made or is prepared by soaking a few threads of long soft asbestos in a strong solution of platinum or palladium chloride, mixed with a saturated solution of sodium formate and enough sodium carbonate to produce an alkaline reaction. After one hour's soaking the sabestos is dried completely in a water-bath, whereby the metal is precipitated in a very minute state of division. The soluble salts are then washed out by hot water and the asbestos is again dried.

a reading is taken. This air will suffice for a quantity of hydrogen corresponding to $\frac{4}{10}$ of the employed volume of air (i.e. twice the volume of oxygen contained in that air). If more H be present, which will only occur in the case of "water gas," either less than 100 c.c. of gas must be employed at the commencement for the analysis, or the residual gas is mixed with oxygen instead of with air. The capillary tube H is heated very gently by means of the lamp I, and the gaseous mixture is quickly passed once through it into G and back again, when one end of the platinum asbestos should become red hot. The residual gas is again measured and $\frac{2}{3}$ of the diminution in volume calculated as hydrogen. If methane (marsh gas, CH₄) is to be estimated, the residue from the last operation is mixed with more air and burnt by means of an electrically heated palladium or platinum wire, enclosed in a capillary tube. If a capillary platinum tube is employed, filled

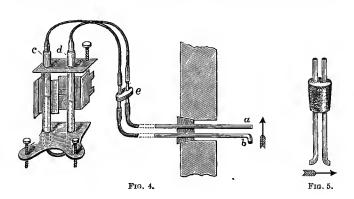

with a few platinum wires, so as to leave a very small space for the gases to pass through, the electric heating may be replaced by that of a broad gas flame, producing a strong red heat.

3. Speed of Draught.—A convenient apparatus for measuring this in chemical works, where any fine mechanism would soon be ruined, is Fletcher's anemometer, based upon the movement of a column of ether in a U-tube (described in Lunge's Sulphuric Acid and Alkali, 4th edition, vol. i., p. 768). Fig. 4 shows this in the simpler form, leaving out the microscopes, which are quite unnecessary for reading the divisions of the scale or the vernier. The ends of the glass tubes a b should be placed rather less than one-sixth of the diameter of the flue from its inner wall. The straight end of a ought to be as exactly parallel as possible to the

direction of the draughts; the end of b ought to be exactly at a right angle to this, and so that the current blows straight into it. Without this precaution a mistake is made, which is avoided by the arrangement shown in Fig. 5, and proposed by Hurter, viz., employing tubes with ends bent in opposite directions. The tubes a b communicate with the ether tube c d; the draught causes the ether to rise in a by aspiration and to fall in b by the pressure of the air blowing into the tube. The difference of level between c and d is read off by means of the scale and vernier. The sliding disc e is then turned through 180°, whereby the currents are reversed. There will now be a difference of levels in the opposite direction, but equal in amount to the first, if the observation is correct. The sum of these two differences is the "anemometer reading" given in the tables.

The following tables show the application of the readings of the Anemometer for calculating the speed of draughts, both for instruments graduated on the inch scale and for those on the metrical scale.

a.-TABLE TO SHOW THE SPEED OF CURRENTS OF AIR.

At a temperature of 15° C. = 60° F.; Barometer, 760 mm. = 29.92 inches.

A .- Readings in Inches.

Anemometer Reading. Inches.	Speed. Feet per Second.	Anemometer Resding. Inches.	Speed. Feet per Second.	Anemom- eter Reading Inches.	Speed. Feet per Second.	Anemom- eter Reading. Inches.	Speed. Feet per Second.
•01 •02 •03 •04 •05	2·855 4·038 4·945 5·710 6·384	·16 ·17 ·18 ·19 ·20	11:42 11:77 12:11 12:45 12:77	·32 ·34 ·36 ·38 ·40	16.15 16.65 17.13 17.60 18.06	.95 1.00 1.25 1.50 1.75	27·83 28·55 31·93 34·97 37·77
.06 .07 .08 .09	6:993 7:554 8:075 8:565 9:028	*21 *22 *23 *24 *25	13.08 13.39 13.70 13.99 14.28	*45 *50 *55 *60	19·15 20·18 21·17 22·12 23·02	2·00 	40·37
11 12 13 14 15	0.469 9.891 10.29 10.68 11.06	•26 •27 •28 •29	14 '56 14 '84 15 '11 15 '38 15 '64	•70 •75 •80 •85	23.89 24.73 25.54 26.32 27.08		

B .- Readings in Millimetres.

Read- ing.	Speed.	Read- ing.	Speed.	Read- ing.	Speed.	Read- ing.	Speed.	Read- ing.	Speed.	Read- ing.	Speed.
mm. 0·1 0·2 0·8 0·4 0·5 0·6 0·7 0·8 0·9 1·0 1·1 1·2 1·8	m. 0·575 6·771 0·944 1·090 1·205 1·341 1·442 1·560 1·636 1·724 1·808 1·889 1·966	mm. 1:4 1:5 1:6 1:7 1:8 1:9 2:0 2:1 2:2 2:3 2:4 2:6 2:6	m. 2·040 2·111 2·181 2·248 2·318 2·376 2·438 2·498 2·557 2·615 2·671 2·726 2·779	mm. 2.7 2.8 3.0 3.2 3.4 3.8 4.0 4.2 4.6 4.8	m. 2-833 2-885 2-985 2-985 2-986 8-077 8-179 3-271 8-361 3-448 3-469 3-816 3-698 8-777	mm. 5·0 5·2 5·4 5·6 5·8 6·0 7·5 8·0 8·5 9·0 9·5	m. 3·856 3·931 4·006 4·080 4·152 4·223 4·395 4·561 4·721 4·878 5·026 5·172 6·814	mm. 10·0 10·5 11·0 11·6 12·0 12·5 13·6 14·0 16·0 17·0 18·0	m. 6·452 6·588 6·718 6·846 5·972 6·095 6·218 6·834 6·450 6·667 6·896 7·108	mm. 19·0 20·0 21 22 23 24 25 30 35 40 45 50	m. 7·515 7·710 7·900 8·086 8·268 8·445 8·620 0·443 10·199 10·903

β .—CORRECTIONS FOR TEMPERATURE.

Column a shows the temperature of the chimney or flue, column b the factor for multiplying the figure found in Table a in order to arrive at the real speed of the current of gas.

A.—Readings in Degrees Fahrenheit.

Fahr.	b .	u.	ъ.	u.	ъ.	u.	ъ.
0	1.0634	90	0.9723	180 .	0.9012	380	0.7865
5	1.0577	95	0.9679	185	0.8977	400	0.7763
10	1.0520	100	0.9636	190	0.8943	425	0.7663
15	1.0464	105	0.9593	195	0.8909	450	0.7556
20	1.0409	110	0.9551	200	0.8875	475	0.7454
25	1.0355	115	0.9509	210	0.8808	500	0.7356
30	1.0302	120	0.9468	220	0.8743	525	0.7261
35	1.0250	125	0.9428	230	0.8680	550	0.7171
40	1.0198	130	0.9388	240	0.8614	575	0.7085
45	1.0148	135	0.9348	250	0.8557	600	0.7000
50	1.0098	140	0.9309	260	0.8497	650	0.6841
55	1.0049	145	0.9270	270	0.8438	700	0.6691
60	1.0000	150	0.9232	280	0.8380	750	0.6552
65	0.9952	155	0.9194	290	0.8324	800	0.6420
70	0.9905	160	0.9156	300	0.8269	850	0.6297
75	0.9858	165	0.9119	320	0.8163	900	0.6181
80	0.9812	170	0.9083	340	0.8060	950	0.6070
85	0.9767	175	0.9047	360	0.7960	1000	0.5964
	30.07	1					

a. t° C.	ь.	t° C.	ъ.	a. t° C.	ь.	a. t° C.	ъ.	t° C.	ъ.	a.	b.
-10 5 0 2 4 6 8 10 12 14 15	1.046 1.036 1.027 1.023 1.020 1.016 1.012 1.005 1.005 1.003 1.000 0.998	18 20 22 24 26 28 30 32 34 36 38 40	0·995 0·991 0·988 0·985 0·981 0·978 0·975 0·968 0·968 0·968 0·969	42 44 46 48 50 52 54 56 58 60 62	0-956 0-953 0-950 0-947 0-944 0-941 0-938 0-935 0-933 0-927 0-924	66 68 70 76 80 85 90 95 100 110 120	0-922 0-919 0-918 0-909 0-903 0-897 0-890 0-884 0-867 0-856	140 150 160 170 180 190 200 210 220 230 240 250	0·835 0·825 0·815 0·806 0·797 0·788 0·780 0·772 0·764 0·756 0·749 0·742	260 270 230 290 300 320 840 360 400 450	0.735 0.728 0.721 0.715 0.709 0.697 0.685 0.676 0.654 0.681

B.—Readings in Degrees Centigrade

A very simple and cheaper instrument is Seger's Differential Anemometer, Fig. 6. The U-tube A is surmounted by two



F1G. 6.

enlargements, B and C. D is a sliding scale, adjustable by slits a a and screwpins b b. The tube is filled with two nonmiscible liquids of nearly equal specific gravity; for instance, paraffin oil and dilute spirits of wine (coloured). The line of contact, at X, is the zero point of the scale D. If an aspirating force is acting on the surface of the liquid in C, the level of the liquid will be raised in C, and the point X will be lowered in a multiplied ratio, corresponding to the difference in the sectional areas of the narrow part of A and the enlargements in C, say 1:20.

C.—Temperature.

The measurement of temperatures up to about 300° calls for no special remark, as the ordinary mercurial thermometers are always used. For higher temperatures a large number of pyrometers have been constructed. All of these are unreliable after prolonged use, many of them even from the very beginning, and they require a frequent control of their indications by calorimetric

methods. Among these "empirical" pyrometers those mostly used are: Gauntlett's (up to 900° C. or 1600° F.), Steinle and

Hartung's graphite pyrometer (up to 1200° C.), and Klinghammer's Thalpotasimeter. In many cases Prinsep's metallic alloys, of definite fusing points, and Seger's cones, do good service; the fusing points corresponding to the commercial forms of these have been given on p. 35.

The calorimetric control can be effected by any of the well-known calorimeters, such as Mahler's or Fischer's, but is a somewhat difficult and complicated operation, and the working of the

air pyrometer is even more so.

Most of the drawbacks formerly connected with pyrometry have been removed by the construction of Le Chatelier's Thermoelectric Pyrometer. Its working part is shown in Fig. 7. It consists of a thermocouple, composed of a wire a of pure platinum, and a wire b of an alloy of 90 parts of platinum+10 parts of rhodium, soldered to the former. These wires are insulated by porcelain tubes c, d, about 3 feet long, and protected on the outside, against heating gases, by the iron pipe e e. The wires are

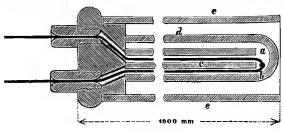


Fig. 7.

connected with platinum or copper wires, leading to a galvanometer, and the indications of the needle of the latter show the temperature at the point where a and b are soldered together. The temperature scale marked on the galvanometer is fixed by comparing it with an air pyrometer at the works where the

instruments are made.

The following rules must be observed for the use of this pyrometer. The galvanometer should be placed in a horizontal position and so as to be protected against mechanical oscillations, preferably on a wall-bracket, and this may be at some distance from the pyrometer itself—e.g. in the manager's office. Before moving the galvanometer from its place, the needle should be always arrested. After fixing it on its bracket, the arresting-screw is cautiously loosened, until the needle begins to move. If it does not point to zero after being placed in a horizontal position, this must be effected by moving the adjusting screws.

The electric resistance of the conducting wire should not appreciably exceed 1 ohm; up to distances of about 300 feet this will be attained by employing insulated copper wire of 12-inch thickness. The junction of the couple with the conducting wires ought not to be much above the ordinary temperature. If one of the wires should break, the contact can be re-established by twisting the ends tightly together for a length of about \(\frac{1}{2} \) inch; it is preferable to fuse them together in an oxyhydrogen flame. If the temperature within the furnace does not exceed 1000°, the pyrometer may be left permanently inside; for higher temperatures, which would cause the iron pipe to soften and to burn away too rapidly, the pyrometer should be taken out and introduced merely for taking an observation, which may be done ten minutes afterwards. Even then it is best to provide a fireclay slab on which the instrument can rest. Le Chatelier's pyrometer may be employed for temperatures up to 1500°C. For higher temperatures, up to 2100°, W. C. Heræus (Hanau, Germany) has constructed a thermocouple, consisting of a wire of pure iridium, fused to another wire of an alloy of 90 parts iridium + 10 ruthenium.

For such high temperatures Wanner's pyrometer is now frequently used. It allows a photometric comparison of the polarised light from a small electric lamp with that of the furnace, etc., to be tested, by means of an instrument like a telescope; it is easy to handle, and is serviceable for approximately measuring temperatures above 1500°, where Le Chatelier's pyrometer cannot be employed. It is also more convenient than the latter for estimating temperatures inside the furnace at some distance from the front of the furnaces. (Supplied by Townson & Mercer, London.)

D.—Feed-Water for Steam-Boilers, etc.

1. Hardness.—The English degrees of hardness are based on the unit of 1 part CaCO₃, or its equivalent of MgCO₃, in 70,000 parts of water (grains to the gallon). The French degrees signify each 1 part CaCO₃ (or MgCO₃) in 100,000 water, the German degrees that of 1 part CaO (or MgO) in 100,000 water.

The testing for hardness was formerly mostly effected by Clark's soap test. The methods to be described here are both

simpler and more accurate than the soap test.

(a) Temporary Hardness (alkalinity) is that which is removed by prolonged boiling, by which operation nearly all the $CaCO_3$ and some of the $MgCO_3$ is precipitated. This can be estimated with sufficient approximation by testing the water alkalimetrically, employing $\frac{1}{5}$ normal hydrochloric acid and methyl orange as indicator, at the ordinary temperature, until the first reddish tint appears. When employing 200 c.c. of the water for this test, the number of c.c. of $\frac{1}{5}$ normal acid used, multiplied by 3.5, indicates

the English degrees of temporary hardness (for French degrees

multiply by 5, for German degrees by 2.8).

Where feed-water, purified by means of sodium carbonate, is tested in this way, an error may be caused by the presence of an excess of Na₂CO₃, which makes the hardness appear too high. In such cases the 200 c.c. of water employed should be boiled in a porcelain dish for some time, the precipitated carbonates removed by filtration, and the filtrate titrated as above. acid then used corresponds to the Na₂CO₃ and a little unprecipitated MgCO₃.

(b) Total Hardness.—Add to 200 c.c. of the feed-water hydrochloric acid in slight excess, boil down to about 50 c.c.; wash this into a 100 c.c. flask, neutralise exactly with caustic soda solution, employing methyl orange as indicator; add 20 c.c. of a mixture of equal volumes of 1/5 normal caustic soda solution and 1/5 normal sodium carbonate solution, boil, allow to cool, fill up the flask to the 100 c.c. mark with distilled water, pour through a dry filter, and estimate the unsaturated alkali in 50 c.c. of the filtrate by a normal hydrochloric acid and methyl orange. Multiply the c.c. of acid used by 2, and deduct this from 20; the remainder = ashows the alkali consumed for precipitating the alkaline earths contained in 200 c.c. of water. The total hardness is hence, = 3.5a in English degrees, 5a in French, 2.8a in German degrees. This process is accurate also in presence of magnesia. By deducting the degrees of alkalinity found in a from the total hardness found in b, the permanent hardness is obtained—i.e. that which is caused by calcium sulphate.

Water having a total hardness of less than 8° (English) is considered as soft, from 8° to 15° as moderately hard, above 15° as

hard.

- (c) Residue on Evaporation.—In the case of water containing but little MgO, a convenient check for the total hardness-i.e. the sum of alkalinity a and permanent hardness b—is afforded by evaporating 500 c.c. down to dryness, heating to decompose the organic matter, moistening with a solution of CO2 in distilled water, and drying at 110°. Since the degrees of hardness are all calculated for CaO, the value of c will not be quite equal to a+b, if any considerable quantity of magnesia is present, and this indirectly proves the presence of more magnesia than usual.
- 2. Estimation of the Reagents (lime water and sodium carbonate) required for Purifying Water.—Add to 500 c.c. of the water 10 c.c. of a 1 normal sodium carbonate solution, evaporate to dryness, take up the residue with a small quantity of water, filter through a small filter, wash till there is no further alkaline reaction, and estimate the unconsumed sodium carbonate in the

filtrate plus washings by titrating with methyl orange and $\frac{1}{5}$ normal hydrochloric acid. If a c.c. of $\frac{1}{5}$ normal sodium carbonate are used in the titration, then $2a \times 0.0106$ shows the grams of pure sodium carbonate required per litre of the water for removing the

calcium sulphate—i.e. the permanent hardness.

The amount of lime water required for removing the temporary hardness is estimated as follows:—To 500 c.c. of water add 100 c.c. of clear lime water, after having previously determined its percentage of CaO by titrating with $\frac{1}{5}$ normal hydrochloric acid and phenolphthalein (methyl orange is not applicable in this case, because this would indicate also the CaCO₃ present in small quantities along with Ca(OH)₂, which would be wrong). Heat the mixture during half an hour in a covered flask (to keep out CO₂), allow to cool, pour through a dry filter, and titrate, without delay, 500 c.c. of the filtrate. The HCl now used, increased by one-fifth (since the original 500 c.c. of water had been brought to 600 c.c.), shows the quantity of lime not used up. By deducting this from the CaO originally contained in 100 c.c. of the lime water, the quantity of CaO required for destroying the temporary hardness of $\frac{1}{5}$ litre of the water to be tested is ascertained.

II. SULPHURIC ACID MANUFACTURE.

A.—Brimstone.

- 1. Moisture.—This should be estimated by drying an average sample of 100 g. at 70° for a few hours, in an oven or water-bath. The sample must be prepared without losing any moisture during the operation; the brimstone for this purpose must, therefore, not be ground, but only coarsely crushed, as quickly as possible.
- 2. Bituminous Substances (Fresenius).—Remove the sulphur by heating the sample for some time a little over 200°, taking care that it does not take fire, weigh the residue, and deduct the ash found in No. 3.
- 3. Ash.—Burn 10 g. in a porcelain dish and weigh the residue. Some samples of brimstone contain carbonaceous matter. In this case (which is easily recognised by the appearance of the sample) the flame must be removed immediately after the sulphur has been burned, and before the carbon has taken fire, so that the latter is not calculated as sulphur.
- 4. Arsenic.—Treat 10 g. brimstone with dilute liquor ammoniæ at 70° to 80°, in order to dissolve the As₂S₃, filter, neutralise the filtrate exactly with dilute nitric acid, and titrate with deci-

normal silver nitrate solution, until a drop gives a brown colour with a solution of neutral potassium chromate. Each c.c. of the silver nitrate solution indicates 0.041 per cent. As₂S₃. If the arsenic should be present as ferric or calcium arsenate (this never occurs in the case of native brimstone, but it may do so in the case of sulphur recovered from Leblanc soda residue), the sample must be extracted with carbon disulphide, the residue oxidised by aqua regia, and the sulphur estimated as in pyrites (see below).

5. Direct Estimation of Sulphur (Macagno, Chem. News, v., 43, p. 192).—Fifty g. of the finely ground brimstone are dissolved in 200 c.c. carbon disulphide by digesting in a stoppered bottle at the ordinary temperature, and the specific gravity of the liquid=s is estimated. This must be reduced to the specific gravity at 15° =S, by means of the formula (valid up to 25° C.) S,=s+0.0014 ($t-15^{\circ}$). The following table gives, for each value of S, the percentage in this solution, which number must be multiplied by 4 to indicate the percentage of sulphur in the sample of brimstone:—

Specific Gravities of Solutions of Sulphur in Carbon Disulphide at 15° (referred to Water of 4°).

Spec. %	Spec. %	Spec.	%	Spec.	%	Spec.	%
Grav. S	Grav. S	Grav.	Š	Grav.	Si	Grav.	\$
1-271 0 1-272 0·2 1-278 0·4 1-274 0·6 1-275 0·9 1-275 1·9 1-277 1·4 1-278 1·6 1-279 1·9 1-280 2·1 1-281 2·4 1-282 2·6 1-283 2·9 1-284 8·1 1-285 3·4 1-286 3·6 1-287 3·9 1-288 4·1 1-288 4·1 1-288 4·1 1-289 4·6 1-290 4·6 1-291 4·8 1-292 5·0 1-293 5·8	1-296 6.0 1-297 6.8 1-298 6.5 1-299 6.7 1-300 7-0 1-301 7-2 1-302 7-6 1-303 7-8 1-304 8-0 1-305 8-2 1-306 8-5 1-307 8-7 1-308 8-9 1-309 9-2 1-310 9-4 1-311 9-7 1-312 9-9 1-313 10-2 1-314 10-4 1-315 10-6 1-316 10-9 1-318 11-3 1-318 11-3 1-318 11-3 1-318 11-3	1:321 1:822 1:323 1:324 1:326 1:326 1:326 1:327 1:329 1:330 1:331 1:332 1:333 1:334 1:335 1:335 1:336 1:331 1:342 1:343 1:344 1:342 1:343 1:342 1:343 1:344 1:342 1:343 1:344 1:342 1:343 1:343 1:344 1:344 1:344 1:344 1:344 1:345	12·1 12·3 12·8 12·8 18·1 18·3 18·5 13·8 14·7 15·0 14·7 15·0 16·4 15·6 16·6 17·1 17·4 17·6 17·9	1:846 1:347 1:349 1:350 1:351 1:352 1:353 1:354 1:355 1:356 1:357 1:360 1:360 1:361 1:362 1:363 1:365 1:365 1:367 1:368 1:368 1:367 1:368	18·1 18·4 18·6 18·9 19·0 19·6 19·9 20·4 20·4 20·4 21·0 21·2 21·5 21·5 21·2 22·3 22·3 22·3 22·3 24·0 24·8 24·8 25·1	1:371 1:372 1:372 1:373 1:374 1:375 1:375 1:375 1:380 1:381 1:382 1:383 1:384 1:386 1:386 1:386 1:386 1:389 1:390 1:391 (satu	25·6 26·0 26·6 26·9 27·4 28·6 29·7 30·2 30·8 31·4 31·9 32·6 38·2 33·8 34·5 86·7 37·2 3a-4d)

- 6. Selenium is found by fusing a sample with potassium nitrate, dissolving the mass in hydrochloric acid, and treating with sulphur dioxide, which precipitates the selenium.
- 7. The degree of fineness of ground brimstone is estimated in France by means of Chancel's sulphurimeter, i.e. a glass tube, closed at one end, provided with a glass stopper at the other, and graduated in 100 parts. In this, the ground brimstone is shaken up for some time with pure, anhydrous ether, and after allowing the tube to rest in a vertical position, the number of divisions occupied by the brimstone is read off (degrees Chancel).

B.—Spent Oxide of Gas-works. See "Coal-Gas."

C.—Pyrites.

1. Moisture.—The ground pyrites is dried at 105° C. till the weight remains constant. For the following tests the pyrites is not employed in the dried state, but the finely ground average sample, kept in a well-sealed bottle. Compare the Appendix as to taking and reducing an average sample.

The analytical results are calculated for dry pyrites, for which purpose a special estimation of moisture is made with the average

sample.

2. Sulphur (Lunge's method).—About 0.5 g. of pyrites is treated with about 10 c.c. of a mixture of 3 vols. nitric acid (specific gravity 1'4) and 1 vol. strong hydrochloric acid, both ascertained to be absolutely free from sulphuric acid, due care being taken to avoid all spurting. Quite exceptionally, the separation of a little free sulphur will be observed; if this takes place, the sulphur must be oxidised by adding a little potassium chlorate. Evaporate to dryness on a water-bath, add 5 c.c. hydrochloric acid, evaporate once more (no nitrous fumes ought to escape now), add I c.c. concentrated hydrochloric acid and 100 c.c. hot water, filter through a small filter, and wash with hot water. The insoluble residue may be dried, ignited, and weighed. It may contain, besides silicic acid and silicates, the sulphates of barium, lead, and even calcium, the sulphur of which, as being useless, is purposely neglected. The filtrate and washings are saturated with ammonia, avoiding much excess and keeping the liquid at 60°-70° for about ten or fifteen minutes before filtration, but not boiling, till all the ammonia is expelled (in which case the precipitate contains some basic sulphate). precipitated ferric hydroxide is filtered and washed. This can be done in from half to one hour, by employing the following precautions: (1) Filter hot, and wash on the filter with hot water, avoiding channels in the mass, but so that the whole precipitate is thoroughly churned up with the water each time (washing by decantation would produce too great a bulk of liquid); (2) employ sufficiently dense, but rapidly filtering paper; (3) use funnels, made at an angle of exactly 60°, whose tube is not too wide, and is completely filled by the liquid running through. A filter pump may also be employed, with the usual precautions. Wash till about 1 c.c. of the washings, on adding BaCl₂, shows no opalescence, even after a few minutes. (If there is any doubt on this point, the complete absence of basic sulphates should be investigated by drying the precipitated ferric hydroxide, fusing it with pure sodium carbonate, and testing the aqueous solution of the melt for sulphates.)

The filtrate and washings should not appreciably exceed 300 c.c., or else should be concentrated by evaporation. Acidulate with pure hydrochloric acid in very slight excess, preferably by adding acid till methyl orange is just reddened, and then adding just 1 c.c. of strong HCl. Then heat to boiling, remove the burner, and add a solution of BaCl2, previously heated to boiling. A large excess of BaCl₂ must be decidedly avoided. For 0.5 g. pyrites, 20 c.c. of a 10 per cent. solution of BaCl₂ is always more than sufficient. This is roughly measured off in a test-tube, provided with a mark, and heated in the same tube; it is then poured into the hot liquid all at once, not drop by drop. It is true that this procedure will cause a little barium chloride to be carried down along with the sulphate, but the error caused by this just compensates the opposite error, caused by the slight solubility of barium sulphate in the hot solution, containing free HCl and ammonium chloride.

After precipitation the liquid is left to stand for half an hour, when the precipitate should be completely settled. It is quite unnecessary to wait for a longer time, as is sometimes prescribed; this is not merely a waste of time, but it unnecessarily retards the work by the cooling of the liquid. Decant the clear portion as carefully as possible through a filter, pour 100 c.c. boiling water on the precipitate, and stir up. Wait two or three minutes, when the liquid ought to have settled completely, and decant again. Repeat the treatment with boiling water, and the decantation, three or four times, till the liquid ceases to give an acid reaction. Wash the precipitate on to the filter, dry, and ignite. It should be a perfectly white and loose powder. One part of it is equal to

0[,]13743 sulphur.

3. Copper.—The method employed at the Duisburg Copper Works, in its most recent form, is as follows:—Of the powdered pyrites, dried at 100° C., 5 g. is gradually dissolved in 60 c.c. of nitric acid, spec. grav. 1'2, in a flask placed in a slanting position.

When the first violent reaction is over, the flask is heated and the evaporation continued until thick, white fumes of sulphuric acid escape. Dissolve the dry residue in 50 c.c. hydrochloric acid, spec. grav. 119, add 2 g. sodium hypophosphite, dissolved in 5 c.c. water, for the purpose of removing the arsenic and reducing the ferric chloride, boil for some time, then add an excess of concentrated hydrochloric acid, diluted with about 300 c.c. hot water, pass hydrogen sulphide into the liquid, separate the precipitate from the liquid by filtration, and wash it well. Pierce the filter paper with a glass rod, wash the precipitate back into the precipitating flask, dissolve the sulphides adhering to the filter and the principal portion of the precipitate by means of nitric acid, and evaporate the contents of the flask to dryness on the water-bath. Treat the residue with nitric acid and water, neutralise with ammonia, and add sulphuric acid in slight excess. liquid has cooled down, separate the clear liquid from the insoluble lead sulphate, etc., wash out the flask and filter with water containing a little sulphuric acid, add to the filtrate 3 to 8 c.c. nitric acid, spec. grav. 1.4, and precipitate the copper electrolytically. From the ascertained percentage of copper deduct 0.01 per cent. for bismuth and antimony.

- 4. Lead remains in the residue from the treatment with aqua regia (No. 2) or nitric acid (No. 3), as lead sulphate. This is extracted from the residue (preferably that from the nitric acid treatment) by heating with a concentrated solution of ammoniam acetate. The solution is evaporated, with addition of a little pure sulphuric acid, the evaporation completed in a porcelain crucible, and the residue dried and ignited. One part PbSO₄ = 0.6831 Pb.
- 5. Zinc is sometimes estimated in pyrites, because the sulphur combined with it is hardly recoverable in the pyrites burners. The following method (communicated to the author by Messrs Hassreidter and Prost) should be employed in this case, in lieu of Schaffner's method described subsequently for zinc blende, because in the case of pyrites the presence of iron renders gravimetric preferable to volumetric analysis: - Dissolve 1 g. pyrites in aqua regia, as described on p. 108, expel the nitric acid, take up the residue with about 20 c.c. concentrated hydrochloric acid, dilute with water, treat the acid solution with H2S in order to precipitate lead, etc., filter, expel the H₂S from the filtrate by boiling, and oxidise the liquid with aqua regia. When cooled down, add animonium carbonate until the precipitate formed redissolves but slowly, then add ammonium acetate, boil for a short time, and filter the liquid from the precipitated basic ferric sulphate. As this contains a little zinc, dissolve it in hydrochloric acid. precipitate it again as above, and repeat this treatment until no

more zinc is found in the filtrate. The united filtrates are concentrated by evaporation. Then precipitate the zinc in the hot solution by H_2S , allow to stand for twenty-four hours, pour off the clear liquid, filter, wash the ZnS, dissolve it (without removing the filter) in dilute HCl, boil off the H_2S , precipitate with sodium carbonate, wash the ZnCO₃, dry and ignite it. One part ZnO=0°8034 Zn. For very accurate work the SiO₂, Fe₂O₃, and Al₂O₃ retained in the ZnO should be estimated and deducted, but this is very rarely necessary.

- 6. The Carbonates (of Ca, etc.) are sometimes estimated in pyrites, because they convert a certain quantity of sulphur into sulphate. Since their quantity is always small, the CO₂ is estimated directly by expelling with strong acids, and is easily estimated gravimetrically by absorbing it in soda-lime, etc., or, more accurately and quickly, by the volumetrical process of Lunge and Rittener, which will be described later on in connection with the analysis of carbonated soda liquors.
- 7. Arsenic.—Reich's method, modified by M'Cay:—Decompose 0'5 g. pyrites by concentrated nitric acid in a porcelain crucible, remove the free acid by evaporation, but not to complete dryness, add 4 g. sodium carbonate, heat on the sand-bath until the mass is quite dry, add 4 g. potassium nitrate, and heat until the mass has fused quietly for ten minutes. After cooling, wash it with hot water, acidulate the filtered solution with a little nitric acid, heat for some time till all CO_2 is expelled, add silver nitrate, and neutralise carefully with dilute ammonia. The precipitate formed contains all the arsenic as $\mathrm{Ag}_3\mathrm{AsO}_4$. Dissolve it in dilute nitric acid, and either estimate the silver volumetrically by ammonium thiocyanate (Volhard's method), or evaporate the solution in a porcelain dish, dry, and weigh the residue. One part $\mathrm{Ag}_3\mathrm{AsO}_4$ =0'1620 As, or 1 part $\mathrm{Ag}=0$ '2316 As.

D.—Burnt Pyrites (Cinders).

1. Sulphur.—Mix exactly 2 g. sodium bicarbonate of known alkalimetric value, in a nickel crucible of 20 or 30 c.c. capacity, intimately with 3 207 g. of ground cinders, by means of a glass rod flattened at the end. Heat the crucible by a small gas-flame, the point of which reaches just to the bottom of the crucible for ten minutes. Stir the mass up again, heat it again for fifteen minutes by a stronger flame, but not to the fusing point. During the heating the crucible should be covered, and no stirring should take place during this time, to prevent the escaping CO₂ from carrying away any dust. Empty the contents of the crucible into a porcelain dish, wash it out with water, add a concentrated

solution of sodium chloride, free from magnesium chloride and perfectly neutral (without this addition it is difficult to avoid some ferric oxide passing through the filter later on), boil for ten minutes, filter, wash the insoluble residue till there is no alkaline reaction, allow the filtrate, etc., to cool down, and titrate it with methyl orange and normal hydrochloric acid (1 c.c.=0.05300 Na₂CO₃, indicating 0.01604 S). If we call the number of c.c. of the acid required by 2 g. bicarbonate=a, and the c.c. of acid used for titrating=b, the percentage of sulphur in the cinders corresponds to $\frac{a-b}{o}$.

- 2. Copper is estimated as in fresh pyrites (p. 109), but the solution of 1 g. of the sample is effected by hydrochloric acid with only a few drops of nitric acid, and no deduction for Bi and Sb is made from the electrolytically estimated Cu.
- 3. Iron.—Dissolve 0.5 cinders in concentrated hydrochloric acid by prolonged heating; reduce the boiling solution by zinc, free from iron, or more conveniently by stannous chloride, the excess of the latter being removed by a little mercuric chloride solution; pour the solution thus obtained into a half-litre of water, to which about 2 g. manganous sulphate has been added, and which has been just reddened by one or two drops of potassium permanganate. Determine the iron by titrating with decinormal potassium permanganate, each c.c. of which indicates 0.005584 g., or in 0.5 g. cinders 1.117 per cent. Fe.

E.-Zinc Blende.

- 1. Total Sulphur.—Decompose 0.5 of the finely ground sample by pure fuming nitric acid, cooling the beaker until the first violent reaction is over, and add hydrochloric acid, drop by drop, gently heating, until the decomposition is finished. Remove the iron by precipitation with ammonia, as in the case of pyrites (p. 108), and precipitate the sulphate by adding the requisite quantity of the dilute hot solution of barium chloride, all at once, in which case the BaSO₄ remaining in solution is just compensated by the BaCl₂ carried down with the precipitate (compare p. 109).
- 2. Zinc.—The following modification of Schaffner's method is employed at the Rhenish and Belgian zinc works, as communicated to the author by Messrs Hassreidter and Prost:—Treat 2.5 g. of the finely ground blende (dried at 100° C.) in a 250 c.c. Erlenmeyer flask with 12 c.c. fuming nitric acid, first without heating, then heating gently until no more red vapours come off. Add 20 to 25 c.c. concentrated hydrochloric acid, evaporate to dryness on a sand-bath, dissolve in 5 c.c. hydrochloric acid and a

little water, heat for some time, add 50 or 60 c.c. water, and heat to 60 or 70° C. until everything except gangue and sulphur has passed into solution. Pass a moderate current of H₂S into the solution, and gradually add, with continuous stirring, 50 to 100 c.c. water, until all Pb and Cd have been precipitated. This will be recognised by the fact that the bubbles of gas evolved are transparent. Any excessive dilution or too much prolonged treatment with H₂S must be avoided. Filter and wash with 100 c.c. sulphuretted hydrogen water, to which 5 c.c. hydrochloric acid has been added, until a drop of the filtrate gives no reaction for zinc with ammonium sulphide. Boil the filtrate and washings (together about 300 c.c.) in order to expel the H_2S (test by lead paper), and oxidise the ferrous salt by adding 5 c.c. concentrated nitric acid and 10 c.c. hydrochloric acid. When partially cooled down, put the solution into a half-litre flask, add 100 c.c. liquor ammoniæ (specific gravity 0.9 to 0.91) and 10 c.c. of a cold saturated solution of ammonium carbonate, shake well and allow to cool. This solution we call A.

In the meantime an ammoniacal zinc solution of known strength, the "titre," is prepared by dissolving a quantity of chemically pure zinc, approximately equal to that contained in the ore, in another half-litre flask, in 5 c.c. nitric acid+20 c.c. hydrochloric acid, adding 250 c.c. water, 100 c.c. liquor ammoniæ, and 10 c.c. of ammonium carbonate solution, shaking up and allowing to stand till cool. (If manganese be present, add 10 c.c. hydrogen peroxide before adding the liquor ammoniæ.) This solution we call B. When all is cool, fill both flasks up to the mark, and filter the solution A (made from the ore) through a dry pleated filter. For the titration itself take from each of the solutions A and B 100 c.c., run this into stout glass cylinders ("battery glasses") and dilute each with 200 c.c. water. The titration is effected by a concentrated solution of commercial crystallised sodium sulphide, diluted with ten or twenty times its volume of water and indicating per c.c. 0.005 to 0.010 g. Zn. This solution is placed in two 50 c.c. burettes, standing side by side, and is run by turns into the zinc solutions A and B. At first 2 or 3 c.c. less than is ultimately required is run in. Agitate the solutions and place at the same time a drop of each, by means of a thin glass rod, on to a strip of sensitive lead paper. After the action has lasted fifteen or twenty seconds, blow away the drops by means of a small wash-bottle and continue the addition of Na₂S, until both drops, after acting for the same time, produce a slight but distinct brownish colour of the same intensity. If too much liquid has been used in these drop tests, the titration must be repeated once or twice; at all events, the final reaction must take place equally in both glasses, and the readings must be accurate to 0.02 c.c.

If we call the quantity of pure zinc weighed out as "titre"

a, that of the c.c. sodium sulphide solution used for the "titre" b, and the c.c. used for 100 c.c. of the ore solution (=0.5 g. ore) c, the expression $\frac{40 \ ac}{b}$ gives the percentage of zinc in the ore.

For exact estimations, a quantity of ferric chloride, equal to the content of iron in the ore, is added to the "titre," in order to meet the objection that the ferric hydroxide may carry down a little zinc.

Some blendes, containing a large proportion of silicates, obstinately resist the ordinary methods of testing (Jensch, Zsch. f. angew.

Chem., 1894, p. 155).

- 3. Lead.—The sulphides precipitated in No. 2 are, if necessary, digested with a concentrated solution of sodium sulphide; then dilute, filter, wash the residue, dissolve it (together with the filter) in nitric acid (sp. gr. 1'20), filter, add an excess of sulphuric acid, evaporate to dryness, and weigh the lead as sulphate. One part $PbSO_4=0.6831\ Pb.$
- 4. Lime and Magnesia are estimated, because they form sulphates in the roasting process. Digest 2.5 g. blende with 50 c.c. dilute sulphuric acid (1:10), with application of heat, decant the clear portion; repeat this treatment once or twice, wash the residue, expel the $\rm H_2S$ from the filtrates by boiling, oxidise with bromine water, precipitate with ammonium carbonate, and in the filtrate precipitate first the calcium by ammonium oxalate (weigh this as CaO after strongly igniting), and in the filtrate from this the magnesium by ammonium phosphate (compare p. 148).
 - 5. Arsenic is estimated as described on p. 111.
- 6. Carbon Dioxide may be estimated as in pyrites, p. 111. This is useful, even when CaO and MgO are estimated, since blende contains sometimes ferrous and zinc carbonate.
- 7. Available Sulphur.—From the total sulphur found in No. 1 (p. 112) deduct:

The remainder indicates the sulphur available for the manufacture of sulphuric acid. The S of BaSO₄, etc., remains in the residue from the dissolving process.

F.—Cinders from Blende.

1. Sulphur (according to Lunge and Stierlin, Zsch. f. angew. Chem., 1906, p. 26).—The process is carried out as described for

pyrites cinders on p. 111, but 2 g. ground potassium chlorate is added to the mixture. The bottom of the crucible should finally be at a red heat, but the contents should merely frit together, not fuse entirely. The crucible must be covered during the heating, and its contents must not be stirred up. The calculation is as on p. 112—that is, the percentage of $S = \frac{a-b}{2}$.

An addition of potassium chlorate is already required in the case of cinders from iron pyrites containing much zinc. In case the cinders contain upwards of 6 per cent. S, the mixture should be: 1.603 g. cinders, 2.000 NaHCO₃, 4.0 KClO₃, 2.-3 ferric oxide (free from S). The percentage of sulphur is then a-b, where a is the c.c. of normal acid corresponding to the 2.000 bicarbonate, b the c.c. of acid required for titration after the heating.

This process is also applicable to fresh (unroasted) blende, by using the following mixture: 0.3207 g. blende, 2.000 NaHCO₃,

 $2KClO_3$, $2Fe_2O_3$; percentage of S=5 (a-b).

A crude test is made by the foreman at the works, in this manner: he heats a sample of the cinders with 10 c.c. hydrochloric acid (1:2 water) in a flask, holding in its neck a strip of paper soaked in a neutral or faintly alkaline solution of lead accetate, and he judges of the more or less complete state of roasting by the depth of the brown colour developed on the paper.

2. Zinc, as on p. 110.

G.-Gases.

I. Chamber Process.

1. Burner Gases.—(a) SO₂ is estimated by Reich's method. The gas is aspirated through a solution of iodine, contained in a wide-necked 200 c.c. bottle, and coloured blue by starch solution, till the colour is just discharged. This bottle is connected with a larger bottle, converted into an aspirator by having a tap near the bottom, or by a siphon with a pinchcock. Water is run from this into a graduated 250 c.c. jar. The iodine bottle is shaken up during the aspiration, and at the moment when the colour is discharged, the tap of the aspirator is closed and the volume of water in the jar is read off. It is equal to the volume of the water run out, increased by that of the SO₂ absorbed. The absorbing-bottle is charged with 10 c.c. of a decinormal solution of iodine (12.692 g. iodine per litre, preparation and valuation in the Appendix), along with about 50 c.c. of water, a little starch solution, and a little sodium bicarbonate. The above quantity of iodine is=0.03207 g. SO₂=10.95 c.c. at 0° C. and a pressure of The latter figure, multiplied by 100 and divided by 10.95 c.c. + the volume of the water run out, yields the percentage of SO₂ in the gas by volume.

This calculation is saved by the following table, in which the 10'95 c.c. are taken into account.

c.c. Water in the Measuring Jar.	Per cent. SO ₂ by Volume.	c.c. Water in the Measuring Jar.	Per cent. SO ₂ by Volume.
80.3	12.0	126.0	8.0
84.3	11.5	135.1	7.5
88.6	11.0	145.5	7.0
93.4	10.5	157.6	6.6
98.6	10.0	171.6	6.0
104.4	9.5	188.2	5.5
110.3	9.0	208.1	5.0
117.9	8.5		

In this no notice is taken of temperature and barometer. If these are to be observed, the volume read off is reduced to 0° and 760 mm. by the Tables 20 and 21, and then looked up in the above table.

(b) Since Reich's test takes no account of the SO₃ always present in burner gases, it is preferable to estimate the total acids (SO₂+SO₃), either along with the test (a) or exclusively. This is performed in the same apparatus, but the absorbing-bottle is preferably provided with a gas entrance tube, closed at the bottom and perforated by numerous pinholes, through which the gas issues in small bubbles. The gas is passed through a solution of decinormal sodium hydroxide, coloured by phenol-phthalein, until the colour is just discharged. The calculation is made as for pure SO₂, employing the table given in (a) (Lunge, Zsch. f. angew. Chem., 1890, p. 563).

In both cases—(a) and (b)—an error is sometimes caused by arsenious oxide collecting in the aspirating tube; this is avoided

by filtering the gases through asbestos.

2. Chamber Gases.—In these, sulphur dioxide and nitrous gases are estimated (as described by Raschig, Zsch. angew. Chem., 1909, xxii., p. 1182) by means of a Reich apparatus (p. 115), charged with 10 c.c. decinormal iodine solution, 100 c.c. water, a little starch solution, and 10 c.c. of a cold saturated solution of sodium acetate. The estimation is performed as described on p. 115, taking care that no droplets of sulphuric acid get into the iodine solution, which is effected by passing the chamber gases through glass wool. The calculation of SO₂ is effected as described supra. In order to estimate the nitrous gases, add, after estimating the SO₂, a drop of phenolphthalein solution to the decolorised solution, and titrate with decinormal caustic soda solution up to the appearance of a red colour. From the number of c.c. used deduct 10 c.c. for the hydriodic acid and 10 c.c. for the sulphuric acid formed, according to the equation: SO₂+J₂+2H₂O=H₂SO₄+2HJ. The c.c. of decinormal soda

solution, used over and above these 20 c.c., indicate nitric or nitrous acid.

- 3. Chamber Exit Gases.—(a) Oxygen. Before estimating this, the acids are removed from the gas by washing with a solution of potassium or sodium hydroxide. Single samples can be taken at odd times during the day, but it is recommended to take an average sample for the whole day, by aspirating at least 10 or 20 litres of gas, and analysing a portion of this. The estimation of oxygen is best made by moist phosphorus in an Orsat apparatus (p. 95) with two absorbing tubes, one of which is filled with potassium hydroxide solution for removing the acids, the other with small pieces of phosphorus. The manipulation is exactly as in testing flue gases, but it should be observed that the temperature must be at least 16°, better 18° C., otherwise the tube must be warmed a little.
- (b) Sulphur and Nitrogen Acids.—The different acid compounds of sulphur and nitrogen are estimated together, whatever their degree of oxidation. The following methods agree in the main with those published by the British Alkali Makers' Association in 1878, but are improved in some analytical details. A continuous test over twenty-four hours is taken of the gases escaping from the exit pipes of the Gay-Lussac towers, aspirating at least one cubic foot per hour by means of any aspirator acting at a constant rate and recording the volume of gas=V by means of gauging the aspirator or by a gas meter. The volume V is reduced to 0° C, and 760 mm. pressure (=32° F, and 29°92 inches*) by the Tables 20 and 21, and is called V¹. In order to allow comparisons, the number of cubic feet of chamber space per pound of sulphur, burnt and passing into the chambers is recorded, excluding towers. but including tunnels, the amount of sulphur being taken by the weekly average, each firm to state the distance of the testing hole from the point at which the gases leave the Gay-Lussac towers. The absorption apparatus consists of four bottles or tubes, containing not less then 100 c.c. of absorbing liquid each, with a depth of at least 3 in. in each bottle, the aperture of inlet tubes not to exceed in in diameter, and to be measured by a standard wire. The first three bottles each contain 100 c.c. of normal caustic soda solution (3100 g. per litre), the fourth 100 c.c. distilled water. The caustic soda used must be free from nitrogen acids. The gases are tested (1) for total acidity, stated in grains of SO₃ per cubic foot of gas, or in grams per cubic metre; (2) sulphur acids; (3) nitrogen acids, both stated in grains of S and N per cubic foot (or grams per cubic metre). The analysis is carried out as follows:—The contents of the four

^{*} The law prescribes the cubic feet to be measured at 60° F. and 30 inches, which necessitates the use of other tables or factors than those mentioned in the text, but the difference is hardly perceptible, and certainly within the limits of experimental error.

bottles are united, taking care not to unuecessarily augment the bulk of the liquids, and are divided into three equal parts, one of which is reserved for accidents, etc. The first part is titrated with normal sulphuric acid (49.04 g. SO₄H₂ per litre), to ascertain total acidity. The number of cubic centimetres of acid necessary for neutralisation is called x. The second part of the liquid is gradually poured into a warm solution of potassium permanganate, strongly acidified with pure sulphuric acid. A small excess of permanganate must be present, and must be afterwards reduced by the addition of a few drops of sulphurous acid solution, until only a faint red tint is visible. Now all nitrogen acids are present as HNO₃, but no excess of SO₂. The HNO₃ is estimated by its action on FeSO4. Twenty-five c.c. of a solution, containing per litre 100 g. crystallised ferrous sulphate and 100 c.c. pure sulphuric acid (the same solution which is used for estimating MnO₂, p. 156) are put into a flask, 20 c.c. to 25 c.c. pure concentrated sulphuric acid is added, the mixture is allowed to cool, and the other mixture, treated with permanganate, etc., is added. The flask is closed by a cork with glass tubes. A current of CO2 passes through and issues beneath the surface of some water, to prevent entrance of air. First, all the air is expelled in this way by means of an apparatus giving a constant current of CO2; then the solutions are introduced, and the contents of the flask are heated to boiling, till the dark colour produced by the formation of NO has changed to a clear light yellow. This takes from a quarter of an hour to one hour, according to the quantity of NO₃H present and that of the sulphuric acid added. unoxidised ferrous sulphate is titrated by a seminormal permanganate solution (yielding 0 004 g. oxygen per cubic centimetre compare Appendix). The cubic centimetre used =y. Since the titre of the iron solution changes somewhat quickly, it should be tested daily by taking out 25 c.c. with the same pipette as is used for the above operation, and ascertaining the amount of permanganate required for oxidising it =z c.c. The data required are found by the following equations:—

1. Total Acidity in grams per cubic metre =

$$SO_3 = \frac{0.120(100 - x)}{V^1}$$

2. Sulphur in grams per cubic metre = $= \frac{0.008 (600 - 6x - z + y)}{V^{1}}$

8. Nitrogen in grams per cubic metre =

$$\mathbf{N} = \frac{0.007 (z-y)}{\mathbf{V}^1}$$

1. Total Acidity in grains per cubic foot =

$$SO_3 = \frac{1.852(100-x)}{V^1}$$

2. Sulphur in grains per cubic foot =

$$S = \frac{0.12346(600 - 6x - z + y)}{V^1}$$


8. Nitrogen in grains per cubic foot =

$$\mathbf{N} = \frac{\mathbf{0.10803}(z-y)}{\mathbf{V}^1}$$

The legal limit for total acidity in the lead-chamber process is 4 grains of SO₃ per cubic foot, before admixture with air, smoke, or other gases; for the contact process, the "best practicable means" are to be adopted.*

For the purposes of the Alkali Act, it is sufficient, in lieu of the above process, to estimate total acidity only by the test described on p. 118, employing decinormal soda solution and phenolphthalein.

(c) Nitric Oxide (NO) may be present in the exit gases after passing through the absorbing-bottles. If it is to be estimated, an absorption-tube (Fig. 8) + is interposed between the tubes of the apparatus described above and the aspirator. This tube con-

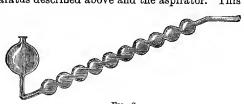

F10. S.

tains 30 c.c. of seminormal permanganate and 1 c.c. of sulphuric acid, specific gravity 1.25. The gas is passed through for twenty-four hours, and the tube then emptied and washed out. Now add 50 c.c. ferrous sulphate solution, corresponding to 2 z permanganate (compare last paragraph), and retitrate the decolorised liquid with permanganate. The quantity of the latter now used is called u. The NO has consumed (30+u-2z) c.e. permanganate, which is equal—

In grams of nitrogen per cubic metre of the volume V1. In grains of nitrogen per cubic foot. $N = \frac{0.007 \left(30 + u - 2z\right)}{3V^1} \qquad \qquad N = \frac{0.10803 \left(30 + u - 2z\right)}{3V^2}$

II. Contact Process.

- 1. The Entering Gases are analysed like those of the Chamber Process (p. 115).
- 2. The Catalysed Gases are passed through a measured quantity of iodine solution, and then through a vessel containing thiosulphate solution. The non-consumed iodine is retitrated by thiosulphate, and the total acidity is ascertained by baryta solution or by decinormal soda solution, with phenolphthalein as

^{*} Alkali Act, 1906.

[†] This shape of bulb-tubes has been found to be far superior to any other form of absorption-tubes tried.

indicator, making the same deduction as prescribed in the Reich-Raschig method (p. 116). If the c.c. of 1/10~N iodine solution consumed are designated by a, and those of 1/10~N soda solution (or baryta solution) by b, the formula x=0.003207a indicates the quantity of non-catalysed SO_2 , and y=0.004~(b-2a) that of the SO_3 , formed. The yield of SO_3 in volume per cent, is shown by the formula:—

 $\frac{(b-2a)100}{b-a}.$

H.—Sulphuric Acid.

1. Specific Gravity.—The specific gravity tables of sulphuric acid refer, of course, to chemically pure acid. Since, in the case of high-grade acids, the impurities always present in commercial acids quite sensibly increase the specific gravity, the table in the cost of acids over 90 per cent. H₂SO₄ should only be employed for the private use of the works, but sales should always be effected on the basis of a real analysis, as described later on under No. 9, p. 135.

The following table is based on that which the author formerly worked out from a series of very careful investigations, carried on with Isler and Naef; some corrections introduced by the Imperial German Standards Commission are incorporated.

It should be noted that the highest percentages show lower specific gravities than those just below, the maximum being at 99°35 per cent. H₂SO₄.

1. SPECIFIC GRAVITY OF SULPHURIC ACID AT 60° F.

Smarie	_		by weight tain	Kilo per	1 Cubic Fo 60°	oot of Acid F.
Specific Gravity.	Degrees Twaddell.	8O ₃ .	H ₂ SO ₄ .	litie. H ₂ SO ₄ .	Weighs lbs. avoir.	Contains lbs. avoir. H ₂ SO ₄ .
1·200	40	22·30	27.32	0·328	74·82	20:44
1·205	41	22·82	27.95	0·337	75·14	21:00
1·210	42	23·33	28.58	0·346	75·45	21:57
1·215	43	23·84	29.21	0·355	75·76	22:14
1·220	44	24·36	29.84	0·364	76·07	22:71
1·225	45	24·88	30.48	0·373	76·38	23:28
1.230	46	25·39	31·11	0·382	76·69	23·85
1.235	47	25·88	31·70	0·391	77·00	24·41
1.240	48	26·35	32·28	0·400	77·32	24·97
1.245	49	26·83	32·86	0·409	77·63	25·54
1.250	50	27·29	33·43	0·418	77·94	26·10
1·255	51	27.76	34·00	0.426	78.25	26.66
1·260	52	28.22	34·57	0.435	78.56	27.23
1·265	53	28.69	35·14	0.444	78.87	27.79
1·270	54	29.15	35·71	0.454	79.19	28.35
1·275	55	29.62	36·29	0.462	79.50	28.92
1.280	56	30·10	36.87	0.472	79·81	29·48
1.285	57	30·57	37.45	0.481	80·12	30·04
1.290	58	31·04	38.03	0.490	80·43	30·60
1.295	59	31·52	38.61	0.500	80·74	31·17
1.300	60	31·99	39.19	0.510	81·06	31·74
1.305	61	32·46	39.77	0.519	81·37	32·32
1.310	62	32·94	40.35	0.529	81·68	32·89
1.315	63	33·41	40.93	0.538	81·99	33·46
1.320	64	33·88	41.50	0.548	82·30	34·03
1.325	65	34·35	42.08	0.557	82·62	34·60
1.330	66	34·80	42.66	0.567	82·93	35·18
1.335	67	35·27	43.20	0.577	83·24	35·79
1.340	68	35·71	43.74	0.586	83·55	36·40
1.345	69	36·14	44.28	0.596	83·86	37·01
1.350	70	36·58	44.82	0.605	84·17	37·63

SPECIFIC GRAVITY OF SULPHURIC ACID-Continued.

Specific Gravity.	Degrees Twaddell.	90		litre,		
	1	SO ₃ .	H_2SO_4 .	H ₂ SO ₄ .	Weighs lbs. avoir.	Contains lbs. avoir. H ₂ SO ₄ .
1.355	71	37.02	45.35	0.614	84.49	38.24
1.360	72	37.45	45.88	0.624	84.80	38.85
1.365	73	37.89	46.41	0.633	85.11	39.46
1.370	74	38.32	46.94	0.643	85.42	40:07
1.375	75	38.75	47.47	0.653	85.73	40.68
1.380	76	39.18	48.00	0.662	86.04	41.29
1.385	77	39.62	48.53	0.672	86 36	41.91
1.390	78	40.05	49.06	0.682	86.67	42.52
1.395	79	40.48	49.59	0.692	86.98	43.13
1.400	80	40.91	50.11	0.702	87.29	43.74
1.405	81	41.33	50.63	0.711	87.60	44 '36
1.410	82	41.76	51.15	0.721	87.92	44.97
1.415	83	42.17	51.66	0.730	88.23	45.58
1.420	84	42.57	52.15	0.740	88.54	46.18
1.425	85	42.96	52.63	0.750	88.85	46.78
1.430	86	43.36	53.11	0.759	89.16	47.38
1.435	87	43.75	53.59	0.769	89.47	47.99
1.440	88	44.14	54.07	0.779	89.79	48.59
1 • 445 1 • 450	89 90	44·53 44·92	54·55 55·03	0.789 0.798	90·10 90·41	49·19 49·79
		42.03		0.000	00.70	F0.00
1.455	91 92	45.31	55.50 55.97	0.808 0.817	90·72 91·03	50.39
1·460 1·465	92	45.69 46.07	56.43	0.827	91.35	50·99 51·59
1.470	94	46.45	56.90	0.837	91.66	52.19
1.475	95	46.83	57.37	0.846	91.97	52.79
1.480	96	47.21	57.83	0.856	92.28	53.39
1.485	97	47.57	58.28	0.866	92.59	54.00
1.490	98	47.95	58.74	0.876	92.90	54.60
1.495	99	48.34	59.22	0.886	93.22	55.20
1.500	100	48.73	59.70	0.896	93.53	55.84
1.505	101	49.12	60.18	0.906	93.84	56.47
1.510	102	49.51	60.65	0.916	94.15	57.10

SULPHURIC ACID MANUFACTURE

SPECIFIC GRAVITY OF SULPHURIC ACID—Continued.

Specific Gravity.	Degrees Twaddell.	100 parts by weight contain		Kilo per	1 Cubic Foot of Acid 60° F.	
		SO3.	H ₂ SO ₄ .	litre. H ₂ SO ₄ .	Weighs 1bs. avoir.	Contains lbs. avoir. H ₂ SO ₄ .
1.515	103	49·89	61·12	0.926	94·46	57·73
1.520	104	50·28	61·59	0.936	94·77	58·36
1.525	105	50·66	62·06	0.946	95·09	59·00
1.530	106	51.04	62.53	0.957	95.40	59.62
1.535	107	51.43	63.00	0.967	95.71	60.26
1.540	108	51.78	63.43	0.977	96.02	60.89
1.545	109	52.12	63.85	0.987	96.33	61.52
1.550	110	52.46	64.26	0.986	96.65	62.15
1.555	111	52*79	64.67	1.006	96.96	62·78
1.560	112	53*22	65.20	1.017	97.27	63·49
1.565	113	53*59	65.65	1.027	97.58	64·10
1.570	114	53*95	66.09	1.038	97.89	64·79
1.575	115	54*32	66.53	1.048	98.20	65·42
1.580	116	54.65	66:95	1.058	98·52	66·04
1.585	117	55.03	67:40	1.068	98·83	66·67
1.590	118	55.37	67:83	1.078	99·14	67·77
1.595	119	55.73	68:26	1.089	99·45	67·96
1.600	120	56.09	68:70	1.099	99·76	68·60
1.605	121	56:44	69.13	1·110	100.07	69·29
1.610	122	56:79	69.56	1·120	100.39	69·92
1.615	123	57:15	70.00	1·131	100.70	70·60
1.620	124	57:49	70.42	1·141	101.01	71·20
1.625	125	57:84	70.85	1·151	101.32	71·85
1.630	126	58·18	71·27	1·162	101.64	72·54
1.635	127	58·53	71·70	1·172	101.95	73·16
1.640	128	58·88	72·12	1·182	102.26	73·79
1.645	129	59·22	72·55	1·193	102.57	74·47
1.650	130	59·57	72·96	1·204	102.88	75·16
1.655	131	59·92	73·40	1·215	103·19	75·84
1.660	132	60·26	73·81	1·225	103·50	76·47
1.665	133	60·60	74·24	1·236	103·82	77·16

SPECIFIC GRAVITY OF SULPHURIC ACID-Continued.

Specific Gravit y.	Degrees Twaddell.	100 parts by weight contain		Kilo per	1 Cubic Foot of Acid 60° F.	
		SO ₃ .	H ₂ SO ₄ .	litrē. H ₂ SO ₄ .	Weighs lbs. avoir.	Contain lbs. avoi H ₂ SO ₄
1.670	134	60 · 95	74·66	1·246	104·13	77•78
1.675	135	61 · 29	75·08	1·259	104·44	78•59
1.680	136	61.63	75.50	1.268	104.75	79·16
1.685	137	61.93	75.86	1.278	105.07	80·12
1.690	138	62.29	76.30	1.289	105.38	80·81
1.695	139	62.64	76.73	1.301	105.69	81·51
1.700	140	63.00	77.17	1.312	106.00	82·21
1.705	141	63.35	77:60	1·323	106 ·31	82·90
1.710	142	63.70	78:04	1·334	106 ·62	83·60
1.715	143	64.07	78:48	1·346	106 ·94	84·29
1.720	144	64.43	78:92	1·357	107 ·25	84·99
1.725	145	64.78	79:36	1·369	107 ·56	85·69
1.730	146	65.14	79:80	1.381	107.87	86•38
1.735	147	65.50	80:24	1.392	108.18	87•08
1.740	148	65.86	80:68	1.404	108.49	87•77
1.745	149	66.22	81:12	1.416	108.80	88•47
1.750	150	66.58	81:56	1.427	109.12	89•17
1.755	151	66.94	82.00	1·439	109·43	89.86
1.760	152	67.30	82.44	1·451	109·74	90.56
1.765	153	67.76	83.01	1·465	110·05	91.45
1.770	154	68.17	83.41	1·478	110·36	92.26
1.775	155	68.60	84.02	1·491	110·68	93.07
1.780	156	68.98	84.50	1.504	110·99	93·81
1.785	157	69.47	85.10	1.519	111·30	94·74
1.790	158	69.96	85.70	1.534	111·61	95·67
1.795	159	70.45	86.30	1.549	111·92	96·60
1.800	160	70.96	86.92	1.565	112·23	97·69
1·805	161	71.50	87.60	1.581	112·67	98·69
1·810	162	72.08	88.30	1.598	112·98	99·75
1·815	163	72.69	89.05	1.621	113·29	101·19

SULPHURIC ACID MANUFACTURE

SPECIFIC GRAVITY OF SULPHURIC ACID—Continued.

			by weight tain	Kilo per		oot of Acid
Specific Gravity.	Degrees Twaddell.	8O ₃ .	H ₂ SO ₄ .	litre. H ₂ SO ₄ .	Weighs lbs. avoir.	Contains lbs. avoir. H ₂ SO ₄ .
1.820 1.821 1.822 1.823 1.824	164 	73·51 73·63 73·80 73·96 74·12	90.05 90.20 90.40 90.60 90.80	1.639 1.643 1.647 1.651 1.656	113.61 113.67 113.73 113.80 113.85	102·31 102·56 102·89 103·06 103·38
1.825 1.826 1.827 1.828 1.829	165 	74·29 74·49 74·69 74·86 75·03	91.00 91.25 91.50 91.70 91.90	1.661 1.666 1.671 1.676 1.681	113·92 113·99 114·04 114·11 114·19	103.68 104.00 104.31 104.62 104.93
1.830 1.831 1.832 1.833 1.834	166 	75·19 75·46 75·69 75·89 76·12	92·10 92·43 92·70 92·97 93·25	1.685 1.692 1.698 1.704 1.710	114·23 114·30 114·36 114·42 114·47	105·18 105·62 105·99 106·38 106·74
1.835 1.836 1.837 1.838 1.839	167	76·35 76·57 76·90 77·23 77·55	93.56 93.80 94.20 94.60 95.00	1.717 1.722 1.730 1.739 1.748	114·54 114·61 114·67 114·73 114·80	107:43 107:49 107:99 108:55 109:12
1.840 1.8405 1.8410 1.8415 1.8410	168	78.04 78.33 78.69 79.47 80.16	95.60 95.95 96.30 97.35 98.20	1.759 1.765 1.784 1.792 1.808	114·86 114·89 114·92 114·95 114·92	109:80 110:18 110:73 111:86 112:86
1.8405 1.8400 1.8395 1.8390 1.8385		80.43 80.59 80.63 80.93 81.08	98.52 98.72 98.77 99.12 99.31	1·814 1·816 1·817 1·823 1·826	114.89 114.86 114.83 114.80 114.76	113·23 113·36 113·48 113·80 113·98

2. TABLE FOR REDUCING THE SPECIFIC GRAVITIES OF SULPHURIC ACID OF VARIOUS STRENGTHS TO ANY OTHER TEMPERATURE (DEGREES C.).

0°.	5°.	10°.	15°.	20°.	25°.	30°.	35°.	40°.	45°.	50°.
1·857	1.852	1.846	1.840	1.835	1.830	1.825	1·821	1.816	1.811	1·806
1·847	1.841	1.836	1.830	1.825	1.820	1.815	1·810	1.805	1.800	1·795
1·837	1.831	1.825	1.820	1.815	1.809	1.804	1·799	1.794	1.789	1·784
1·827	1.821	1.815	1.810	1.805	1.799	1.793	1·788	1.783	1.778	1·778
1·817	1.811	1.805	1.800	1.794	1.788	1.783	1·777	1.772	1.766	1·761
1·807	1.801	1.796	1.790	1.784	1.778	1.778	1.767	1.762	1.756	1·751
1·797	1.791	1.786	1.730	1.774	1.763	1.763	1.767	1.752	1.746	1·741
1·786	1.781	1.776	1.770	1.765	1.759	1.754	1.748	1.743	1.787	1·782
1·776	1.770	1.765	1.760	1.755	1.749	1.744	1.738	1.733	1.728	1·723
1·765	1.760	1.755	1.750	1.745	1.740	1.735	1.730	1.725	1.720	1·715
1.754	1.760	1.745	1.740	1.785	1.730	1.728	1.721	1.716	1.711	1.706
1.744	1.740	1.735	1.730	1.725	1.720	1.716	1.711	1.706	1.701	1.698
1.734	1.730	1.725	1.720	1.715	1.710	1.706	1.701	1.596	1.691	1.686
1.724	1.720	1.715	1.710	1.705	1.700	1.696	1.691	1.686	1.681	1.676
1.714	1.710	1.705	1.700	1.695	1.690	1.685	1.681	1.676	1.671	1.667
1.704	1.700	1.695	1.690	1.635	1.680	1.676	1.671	1.666	1.661	1.656
1.594	1.590	1.685	1.680	1.675	1.670	1.666	1.661	1.656	1.651	1.646
1.584	1.680	1.675	1.670	1.665	1.660	1.656	1.651	1.646	1.641	1.637
1.674	1.670	1.665	1.660	1.655	1.650	1.646	1.641	1.636	1.682	1.628
1.564	1.660	1.655	1.650	1.645	1.640	1.636	1.632	1.627	1.622	1.618
1.654	1.650	1.645	1.640	1.635	1.631	1.626	1.622	1.617	1.612	1.608
1.644	1.640	1.635	1.680	1.625	1.621	1.616	1.612	1.607	1.602	1.598
1.634	1.630	1.625	1.620	1.615	1.611	1.606	1.602	1.597	1.592	1.538
1.624	1.620	1.515	1.610	1.605	1.501	1.596	1.592	1.587	1.582	1.578
1.614	1.610	1.605	1.600	1.595	1.591	1.536	1.582	1.577	1.572	1.568
1.604	1.600	1.595	1.590	1.585	1.581	1.576	1.572	1.557	1.562	1.558
1.594	1.589	1.584	1.580	1.576	1.570	1.566	1.562	1.558	1.558	1.648
1.584	1.579	1.574	1.570	1.566	1.561	1.556	1.552	1.548	1.543	1.599
1.574	1.569	1.564	1.560	1.658	1.552	1.547	1.543	1.539	1.584	1.590
1.583	1.558	1.554	1.550	1.546	1.542	1.588	1.594	1.530	1.525	1.521
1.552	1.548	1.544	1.540	1.586	1.582	1.628	1.524	1.520	1.516	1·512
1.542	1.588	1.534	1.680	1.526	1.522	1.518	1.514	1.510	1.608	1·502
1.532	1.528	1.524	1.520	1.616	1.512	1.508	1.504	1.500	1.497	1·492
1.522	1.518	1.514	1.510	1.506	1.502	1.498	1.494	1.490	1.488	1·482
1.512	1.508	1.604	1.500	1.498	1.492	1.488	1.484	1.480	1.476	1·472
1.502	1·498	1·494	1·490	1·486	1·482	1.478	1·474	1·470	1·456	1·452
1.492	1·488	1·484	1·480	1·476	1·472	1.468	1·455	1·461	1·467	1·458
1.482	1·478	1·474	1·470	1·466	1·462	1.458	1·455	1·451	1·447	1·443
1.472	1·468	1·464	1·460	1·456	1·452	1.448	1·445	1·442	1·488	1·484
1.462	1·458	1·454	1·450	1·446	1·442	1.438	1·435	1·432	1·429	1·425
1·452	1·448	1:444	1·440	1·498	1·432	1·429	1:425	1·423	1·420	1:416
1·442	1·438	1:434	1·490	1·426	1·422	1·419	1:416	1·413	1·409	1:405
1·432	1·428	1:424	1·420	1·415	1·413	1·410	1:406	1·402	1·398	1:394
1·422	1·418	1:414	1·410	1·406	1·403	1·809	1:896	1·892	1·388	1:884
1·412	1·408	1:404	1·400	1·396	1·398	1·389	1:886	1·882	1·378	1:874
1·402	1·398	1·394	1·390	1.886	1.883	1.879	1.872	1·872	1.868	1·364
1·392	1·888	1·884	1·380	1.876	1.378	1.370	1.862	1·862	1.859	1·865
1·382	1·378	1·874	1·870	1.868	1.368	1.860	1.852	1·852	1.849	1·346
1·872	1·368	1·864	1·860	1.856	1.858	1.860	1.344	1·844	1.840	1·886
1·362	1·858	1·354	1·350	1.846	1.343	1.840	1.334	1·394	1.830	1·326

TABLE 2—Continued.

60°.	86°.	70°.	75°.	80°.	85°.	90°.	95° .	100°.
1.798	1.792	1.787	1.782	1.778	1·774	1.770	1.766	1.762
1.787	1.781	1.776	1.770	1.766	1·762	1.767	1.762	1.748
1.774	1.769	1.784	1.759	1.754	1·749	1.744	1.789	1.734
1.762	1.757	1.752	1.747	1.741	1·736	1.781	1.726	1.721
1.760	1.744	1.789	1.784	1.729	1·724	1.719	1.714	1.708
1·741	1.785	1.780	1.726	1.720	1.715	1.710	1.705	1.700
1·731	1.726	1.721	1.716	1.712	1.707	1.702	1.697	1.692
1·722	1.717	1.712	1.707	1.702	1.697	1.693	1.688	1.688
1·718	1.708	1.703	1.698	1.693	1.688	1.684	1.679	1.674
1·705	1.700	1.695	1.699	1.685	1.681	1.678	1.671	1.667
1.697	1.692	1.688	1.688	1.678	1.674	1.669	1.664	1.660
1.687	1.688	1.678	1.678	1.668	1.664	1.659	1.654	1.650
1.677	1.678	1.668	1.668	1.659	1.654	1.649	1.644	1.640
1.667	1.663	1.658	1.658	1.649	1.644	1.639	1.685	1.630
1.657	1.653	1.648	1.644	1.689	1.634	1.630	1.625	1.620
1.647	1.642	1.688	1.634	1.630	1.625	1.620	1.615	1.610
1.637	1.632	1.628	1.624	1.620	1.616	1.611	1.606	1.602
1.628	1.623	1.619	1.815	1.611	1.606	1.602	1.597	1.598
1.619	1.614	1.610	1.606	1.602	1.597	1.598	1.588	1.584
1.610	1.605	1.600	1.596	1.592	1.688	1.593	1.579	1.676
1.500	1.595	1·591	1.586	1.582	1.578	1.574	1·570	1.565
1.590	1.585	1·581	1.577	1.573	1.569	1.565	1·561	1.566
1.580	1.676	1·572	1.668	1.564	1.560	1.556	1·552	1.547
1.670	1.566	1·562	1.558	1.554	1.650	1.546	1·542	1.587
1.560	1.556	1·552	1.648	1.544	1.540	1.536	1·631	1.527
1.550	1.545	1.541	1.537	1.588	1.629	1·525	1.521	1·516
1.589	1.535	1.531	1.527	1.528	1.519	1·515	1.510	1·606
1.531	1.526	1.522	1.518	1.518	1.509	1·505	1.501	1·496
1.522	1.517	1.513	1.509	1.604	1.500	1·496	1.492	1·487
1.518	1.509	1.504	1.500	1.495	1.491	1·487	1.483	1·478
1.604	1.500	1.496	1•491	1·486	1·482	1·478	1.478	1·469
1.494	1.490	1.485	1•481	1·476	1·472	1·468	1.463	1·459
1.484	1.480	1.476	1•472	1·467	1·452	1·458	1.458	1·449
1.474	1.470	1.466	1•482	1·457	1·452	1·448	1.443	1·438
1.484	1.460	1.465	1•461	1·446	1·442	1·438	1.438	1·428
1·454	1.450	1·442	1.441	1.437	1·433	1·429	1·424	1·419
1·445	1.441	1·436	1.482	1.428	1·424	1·419	1·414	1·410
1·485	1.431	1·427	1.423	1.418	1·414	1·409	1·405	1·401
1·426	1.422	1·418	1.418	1.409	1·405	1·400	1·396	1·392
1·417	1.418	1·469	1.404	1.400	1·396	1·391	1·387	1·383
1.407	1·403	1.899	1.395	1.891	1.356	1·382	1.378	1:374
1.307	1·393	1.889	1.386	1.880	1.376	1·372	1.868	1:364
1.386	1·382	1.378	1.374	1.370	1.366	1·362	1.358	1:358
1.676	1·372	1.868	1.364	1.860	1.356	1·352	1.348	1:348
1.368	1·362	1.358	1.354	1.860	1.346	1·342	1.338	1:338
1.856 1.846 1.887 1.627 1.817	1·352 1·342 1·834 1·328 1·814	1.848 1.338 1.829 1.819 1.810	::		::	:: :: ::		
	1.798 1.787 1.777 1.762 1.760 1.741 1.781 1.792 1.705 1.697 1.667 1.657 1.667 1.657 1.687 1.688 1.610 1.500 1.550 1.550 1.550 1.550 1.550 1.550 1.550 1.550 1.550 1.510 1.504 1.414 1.445 1.484 1.474 1.484 1.484 1.474 1.485 1.485 1.4876 1.497 1.886 1.417 1.407 1.886 1.976 1.866	1.798 1.792 1.787 1.787 1.787 1.787 1.787 1.787 1.787 1.787 1.787 1.787 1.781 1.792 1.791 1.792 1.792 1.792 1.792 1.792 1.792 1.793 1.790 1.687 1.688 1.687 1.688 1.687 1.683 1.687 1.683 1.693	1.798 1.792 1.787 1.787 1.781 1.776 1.774 1.769 1.784 1.762 1.765 1.762 1.760 1.744 1.789 1.741 1.785 1.780 1.741 1.785 1.780 1.741 1.785 1.780 1.741 1.785 1.780 1.781 1.726 1.781 1.781 1.726 1.781 1.782 1.781 1.793 1.793 1.793 1.793 1.697 1.692 1.688 1.687 1.688 1.688 1.687 1.688 1.688 1.687 1.688 1.688 1.687 1.683 1.688 1.687 1.683 1.688 1.687 1.683 1.688 1.687 1.683 1.688 1.687 1.683 1.688 1.687 1.88 1.678 1.670 1.683 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.687 1.88 1.688 1.688 1.688 1.687 1.898 1.688 1.688 1.698 1.698 1.698 1.698 1.698 1.698 1.599 1.590 1.595 1.590 1.595 1.590 1.595 1.590 1.595 1.590 1.595 1.591 1.580 1.590 1.595 1.591 1.592 1.590 1.595 1.591 1.592 1.590 1.595 1.591 1.593 1.590 1.595 1.591 1.592 1.590 1.595 1.591 1.592 1.590 1.595 1.591 1.592 1.590 1.591 1.590 1.595 1.591 1.592 1.591 1.592 1.591 1.592 1.591 1.593 1.592 1.592 1.591 1.491 1.494 1.490 1.485 1.435 1.431 1.477 1.443 1.440 1.445 1.441 1.436 1.445 1.441 1.436 1.447 1.443 1.449 1.448 1.449 1.448 1.449 1.449 1.491 1.493 1.499 1.497 1.403 1.899 1.893 1.893 1.893 1.896 1.892 1.388 1.896 1.892 1.388 1.897 1.894 1.893 1.897 1.894 1.893	1.798 1.792 1.787 1.782 1.787 1.781 1.776 1.776 1.774 1.769 1.764 1.759 1.762 1.767 1.762 1.747 1.760 1.744 1.759 1.784 1.741 1.785 1.780 1.784 1.741 1.785 1.780 1.784 1.741 1.785 1.780 1.721 1.712 1.712 1.712 1.713 1.703 1.698 1.705 1.700 1.695 1.699 1.697 1.692 1.688 1.688 1.687 1.688 1.678 1.678 1.687 1.688 1.688 1.678 1.687 1.688 1.688 1.688 1.687 1.683 1.688 1.687 1.683 1.688 1.687 1.683 1.688 1.687 1.683 1.688 1.687 1.688 1.688 1.687 1.688 1.688 1.697 1.692 1.688 1.698 1.697 1.692 1.688 1.698 1.697 1.692 1.688 1.698 1.697 1.698 1.698 1.697 1.698 1.698 1.697 1.698 1.698 1.697 1.698 1.698 1.698 1.698 1.698 1.698 1.698 1.698 1.698 1.698 1.698 1.698 1.698 1.698 1.699 1.691 1.690 1.690 1.596 1.590 1.595 1.591 1.596 1.590 1.595 1.591 1.597 1.580 1.556 1.562 1.568 1.590 1.556 1.552 1.648 1.550 1.556 1.552 1.548 1.550 1.556 1.552 1.581 1.527 1.530 1.528 1.530 1.538 1.537 1.530 1.538 1.597 1.530 1.545 1.541 1.537 1.530 1.556 1.552 1.548 1.544 1.480 1.446 1.441 1.444 1.490 1.485 1.481 1.445 1.441 1.436 1.442 1.445 1.441 1.436 1.442 1.445 1.441 1.436 1.442 1.445 1.441 1.436 1.442 1.445 1.441 1.436 1.442 1.441 1.438 1.499 1.404 1.407 1.408 1.899 1.395 1.386 1.382 1.378 1.384 1.387 1.384 1.383 1.384 1.387 1.384 1.383 1.384 1.387 1.384 1.383 1.384 1.387 1.384 1.389 1.386 1.387 1.384 1.389 1.386 1.387 1.384 1.389 1.386 1.387 1.384 1.389 1.381 1.397 1.388 1.389 1.385 1.387 1.384 1.389 1.385 1.387 1.384 1.389 1.385 1.387 1.384 1.389 1.385 1.387 1.384 1.389 1.385	1.798	1.798	1.798	1.798

TABLE 2-Continued.

0%	5°.	10°.	15°.	20°.	25°.	30°	35°.	40°	45°•	50°.
1·352	1:348	1:344	1:340	1.336	1:333	1.330	1·327	1·324	1.820	1·316
1·341	1:337	1:333	1:330	1.327	1:324	1.321	1·318	1·314	1.310	1·308
1·330	1:326	1:323	1:320	1.317	1:314	1.311	1·308	1·304	1.801	1·297
1·320	1:316	1:313	1:310	1.307	1:804	1.301	1·298	1·294	1.291	1·287
1·310	1:306*	1:303	1:300	1.297	1:294	1.291	1·288	1·284	1.281	1·277
1·300	1·296	1·293	1·290	1:237	1·234	1·280	1·277	1·274	1·270	1·287
1·290	1·236	1·253	1·280	1:277	1·274	1·270	1·267	1·264	1·260	1·256
1·280	1·276	1·273	1·270	1:267	1·264	1·260	1·257	1·254	1·250	1·246
1·270	1·266	1·263	1·260	1:257	1·254	1·251	1·248	1·245	1·241	1·237
1·260	1·256	1·253	1·250	1:247	1·244	1·241	1·238	1·235	1·231	1·227
1·250	1·246	1.243	1·240	1·237	1.234	1.230	1·227	1·224	1·220	1·217
1·240	1·236	1.233	1·230	1·227	1.224	1.220	1·217	1·214	1·210	1·207
1·230	1·226	1.223	1·220	1·217	1.214	1.210	1·207	1·204	1·200	1·197
1·220	1·216	1.213	1·210	1·206	1.204	1.200	1·197	1·194	1·190	1·187
1·210	1·206	1.203	1·200	1·196	1.193	1.190	1·186	1·183	1·180	1·176
1-200	1·198	1·193	1·190	1·186	1·183	1·180	1·176	1·173	1·169	1·165
1-190	1·188	1·183	1·180	1·176	1·173	1·170	1·166	1·163	1·159	1·155
1-180	1·176	1·173	1·170	1·166	1·163	1·160	1·156	1·153	1·149	1·148
1-169	1·168	1·163	1·160	1·157	1·153	1·150	1·147	1·144	1·141	1·138
1-159	1·156	1·153	1·150	1·147	1·143	1·140	1·137	1·134	1·131	1·128
1·149	1·146	1·143	1·140	1·137	1·134	1·131	1·128	1·125	1·122	1·119
1·138	1·135	1·133	1·130	1·127	1·125	1·122	1·119	1·116	1·113	1·110
1·128	1·125	1·128	1·120	1·118	1·115	1·112	1·110	1·107	1·104	1·102
1·118	1·115	1·113	1·110	1·108	1·105	1·102	1·100	1·097	1·094	1·092
1·103	1·105	1·103	1·100	1·097	1·094	1·092	1·090	1·087	1·084	1·082
1.093	1·095	1.093	1.090	1.087	1.084	1.082	1.080	1.077	1.074	1.072
1.088	1·085	1.088	1.080	1.077	1.074	1.072	1.070	1.067	1.064	1.062
1.078	1·075	1.073	1.070	1.067	1.064	1.062	1.060	1.057	1.054	1.052
1.068	1·065	1.063	1.060	1.057	1.054	1.052	1.050	1.048	1.044	1.042
1.058	1·055	1.053	1.050	1.047	1.044	1.042	1.040	1.038	1.084	1.032
1 048	1.045	1·043	1.040	1.037	1:034	1.032	1.030	1.028	1:024	1.022
1 038	1.085	1·033	1.030	1.027	1:024	1.022	1.020	1.018	1:014	1.012
1 028	1.025	1·023	1.020	1.017	1:014	1.012	1.010	1.008	1:004	1.002
1 018	1.015	1·018	1.010	1.007	1:004	1.002	1.000	0.998	0:994	0.992

TABLE 2-Continued.

55°.	60°.	65°.	70°.	75°.	80°.	85°.	90°.	95° .	100°
1.812	1.308	1.304	1.300						
1.802	1.298	1.294	1.290	••		· •• i		••	1
1·293 1·233	1·289 1·279	1·284 1·274	1·280 1·270		••			••	
1.273	1.269	1.265	1.260	•	::		::	::	::
1.263	1.259	1.255	1.250						
1·252 1·242	1·243 1·238	1·244 1·234	1.240 1.230	•				• • •	
1.533	1.224	1.224	1.220			••		••	٠٠.
1.223	1.214	1.214	1.210	::	::	::			::
1.210	1.209	1.204	1.200						٠
1.204	1.200	1.195	1 190	••	•••				
1·194 1·183	1·190 1·179	1·185 1·175	1·180 1·170		•••			••	
1.172	1.168	1.164	1.150	.:	::	•	.:		
1.162	1.158	1.154	1.150		l				
1.152	1.148	1.144	1.140	••					
1·148 1·1 8 5	1.139	1·135 1·127	1·131 1·128	••		••		••	
1·125	1.122	1.118	1.114	•	::	::	::	••	::
1.116	1.113	1.109	1.106		l l				
1.107	1.104	1.100	1.097						٠.
1.099	1.096	1.092	1.088					••	
1·089 1·079	1.086 1.075	1.082 1.072	1.078 1.068					••	
				•			••	••	
1.069	1.065	1.062	1.058]	••	
1.059	1.055	1.052	1.048		.		- • •	••	
1·049 1·036	1.045 1.085	1.042	1.028	••		•		••	
1.039	1.025	1-022	1.018		:		::	••	
1.019 -	1.015	1.012	1.008						
1.009	1.005	1.002	0.998		. 1			••	٠٠.
0.999	0.995	0.992	0.988		•••			•	••
0.988	0.985	0.982	0.978		1			••	

8. SPECIFIC GRAVITIES OF COMMERCIAL (NORDHAUSEN) OIL OF VITRIOL.

(Messel, Journ. Soc. Chem. Ind., 1885, p. 573.)

						Percentage	Specific	Gravity
!	Specia	mens.			of SO ₃ .	At 80° F. = 26.6° C.	At 60° F. = 15.5° C.	
	T.,					8.3	1.842	1.852
Liguid .						30.0	1.930	1.940
Crystalline m	ass,	rese	mblin	g niti	re.	40.0	1.956	1.970
Do.			do.			44.5	1.961	1.975
Do.			do.			46.2	1.963	1.977
•						59.4	1.980	1.994
Liquid .						60.8	1.992	2.006
Do						65.0	1.992	2.006
Do						69.4	2.002	2.016
Crystallised						72.8	1.984	1.988
$\mathbf{D_{0}}$.						80.0	1.959	1.973
Do.						82.0	1 .953	1.967

4. SPECIFIC GRAVITIES AND PERCENTAGE OF FUMING (NORDHAUSEN) OIL OF VITRIOL AT DIFFERENT TEMPERATURES.

		Density at			803
15°.	20°.	25°.	80°.	85°.	Per Cent
1.8417	1.8371	1.8323	1.8287	1.8240	76.67
1.8427	1.8378	1.8333	1.8295	1.8249	77:49
1.8428	1.8388	1.8351	1.8302	1.8255	78.34
1.8437	1.8390	1.8346	1.8300	1.8257	79.04
1.8427	1.8386	1.8351	1.8297	1.8250	79.99
1.8420	1.8372	1.8326	1.8281	1.8234	80.46
1:8398	1.8350	1.8305	1.8263	1.8218	80.94
1.8446	1.8400	1.8353	1.8307	1.8262	81.37
1.8509	1.8466	1 8418	1.8371	1.8324	81.91
1.8571	1.8522	1.8476	1.8432	1.8385	82.17
1.8697	1.8647	1.8595	1.8545	1.8498	82.94
1.8790	1.8742	1.8687	1.8640	1.8592	83 25
1 •8875	1.8823	1.8767	1 8713	1.8661	83.84
1.8942	1.8888	1.8833	1.8775	1.8722	84.12
1.8990	1.8940	1.8890	1.8830	1.8772	84.33
1 9034	1 8984	1.8930	1.8874	1.8820	84.67
1.9072	1.9021	1 .8950	1.8900	1.8845	84.82
1.9095	1.9042	1.8986	1.8932	1.8866	84.99
1.9121	1.9053	1.8993	1.8948	1.8892	85.14
1.9250	1.9193	1.9135	1.9082	1.9023	85.24
1.9290	1.9236	1.9183	1.9129	1 9073	85.68
1.9368	1.9310	1.9250	1.9187	1.9122	85.88
1.9447	1.9392	1 9334	1.9279	1.9222	86.51
1.9520	1.9465	1.9402	1.9338	1.9278	86.72
1.9584	1.9528	1.9466	1.9406	1.9340	87.03
1.9632	1.9573	1.9518	1.9457	1.9398	87.46
cryst.	cryst.	1.9740	1.9666	1.9740	88.00

The above table is only intended for control in works, but not for commercial purposes, because the specific gravity is anything but a certain guide for the percentage of Nordhausen acid, and altogether fails as such, for strengths just below the monohydrate. The table was not made for chemically pure acids, but for commercial acid.

5. FREEZING AND MELTING POINTS OF SULPHURIC ACID.*

Specific Gravity at 15°.	Freezing Point.	Melting Point.
1.671 1.691	Liquid at -20° Liquid at -20°	•••
1·712 1·727	Liquid at -20° -7.5°	 - 7 · 5°
1·732 1·749	-8.5° -0.2°	- 8·5° + 4·5°
1·767 1·778	+1.6° +8.5°	+ 6.5° + 8.5°
1.790 1.807 1.822	+4.5° -9.0°	+ 8.0° - 6.0°
1.822	Liquid at -20° Liquid at -20°	

^{*} Lunge, Berichte d. deutsch. chem. Ges., 1881, s. 2649.

6. BOILING POINTS OF SULPHURIC ACID.

(Lunge, Ber. d. d. chem. Ges., 11, 370.)

Per Cent. SO ₄ H ₂ .	Specific Gravity.	Boiling Point.	Per Cent. SO ₄ H ₂ .	Specific Gravity.	Boiling Point.	Per Cent. SO ₄ H ₂ .	Specific Gravity.	Boiling Point.
		Degrees.			Degrees.			Degrees.
5	1.031	101	56	1.459	133	82	1.758	218.5
10	1.069	102	60	1.503	141.5	84	1.773	227
15	1.107	103.5	62.5	1.530	147	86	1.791	238.5
20	1.147	105	65	1.557	153.5	88	1.807	251.5
25	1.184	106.5	67.5	1.585	161	90	1.818	262.5
30	1.224	108	70	1.615	170	91	1.824	268
35	1.265	110	72	1.639	174.5	92	1.830	274.5
40	1.307	114	74	1.661	180.5	93	1.834	281.5
45	1.352	118.5	76	1.688	189	94	1.837	288.5
50	1.399	124	78	1.710	199	95	1.840	295
53	1.428	128.5	80	1.733	207			1
			<u> </u>					

Monohydrate (100 per cent.) boils at 338° (Marignac).

7. FUSING POINTS* OF SULPHURIC ACID AND OF NORDHAUSEN OIL OF VITRIOL. (KNIETSCH.)

Percentage of SO ₃ (as H ₂ sO ₄). Per cent. 1 SO ₃ - 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 be 66 66 66 66 + 67 66° + 67 66° + 67 66° + 67 66° + 67 66° + 67 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° + 68° 66° 66° + 68° 68° 66°

^{* &}quot;Fusing Point" is understood to be the temperature to which the mercury of the thermometer, dipping into the colidifying liquid, rises and at which it remaine constant. It should be noticed that large quantities of Nordhausen oil of vitriol, euch as exist in transportation vessels, frequently do not hehave in accord with the above data, because during the carriage and storage a separation often takes place in the acid, crystale of a different concentration being formed, which of course possess a

correspondingly different fusing point.

The figures in parentheses signify the fusing points of freshly made Nordhausen oll of vitriol, which has not polymerised.

8. PERCENTAGE OF \mathbf{SO}_3 IN NORDHAUSEN OIL OF VITRIOL. (GNEHM.)

Found by Titrating.	Contair cen		Found by Titrating.	Contain cen		Found by Titrating.	Contair cen	s per t.
SO ₃ .	SO_4H_2 .	SO ₃ .	SO3.	SO ₄ H ₂ .	SO ₃ .	SO3.	SO ₄ H ₂ .	SO3.
81.6326	100	0	87.8775	66	34	93-9387	33	67
81.8163	99	1	88.0612	65	35	94.1224	32	68
82.0000	98	2	88.2448	64	36	94.3061	31	69
82.1836	97	3	88.4285	63	37	94.4897	30	70
82:3674	96	4	88.6122	62	38	94.6734	29	71
82.5510	95	5	88-7959	61	39	94.8571	28	72
82.7346	94	6	88.9795	60	40	95.0408	27	73
82.9183	93	7	89.1632	59	41	95.2244	26	74
83 1020	92	8	89:3469	58	42	95.4081	25	
83.2857	91	9	89.5306	57	43	95.5918	24	
83.4693	90	10	89.7142	56	44	95.7755	23	
83.6530	89	11	89-8979	55	45	95 9591	22	
83 8367	88	12	90.0816	54	46	96.1428	21	
84.0204	87	13	90.2653	53	47	96 3265	20	
84.2040	86	14	90.4489	52	48	96.5102	19	
84.3877	85	15	90.6326	51	49	96.6938	18	
84.5714	84	16	90.8163	50	50	96 8775	17	
84.7551	83	17	91.0000	49	51	97.0612	16	
84.9387	82	18	91.1836	48	52	97 2448	15	
85.1224	81	19	91.3673	47	53	97.4285	14	
85.3061	80	20	91.5510	46	54	97.6122	13	
85 4897	79	21	91.7346	45	55	97 7959	12	
85.6734	78	22	91.9183	44	56	97.9795	11	
85.8571	77	23	92.1020	43	57	98.1632	10	
86.0408	76	24	92.2857	42	58	98.3469	9	
86.2244	75	25	92.4093	41	59	98.5306	8	
86.4081	74	26	92.6530	40	60	98.7142	7	
86 5918	73	27	92.8367	39	61	98.8979	6	• • • •
86.7755	72	28	93-0204	38	62	99 0816	5	
86.9591	71	29	93.2040	37	63	99.2653	4	•••
87.1428	70	30	93:3877	36	64	99.4489	ខ	
87.3265	69	-31	93.5714	35	65	99•6326	2	
87.5102	68	32	93.7551	34	66	99-8163	1	1.00
87.6938	67	33						
01 0990	07	99						

The Quantitative Examination of Free Sulphuric Acid.

The quantitative examination of free sulphuric acid is made by titrating a weighed quantity. It is not sufficiently accurate to measure the acid by a pipette, etc., especially in the case of concentrated acid. The titration is performed by means of standard sodium hydroxide solution, and the results are

expressed in terms of H2SO4.

Weigh from 2 to 3 g. acid in a glass-tap pipette (Fig. 12, p. 145), after cleaning the latter on the outside; run its contents into at least 100 c.c. water, and weigh the pipette again, without washing it out. This enables another pipette full of acid to be taken and tested, without washing and drying the instrument, and so forth. The same procedure is also very well adapted for slightly fuming mixtures of sulphuric and nitric acid, and for Nordhausen oil of vitriol (cf. p. 145).

The standard sodium hydroxide solution is "normal," *i.e.* containing 0.04001 NaOH g. per litre. It is controlled by means of standard hydrochloric acid (0.03647 g. HCl per litre), the strength of which has been fixed by pure sodium carbonate. The method

is described in detail in the Appendix.

As indicator, methyl orange is used always in the cold, and so much only is taken that the colour produced is just visible. Nitrous acid destroys this colouring matter, but ordinary commercial acid never contains sufficient to cause any trouble, and even "nitrous vitriol" or fuming nitric acid can be treated with methyl orange, if the indicator is added (or renewed) shortly before the last quantity of alkali has been added; or else an excess of alkali is added, then methyl orange, and titrated back. Nitrous acid behaves towards methyl orange like the strong mineral acids; that is, the change of colour takes place when the compound NaNO₂ has been formed.

Examination of Sulphuric Acid for other Substances.

(a) Nitrous Acid (Nitrososulphuric Acid) is titrated with seminormal permanganate. (Preparation in the Appendix.) This can be done without loss of NO by manipulating as follows (Lunge, Berliner Berichte, x., 1075):—Put the uitrous vitroin into a burette fitted with a glass tap, run it slowly into a measured quantity of permanganate, diluted with five times its volume of tepid water (30° C. to 40° C.), and agitate continuously

till the colour just vanishes. Sometimes during this process a little manganese dioxide is separated, which makes it difficult to recognise the end of the reaction, but this is avoided by keeping

TABLE FOR ESTIMATING NITROUS VITRIOL.

Employ 50 c.c. of seminormal permanganate. The results are expressed as NO_3H and NO_3Na . The column y refers to acid of 140° Tw. as unit:—

Acid consumed.	МО	зн,	NO3	Na.	Acid consumed.	NO	Э₃Н.	NO	NO3Na.	
y. c.c.	a. g. per litre.	b. per cent.	g. per litre.	b. per cent.	y. c.c.	g. per litre.	b. per cent.	a. g. per litre.	b. per cent.	
10 11 12 13 14 15 16 17 18 19 20 21 22 23	78·75 71·59 65·63 60·58 56·25 52·50 49·22 46·32 43·75 41·45 39·38 37·50 35·80 34·24	4·61 4·19 3·84 3·54 3·29 2·88 2·71 2·56 2·42 2·30 2·92 2·09	106·29 96·63 88·58 81·76 .75·92 70·86 66·43 62·52 55·95 53·15 50·61 48·32 46·21	6·22 5·65 5·18 4·78 4·44 3·88 3·65 3·45 3·27 3·11 2·83 2·70	36 37 38 39 40 41 42 43 44 45 46 47 48	21·88 21·28 20·72 20·19 19·69 19·21 18·75 18·27 17·90 17·76 17·12 16·47 16·41	1·28. 1·24 1·21 1·15 1·12 1·10 1·07 1·05 1·02 1·00 0·978 0·960 0·938	29·53 28·72 27·97 27·25 26·53 25·83 25·83 24·66 24·16 23·57 23·51 22·57 22·15	1.73 1.68 1.64 1.55 1.55 1.51 1.48 1.44 1.41 1.35 1.35 1.30 1.27	
24 25 26 27 28 29 30 31 32 33 34 35	32·81 30·29 29·17 28·13 27·16 26·25 25·40 24·61 23·86 23·16 22·50	1·92 1·84 1·77 1·71 1·65 1·59 1·54 1·49 1·44 1·40 1·35 1·32	44·28 42·52 40·88 39·37 37·97 36·66 35·43 34·28 33·22 32·20 31·26 30·37	2·59 2·49 2·39 2·30 2·22 2·14 2·07 2·00 1·94 1·88 1·88 1·78	50 55 60* 65 70 75 80 85 90 95	15·75 14·32 13·13 12·12 11·25 10·50 9·85 9·26 8·73 8·29 7·88	0·921 0·837 0·768 0·709 0·658 0·614 0·576 0·542 0·511 0·485 0·461	21:26 19:33 17:72 16:36 15:18 14:17 13:29 12:50 11:78 11:19 10:64	1.24 1.13 1.04 0.957 0.888 0.829 0.777 0.731 0.689 0.654 0.622	

N.B.—The figures in column α also indicate 0.01 lb. avoirdupois per gallon, or nearly ounces per cubic foot.

the temperature not above 40° and by diluting the permanganate, say to 200 c.c. (The same method holds good for the analysis of sodium nitrite, but in this case the permanganate solution must be previously acidulated to such an extent that the NaNO₂ solution

is immediately decomposed when run into the permanganate.) Each cubic centimetre of the permanganate indicates 0.009502 g. N_2O_3 , hence more or less of it is employed, according as to whether an acid containing more or less N_2O_3 is titrated. For chamber acid, employ at most 5 c.c.; for good Gay-Lussac acid, up to 50 c.c. of permanganate. If the quantity of permanganate is called x, and that of the vitriol consumed for decolorising it y, the quantity of N_2O_3 present in grams per litre of acid is:—

Calculated as
$$NO_3H = \frac{9\cdot502x}{y}$$
as $NaNO_3 = \frac{21\cdot253x}{y}$

The preceding table, p. 136, saves the calculation for all cases in which x=50. The column y gives the number of cubic centimetres of nitrous vitriol used, a the percentage in grams per litre, and b the percentage by weight, for acid of 140° Tw. (For other strengths the percentage by weight is calculated by dividing the figures of column a by 10×specific gravity.)

(b) Total Nitrogen Acids.—These are contained in sulphuric acid as N₂O₃, or more correctly as nitrososulphuric acid, SO₂(OH)(ONO), and NO₃H. NO can be present only in minute quantity, and only in absence of NO₃H. N₂O₄ is decomposed by sulphuric acid into nitrososulphuric and nitric acid. estimation made according to (a) only indicates N_2O_3 . The total nitrogen acids are converted into NO by shaking up the nitrous vitriol with mercury; the quantity of NO formed is estimated by volume (Crum's reaction). This is done by Lunge's Nitrometer, Fig. 9, p. 138. Fill the graduated limb a with mercury by raising the level tube b; put the three-way tap so that it communicates with any of the openings; run the nitrous vitriol into the top cup of a from a 1 c.c. pipette graduated in $\frac{1}{100}$ c.c., employing only 0.5 c.c. of very strong, but up to 5 c.c. of very weak nitrous vitriol; lower the level tube, open the tap carefully so that the vitriol runs in without any air entering; pour 2 or 3 c.c. of pure strong sulphuric acid, free from nitrogen compounds, into the cup; let this acid enter the nitrometer, and repeat the washing of the cup with 1 or 2 c.c. of pure acid. Start the evolution of gas by taking the tube a out of the clamp, inclining it several times till almost horizontal, and suddenly righting it again, so that mercury and acid are well mixed; shake for one or two minutes till no more gas is evolved. Place the tubes so that the mercury in b is as much higher than that in a as is required for balancing

the acid in a; this requires 1 mm. of Hg for $6\frac{1}{2}$ mm. of acid. An exact reading can only be obtained when the gas has attained the temperature of the room and all froth has subsided. Read off the volume of the gas, also a thermometer hung up close by, and the barometer. In order to check the levelling, open the tap, when the level of a should not change. If it rises, the pressure has been in excess, and the reading must be increased a little, say by 0.1 c.c. If it sinks, the reverse is the case, i.e. always in the opposite sense to the change of level. Another plan is, to put a little acid into the cup before opening the tap.



This will be sucked in if the pressure was too low, or raised if too high. With adroit manipulation the reading can then soon be corrected. Finally, lower the graduated tube a, lest any air should enter on opening the tap; open the tap, raise the tube b, force the gas and all acid into the cup, and turn the tap so that the acid flows through into a vessel held below; the last portions are drawn off by blotting-paper. The nitrometer is then ready for the next experiment.

A test must always be made to see whether the glass tap is gas-tight. It will hardly remain so without greasing it occasionally with vaseline, but this ought to be done very slightly, so as

to avoid any grease getting into the hore, for if the grease comes in contact with acid, troublesome froth is formed.*

c.c. NO read off.	a. Absolute weight, mg.	b. Per cent. by weight, when employing 1 c.c. acid of 140° Tw. in the Nitrometer.	
Nitrogen, N ₂		0.6256	0.0366
Nitric oxide, NO		1.3403	0.0784
Nitrogen trioxide, NoO3		1.6974	0.0993
Nitric acid, real, HNO3		2.8143	0.1646
Sodium nitrate, NaNOs		3.7963	0.2221
Potassium nitrate, KNO ₃		4.5176	0.2642

(Multiples of these figures are given in Table 5, p. 15.)

This process is interfered with by the presence of sulphurous acid, the best test for which is the smell. To remove it, the acid is stirred up with a very small quantity of powdered potassium permanganate. Any great excess of this acid makes the process

very troublesome and inaccurate.

In highly concentrated acids a notable quantity (up to 3 per cent. by volume) of NO may be dissolved; therefore a little water must be added to such acids in the nitrometer, sufficient to reduce their strength to about 90 per cent. $H_2\mathrm{SO}_4$. The volume of NO read off is reduced to 0° C. and 760 mm. (32° F. and 29.92 in.) by means of the tables, pages 36 et seq., and calculated for the nitrogen compounds present by the table on this page, in which column a gives milligrams, b per cent. by weight, when employing 1 c.c. acid of 140° Tw.


Nitrometers (and gas-volumeters) should of course be obtained from a reliable dealer, so that the correctness of the graduations

and the tightness of the taps can be depended upon.

The reduction to 0° and 760 mm. can be effected without thermometer and barometer, and without the use of any tables, by means of Lunge's Gas-volumeter, Fig. 10, which serves also for numerous other analytical operations. It consists of the gas-measuring tube A, the reduction tube B, and the level tube C, all connected by thick rubber tubing with the three-way tube a. B and C are held in two arms of the same clamp, so as to be each either individually movable in its own arm, or both together by

^{*} Such froth may also be formed in the presence of too much water, by the separation of mercuric aulphate, but this hardly ever happens in the case of nitrons vitriol, and even in the analysis of sodium nitrate only when the description given for the estimation is not properly adhered to.

means of the common clamp. Tube A may be an ordinary nitrometer with three-way tap and funnel; it is, however, best employed merely as a gas-measuring tube, and for some purposes this tube is made to hold upwards of 100 c.c., in which case the upper portion is in the shape of a bulb, the division beginning below this, say, at 90 or 100 c.c. The most convenient shape, which serves both for small and large quantities of gas, is a tube possessing a bulb in the middle, and graduated above

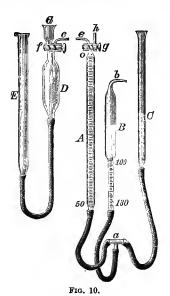

this from 0 (at the tap) to 40 c.c., below the bulb from 100 to 140 c.c. A two-way tap, g, allows communication either with the straight outlet tube h, or with the right-angle tube e.

Instead of carrying out the decomposition in tube A, it is decidedly preferable to employ for this purpose a separate tube, D, provided with a two-way tap, f, a funnel, d, and an outlet tube, c, corresponding to the tube e on A. D has its own level tube E. All these tubes are held in clamps, which can be moved up and down on the two bars of a heavy iron stand.

The "reduction tube" B is enlarged at the top, and the narrow portion below is graduated from 100 to 125 c.c. in 10 c.c. It contains a volume of dry air which at 0°

and 760 mm. pressure would occupy exactly 100 c.c. This is obtained by taking, once for all, a reading of the thermometer and the barometer, and calculating what would be the volume of 100 c.c. of dry air under the prevailing atmospheric conditions. In reading the barometer, a deduction must be made for the expansion of the mercury, viz., 1 mm. between 0° and 12°, 2 mm. between 13° and 19°, 3 mm. between 20° and 25°. For calculating the volume of 100 c.c. air at "normal conditions" from the observed temperature t and the barometric reading b (corrected as above), we have the formula:—

$$\mathbf{V} = \frac{100(273+t)760}{273b}$$

A drop of concentrated sulphuric acid is previously introduced through the open end of b, most conveniently by suction. After setting the level in B to the point indicated by the equation, the capillary end of b is sealed by fusing it up; in order to prevent the heat from expanding the air in B, a cardboard shield is put between the flame and B.

This is avoided by replacing the open capillary tube b by Lunge's "beaker-tap" (Ber., 1892, p. 3157), and still better by Göckel's gas-tap with annular mercury seal (supplied by Dr

H. Göckel, Luisenstrasse 6, Berlin, N.W.).

The "laboratory vessel" or "decomposition tube" D, in which the reaction is carried out, is provided with the fittings of an ordinary nitrometer, viz., the three-way tap f, the cup d, the lateral outlet c, and the special level tube E. It holds about 150 c.c. and is not graduated. Mercury is poured in through E. By raising E, the vessel D is completely filled with mercury, till it begins to run out at c. The tap f is shut, the end of c closed by a glass or rubber cap, and the nitrous vitriol placed in d; this is sucked into D, then some pure acid sucked in, to wash the cup and tap, tap f closed (no bubbles of air must remain below it!). and the decomposition brought about in the usual manner by shaking the vitriol with the mercury, to evolve all the nitrogen acids as NO. The tubes D and A are then brought opposite to each other (A having been previously filled, by raising C, with mercury till it flows out at e); c and e are joined by a short piece of rubber tubing till they touch, so that no air remains in the space between; C is lowered, E raised, and by cautiously opening tap f, the NO contained in D is transferred into A. As soon as all the gas is in A, and the acid following it has filled the narrow tube e, tap g is closed. Now tube C is raised till the mercury in B has risen to the mark 100, and B and C are simultaneously moved up or down, as may be required, till the levels in A and B coincide, that in B being still at 100 c.c. Since the air in B is now compressed to the point which it would occupy in the dry state at 0° and 760 mm., and the gas in A is placed under exactly the same pressure (the temperature of these two parallel tubes being presumably the same), the reading in A gives the volume of NO reduced to the same conditions of 0° and 760 mm. The temperature in A and B must be exactly the same; this ensured by the conductivity of the mercury, but in the case of large quantities of NO it is necessary to wait at least ten minutes

before finally adjusting the levels. If only one gas-volumeter is available, and that is adjusted for moist gases (as is required for other purposes), it may be used also for dry gases, but it is then necessary to avoid any sulphuric acid passing from D into A, and to suck a drop of water into A, before transferring the gas into it from D. Another way for measuring dry gases with a moist reduction tube is as follows: observe the temperature; take the tension of aqueous vapour corresponding to this from the table, p. 52=f, and adjust the mercury in the measuring tube A higher by f mm. than in the reduction tube B, where, as usual, the mercury is adjusted by means of the level tube C to the point marking $100^{\circ}00^{\circ}$ c.c. If, on the other hand, a reduction tube has been prepared for dry gases, by introducing a drop of concentrated acid, it may be used for moist gases (as in the testing of manganese ore, bleaching powder, potassium permanganate, etc.), by adjusting the mercury in A f mm. lower

(c) Relative Proportions of the three Nitrogen Acids.—In order to find from the result of the permanganate titration and from the estimation of total nitrogen in the nitrometer (as NO) the relative proportions of N₂O₃, N₂O₄, and NO₃H in a mixture of all three nitrogen acids absorbed by sulphuric acid, we may employ the following formula:—

```
a = \text{c.c.} NO found in the nitrometer. b = \text{c.c.} O, calculated from the permanganate titration.
```

/1 a a O 14000 -- - 1 a a gardinarial norm

(1 c.c. O=1.4292 mg.; 1 c.c. seminormal permanganate =0.004 g.=2.7975 c.c. oxygen.)

 $x = \text{vols. NO, corresponding to the } N_2O_3 \text{ present.}$

 $y = ,, NO, ,, N_2O_4^{-1}, ,, NO, ,, NO_3H, ,,$

If 4b be > a,

than in B.

x=4b-a; y=2(a-2b), or =a-x.

If 4b be < a,

$$y=4b$$
; $z=a-4b$.

(d) Qualitative Test for Traces of Nitrogen Acids.—These can be detected by means of diphenylamine. Dissolve a few grams of diphenylamine in 100 parts of pure sulphuric acid. This acid

should be completely free from nitrogen oxides, and can be made so, if not at hand, by boiling with a trace of ammonium sulphate. Dilute the acid with $\frac{1}{10}$ th volume of water before dissolving the diphenylamine. This solution may be employed at once, or kept, as it keeps quite well. Pour about 2 c.c. of the vitriol to be tested into a test-tube, and add about 1 c.c. of the diphenylamine solution so that the layers mix only gradually. In the case of dilute acids, or other lighter liquids, proceed in the opposite manner. The slightest traces of nitrogen acids are detected by the appearance of a brilliant blue colour at the area of contact of the liquids.

The smallest traces of nitrous acid are detected, even in the presence of nitric acid, by the reagent proposed by Griess, as modified by Ilosvay and by Lunge. This reagent is prepared by (1) dissolving 0.5 g. sulphanilic acid in 150 c.c. dilute acetic acid; (2) boiling 0.1 g. solid a-naphthylamine with 20 c.c. water, pouring the colourless liquid off from the purple residue, and mixing it with 150 c.c. dilute acetic acid. The two solutions are united, and can thus be kept for an indefinite time in a bottle, well protected against air (which often contains traces of nitrogen acids). Add a few c.c. of this solution to the solution to be tested, and heat to 70° or 80°. If as little as 1 part nitrous acid be present in 1000 million parts of the liquid, a red colour is formed in about one minute. More concentrated solutions of HNO₃, say 1: 1000, do not yield the blue colour, but a yellow solution.

In the presence of selenium the diphenylamine test fails, as Se gives the same reaction as nitrogen acids. In that case test for somewhat large quantities of nitrogen acids by the decoloration of indigo solution; for traces, by the reddening of a solution of

brucine sulphate.

- (e) Selenium in sulphuric acid can be recognised by adding to the acid a strong solution of ferrous sulphate, when a brownish-red precipitate will make its appearance, which cannot be confused with the colour produced by NO, or else by the green colour, produced in a solution of codein.
- (f) Examination for Lead.—Dilute the acid, if concentrated, with an equal volume of water and twice its volume of alcohol. Allow the mixture to stand for some time, filter any precipitate of PbSO₄, wash it with dilute alcohol, and dry and ignite in a porcelain crucible, burning the filter separately. 1 g. PbSO₄=0.6831 g. Pb.
- (g) Examination for Iron.—Boil the acid, if free from nitrogen, with a drop of nitric acid to oxidise the iron. Dilute a little, allow to cool, and add a solution of potassium thiocyanate. A red colour proves the presence of iron. If there is not too little, it can be quantitatively estimated in another sample by heating with pure zinc (free from iron), pouring off from the zinc, washing

the latter, allowing to cool, and titrating with permanganate. This is best employed as $\frac{1}{20}$ th normal, indicating 0'002792 g. Fe per cubic centimetre. Not less than 50 c.c. of the acid should be taken for this test, as it generally contains very little iron.

The smallest traces of iron can be estimated colorimetrically

(Lunge, Zsch. f. angew. Chem., 1896, p. 3).

- (h) Arsenic is detected qualitatively by the well-known methods of Marsh or of Reinsch. For quantitative estimation dilute 20 c.c. of the acid with water, and treat with a current of SO₂, until there is a strong smell of the gas. This reduces As₂O₅ to As₂O₃, but that requires a pretty long time and a considerable excess of SO₂. Now drive off this excess by heating and passing in a current of CO₂, neutralise exactly with Na₂CO₃ and a little NaHCO₃, and titrate with decinormal iodine and starch. 1 c.c. of the iodine solution indicates 0 004948 g. As₂O₃. (Any considerable proportion of iron should be previously removed.)
- (i) Chlorides.—Boil 10 c.c. of the acid in a flask, pass the vapours on to the surface of a little water, contained in a flask, and estimate the absorbed HCl acidimetrically, or after neutralising with Na₂CO₃, by titrating with decinormal silver nitrate (p. 146).

Analysis of Fuming Sulphuric Acid (Nordhausen Oil of Vitriol) and of Sulphuric Anhydride.

The substance is either weighed in glass bulbs or in a glass-tap tube. The former are very thin bulbs of about 2 cm. diameter, ending on each side in a capillary tube. Melt the acid, if solid, till it is completely homogeneous, and suck 3 g. to 5 g. into the bulb, which ought to be half-filled with it. The sucking is best done by means of a bottle closed with a rubber cork,



Fig. 11.

through which passes a tightly fitting glass tap, connected at its free end with a rubber tube. Suction is applied to the latter, the tap closed, the rubber tube drawn over one of the capillary ends of the weighing bulb, and by opening the tap a sufficient quantity of acid admitted into the bulb. The tube is cleaned outside, and one of the capillary ends is sealed off. The other end can be left open without fear of any loss of SO₃ or attraction of moisture during weighing. The weighing is best done on a small platinum crucible with two nicks, on which the ends of the bulb can rest. If the

latter should be accidentally broken, the acid runs into the crucible, not on to the balance. Put the bulb, after weighing, open

end downwards into a small Erlenmeyer flask, into the neck of which it ought to fit exactly (Fig. 11), and which contains so much water that the capillary tube dips well into it, to prevent any loss of SO₃ on mixing the acid with water. Break off the other point, allow the acid to run out, squirt a few drops of water into the upper capillary, and ultimately rinse the whole bulb tube by repeated aspiration of water. Dilute the liquid to 500 c.c. and take 50 c.c. for each test. This is done with $\frac{1}{2}$ normal sodium carbonate solution (1 c.c.=0.008007 g. SO₃), and methyl orange as indicator. From the acidity found, that due to SO₂ is deducted, which is ascertained by titrating another sample with iodine.

Lunge and Rey's glass-tap pipette (Fig. 12) (the taps of which must be tight without greasing!) is more convenient than the bulb tube. Shut the lower tap c, open the upper tap a, apply suction (with the mouth) at d, and shut a whilst sucking. Immerse the point e in the acid to be tested, and open c; the partial vacuum in bulb b suffices for drawing up enough acid, which must not be allowed to reach the tap c. Shut c, clean the point e, put the pipette in the outer glass vessel f, and weigh. Take the pipette out of f, place it point downwards in water, and slowly run out the contents. Then squirt some water from above into b, allow to stand for a moment, and rinse thoroughly with water.

The strongest fuming oil of vitriol cannot be run directly into water without loss. Such oil of vitriol is weighed out in small glass bulbs, as described above; both ends are sealed up, the bulb is placed in a bottle containing a considerable quantity of water, the stopper put in, the bulb broken by shaking the bottle, and after waiting a little the solu-

tion titrated.

Solid products of this class must be melted by moderate heating; they then remain long



FIG. 12.

enough in the liquid state to complete the weighing and running out without being heated again. But products which are not far removed from real SO_3 in composition would give out too much vapour in this operation. Such products are weighed out in a stoppered bottle, and mixed in this with a known and exactly analysed quantity of monohydrate, at a temperature of 30° to 40° C. This ought to produce a mixture containing about 70 per eent. SO_3 which will remain liquid at ordinary temperatures.

If only 0.5 to 1 g. of acid has been weighed off, titrate directly. This is more accurate than diluting and titrating only part of the liquid, but the latter method cannot be avoided when a larger

quantity of acid has been weighed.

The acidimetric determination, of course, indicates the total percentage of acid. From this we must deduct in the first instance any SO₂ present. This is estimated in the usual way by decinormal iodine, and for each c.c. of this 0.05 c.c. normal sodium carbonate solution is deducted (since with methyl orange the colour changes when SO_2 has passed into NaHSO₃). If we call the c.c. of normal sodium carbonate used =n, those of decinormal iodine used for the same quantity of oil of vitriol =m, the acidity due to $H_2SO_4 + SO_3$ is $= (n - 0.05 \ m)$ 0.040035 SO₃. To the SO₃ thus found add the SO₂ (calculated $= 0.0032035 \ m$), and assume the residue to be water.* By multiplying this H_2O by 4.445, we obtain the quantity of SO₃ combined with it to form H_2SO_4 , and by deducting this from the total SO₃ acidity, that of the free SO₃.

III. SALTCAKE AND HYDROCHLORIC ACID.

A.—Salt (Common Salt, Rock-Salt).

- 1. Moisture.—Ignite 5 g. of salt in a covered platinum crucible (to prevent loss by spirting); heat first quite gradually, then for some minutes, up to a low red heat. If the sample is too damp, or if several samples are to be tested at the same time, weigh off the 5 g. samples in flat-bottomed Erlenmeyer flasks, with funnels on, heat a number of these on a sand-bath for three or four hours to 140° or 150° (without funnel), and allow them to cool with the funnel in, which saves the use of a desiccator. Afterwards the small remainder of chemically combined water may be removed by heating on a wire-gauze, but this is mostly unnecessary.
- 2. Insoluble matter.—Dissolve 5 g., filter the insoluble matter, wash, dry, and ignite.
- 3. Chlorine.—Weigh off 5.846 g. of the moist salt, dissolve it, and dilute to 500 c.c.; take out 25 c.c. by means of a pipette, add so much of a solution of neutral potassium chromate that the liquid is distinctly yellow, and titrate with decinormal silver solution (cf. Appendix). Add the silver solution from a 50 c.c.

^{*} In case any weighable quantity of solid impurities is present, this must be of course equally deducted.

burette, till the precipitate, even after agitation, shows a distinct but faint pink colour. 0'2 c.c. is deducted from the number of cubic centimetres of silver solution used, as being required for producing the colour. The remainder, multiplied by 2, gives the percentage of NaCl in the salt. In lieu of potassium chromate, sodium arsenate may be employed as indicator. This is even more sensitive, and no deduction from the silver solution used should be made in this case.

- 4. Lime.—Dissolve 5 g. of the salt in water, if necessary with the aid of a little HCl. When analysing impure rock-salt, the treatment with dilute HCl must be continued for some time, in order to dissolve all CaSO₄. It is also necessary to filter off any clay, etc., but non-argillaceous salt ought to dissolve completely, excepting any grains of sand and the like. In the clear solution precipitate the lime with ammonia and ammonium oxalate, allow to stand for twelve hours, filter the precipitate through a fine filter-paper in a well-shaped funnel (cf. p. 109), wash, dry, and ignite it in a platinum crucible till it is completely converted into CaO. This is done by first gently heating till the calcium oxalate is decomposed, and then igniting at nearly a white heat for twenty minutes, either over a gas blowpipe or, more conveniently, in a Hempel's gas-oven or over a Muencke burner. One part CaO is equal to 2'4281 CaSO₄, and is calculated as such.
- 5. Sulphates.—Dissolve 10 g. of the salt in tepid water, with addition of a little hydrochloric acid. Dilute to 1 litre, filter through a dry pleated filter, and precipitate 250 c.c. (=2.5 g. salt) by barium chloride (cf. p. 108). The sulphate is usually calculated as $CaSO_4$.
- 6. Magnesium chloride may be titrated directly by drying the salt, extracting it with absolute alcohol, filtering, evaporating off the alcohol from the filtrate (which contains nothing but MgCl₂), and titrating with silver nitrate.

B.—Saltcake (Sulphate of Soda).

- (N.B.—Nos. I and 2 are sufficient for the daily checking of the manufacture; the others are employed for saltcake when bought and sold.)
- 1. Free Acid.—Dissolve 20 g. saltcake, dilute to 250 c.c., take out 50 c.c. with a pipette, and methyl orange, and titrate with standard sodium carbonate to the point of neutralisation. Each

cubic centimetre of the standard alkali is equal to 1 per cent. SO₃. The total acidity is calculated as SO₃, including HCl and NaHSO₄. (If litmus were employed as indicator, the presence of salts of iron and alumina would cause trouble in the titration; with methyl orange this is not the case.)

- 2. Sodium Chloride.—Take another 50 c.c. of the solution made for the test No. 1, add the same quantity of standard alkali as used for this test, so that the acid is exactly neutralised, then a little neutral potassium chromate, and titrate with decinormal silver solution, as in A, 3. Each cubic centimetre of silver solution (after deducting 0.2 from the whole) is equal to 0.1462 per cent. NaCl. Or else employ a solution containing 2.906 g. AgNO₃ per litre and indicating 0.001 g. NaCl per cubic centimetre. This would, in the present case, indicate 0.025 per cent. NaCl per cubic centimetre.
- 3. Iron.—Dissolve 10 g. of sulphate in water, reduce the iron salts to the ferrous state by a little sulphuric acid and zinc, and titrate with potassium permanganate (cf. p. 143).
 - 4. Residue, insoluble in water, is estimated as usual, if present.
- 5. Lime.—Dissolve 10 g. in water, if necessary with a little HCl; add $\rm NH_4Cl$ and $\rm NH_3$, precipitate with ammonium oxalate, ignite, and weigh as $\rm CaO$ (cf. A, 4). If any appreciable quantity of $\rm Fe_2O_3$ has been found, this must be deducted.
- 6. Magnesia is precipitated in the filtrate from No. 5 by ammonium phosphate; allow to stand for twenty-four hours; filter, wash with dilute ammonia, dry, ignite, and weigh the magnesium pyrophosphate, of which 1 part=0.3621 MgO.
- 7. Alumina.—The solution of the saltcake is precipitated by ammonia (free from CO_2). The precipitate is ignited and weighed. Deducting the weight of Fe_2O_3 found in No. 3, the remainder is $=Al_2O_3$.
- 8. Sodium Sulphate (direct estimation).—Dissolve 1 g. of the saltcake; precipitate any lime together with ferric oxide, etc., as in No. 5; filter; evaporate the filtrate to dryness after adding a few drops of pure sulphuric acid; ignite; repeat this after adding a small piece of ammonium carbonate, and weigh. Deduct from this weight (1) the NaCl found in test No. 2, calculated for Na₂SO₄ (1'0000 NaCl=1'2151 Na₂SO₄, or each cubic centimetre of Na₂SO₄); (2) the MgO found in test No. 6 calculated as MgSO₄ (1'000 MgO=2'9859 MgSO₄). The remainder is equal to the sodium sulphate actually present in 1 g. saltcake.

C.—Chimney-Testing.

Act of Parliament.—By the Alkali Works Regulation Act of 1906, it is enacted that "Every alkali work shall be carried on in such a manner as to secure the condensation to the satisfaction of the chief inspector, (a) of the muriatic acid gas evolved in such work to the extent of 95 per centum, and to such an extent that in each cubic foot of air, smoke, or chimney gases escaping from the works into the atmosphere, there is not contained more than one-fifth part of the grain [=0.457 g. per cubic centimetre] of muriatic acid; (b) of the acid gases of sulphur and nitrogen which are evolved in the process of the manufacture of sulphuric acid in that work to such an extent that the total acidity of such gases in each cubic foot of residual gases after completion of the process, and before admixture with air, smoke, or other gases, does not exceed what is equivalent to four grains of sulphuric anhydride; (c) in the residual gases from the con-centration of distillation of sulphuric acid, the total acidity of gases in each cubic foot must not exceed the equivalent of 1½ grain of sulphuric anhydride."

Hydrochloric Acid in Chimney Gases.—In order to ascertain the HCl in chimney gases, an aspirator is used known as Fletcher's flexible aspirator, or bellows. This aspirator is supposed to draw at one aspiration one-tenth of a cubic foot. It is not safe to trust to this supposed capacity, and moreover the capacity of a new aspirator varies for some time. To ascertain the real capacity, fill a very large beaker or other cylindrical vessel with water, and invert it under water. Completely fill the aspirator with air, and expel this air into the inverted beaker. Mark the point to which the beaker is filled when the water inside the beaker is level with that outside. Measure the capacity of the beaker to that mark; say it contains V cubic centimetres of water. Then the number of aspirations which must be made with this aspirator in order to draw 1 cubic foot of air is:—

$$N\,=\frac{28290}{V}\,;$$

or if the capacity of the beaker is measured in grains:-

$$N = \frac{436485}{V}$$
.

N will usually be a mixed number, but the nearest integral number is substituted, and it will be safest to substitute the next higher integral number. Thus, if N be found 9'3, it will be safest

to consider 10 as the number of aspirations necessary to draw 1 cubic foot. The aspirator must be air-tight. The gas is withdrawn from the chimney through a glass tube, which should be sufficiently long to reach a considerable distance into the chimney, say 6 feet. The glass tube should be of at least \frac{1}{2} in diameter, otherwise the aspiration is tedious. In flues where the temperature is too high for glass, a platinum tube must be employed. The bellows and tube are washed with distilled water until the washings give no reaction with silver nitrate. 100 or 200 cubic centimetres of distilled water, free from chloride, are then charged into the bellows, and after each aspiration the gas is well washed by shaking the contents of the aspirator violently. When the number N of aspirations has been made, some water is forced into the glass tube, and allowed to flow back into the bellows to wash out any acid which may have condensed in the tube. The liquid is then transferred into a porcelain dish (or into a beaker standing on a porcelain slab). If the liquid is so highly charged with soot that it would be impossible to recognise the change of colour, it must be filtered through a filter previously washed free The liquid is then oxidised by potassium from chlorides. permanganate, and any excess of this reagent removed by a trace of ferrous sulphate, neutralised by pure sodium carbonate, coloured by potassium chromate, and titrated with decinormal silver solution. (See p. 146 A, 3, and Appendix.) Some use a centinormal silver solution. Call the number of cubic centimetres consumed = x; then the hydrochloric acid, in grains per cubic foot of gas, will be:—

G = 0.05633x grains.

In order to calculate the percentage escape, the velocity of the gas in the chimney must be ascertained and reduced to 60° F. No notice is usually taken of the barometric pressure, since the measurement by the bellows is anyhow inaccurate. In addition, the diameter of the chimney and the number of tons of salt decomposed during twenty-four hours in the furnaces connected with the chimney must be known.

If G = number of grains of HCl per cubic foot, If V = velocity at 60° F. in feet per second,

If D = diameter of chimney at testing-bole in feet,

If T = tons of salt decomposed per twenty-four hours assumed to contain 93 per cent. NaCl,

the percentage escape will be :-

$$0.7458 \times \frac{\text{GVD}^2}{\text{T}}$$
.

D.—Testing of the Gases in the Hargreaves' Process.

(a) Total acidity, as described p. 117.

(b) Sulphur dioxide, as p. 116.
(c) Hydrogen chloride is estimated in the sample taken for (a), as described p. 149. By deducting (b) and (c) from (a), the amount of SO₃ is found.

E.-Hydrochloric Acid.

SPECIFIC GRAVITY OF PURE HYDROCHLORIC ACID AT 15° C. COMPARED WITH WATER AT 4°, AND REDUCED TO VACUUM. (Lunge and Marchlewski.)

	Specific Gravity	100 parts by weight correspond to parts by weight of			1 litre	1 cubic
Degrees Twaddell. at $\frac{15^{\circ}}{4^{\circ}}$ in vacuo.	HCI.	Acid of spec. gravity 1.1425 = 28.5° Tw. Acid of spec. gravity 1.52 = 80.4° Tw.		contains g. of HCl.	foot contains lbs. of HCI.	
0 1 2 3 4 5	1.000 1.005 1.010 1.015 1.020 1.025	0.16 1.15 2.14 3.12 4.18 5.15	0.57 4.08 7.60 11.80 14.67	0·53 3·84 7·14 10·41 13·79 17·19	1.6 12 22 32 42 53	0-10 0-75 1-37 1-99 2-62 3-30
6	1.030	6·15	21.85	20*53	64	3:99
7	1.035	7·15	25.40	23*87	74	4:61
8	1.040	8·16	28.99	27*24	85	5:30
9	1.045	9·16	32.55	30*58	96	5:98
10	1.050	10·17	86.14	38*95	107	6:67
11	1.055	11·18	39·73	37-93	118	7:85
12	1.060	12·19	43·32	40-70	129	8:04
13	1.065	13·19	46·87	44-04	141	8:79
14	1.070	14·17	50·35	47-81	152	9:48
15	1.075	15·16	53·87	50-62	163	10:16
16	1.080	16-15	57·39	53:92	174	10·85
17	1.085	17-18	60·67	57:19	186	11·59
18	1.090	18-11	64·35	60:47	197	12·28
19	1.095	19-06	67·79	63:64	209	13·03
20	1.100	20-01	71·11	66:81	220	13·71
21	1·105	20·97	74-62	70·01	232	14·46
22	1·110	21·92	77-89	73·19	243	15·16
23	1·115	22·86	81-23	76·32	255	15·90
24	1·120	23·82	84-64	79·58	267	16·65
25	1·125	24·78	88-06	82·74	278	17·38
26	I·130	25·75	91·50	85·97	291	18·14
27	1·135	26·70	94·88	89·15	808	18·89
28	1·140	27·66	98·29	92·35	316	19·64
29	I·145	28·61	101·67	96·52	928	20·45
30	1·150	29·57	• 105·08	98·73	340	21·20
81	1·155	30·56	108-58	102:00	358	22·01
32	1·160	31·52	112-01	105:24	366	22·62
33	1·165	82·49	115-46	108:46	379	23·63
84	1·170	33·46	118-91	111:71	392	24·44
85	1·175	94·42	122-32	114:92	404	25·19
36	1·180	35·39	125-76	118·16	418	26·06
37	1·185	36·31	129-03	121·23	430	26·81
38	1·190	37·23	132-30	124·30	443	27·62
39	1·195	88·16	186-61	127·41	456	28·43
40	1·200	39·11	188-98	130·58	469	29·24

2. INFLUENCE OF TEMPERATURE ON THE SPECIFIC GRAVITY OF HYDROCHLORIC ACID.

0°.	5°.	10°.	15°.	20°.	25°.	30°.	35°.	40°.	45°.	50°
1·168 1·158 1·148 1·138 1·128	1·165 1·155 1·145 1·135 1·125	1.158	1·160 1·150 1·140 1·190 1·120	1·157 1·147 1·187 1·127 1·117	1·154 1·145 1·134 1·125 1·115	1·142 1·132 1·122	1·149 1·139 1·129 1·119 1·110	1·147 1·137 1·127 1·117 1·108	1·144 1·184 1·125 1·114 1·106	1·142 1·132 1·123 1·112 1·103
1·118 1·108 1·098 1·089 1·078	1·115 1·105 1·095 1·085 1·075	1·118 1·108 1·098 1·088 1·078	1·110 1·100 1·090 1·080 1·070	1·107 1·097 1·087 1·077 1·068	1.105 1.095 1.085 1.075 1.065	1.092 1.082 1.073	1·101 1·090 1·080 1·070 1·061	1.099 1.088 1.077 1.068 1.059	1:097 1:086 1:075 1:066 1:057	1:094 1:084 1:073 1:064 1:055
1.068 1.058 1.048 1.038 1.028	1.065 1.055 1.045 1.035 1.025	1.063 1.053 1.043 1.033 1.023	1.060 1.050 1.040 1.080 1.020	1.058 1.048 1.087 1.027 1.017	1.055 1.045 1.085 1.024 1.014	1.048 1.082 1.022	1.050 1.040 1.080 1.019 1.009	1.048 1.038 1.027 1.017 1.007	1.046 1.085 1.025 1.014 1.004	1.044 1.083 1.022 1.012 1.002
1.018	1 · 018 1 · 015 1 · 013 1 · 010 1 · 007 1 · 004 1 · 002 0 · 999 0 · 997 0 · 994 0 · 992									
55°.	60°.	65°.	70)°.	75*.	80°.	85°.	90%	95°.	100°.
1·140 1·130 1·120 1·109 1·101	1·138 1·128 1·118 1·107 1·009	1:136 1:126 1:116 1:104 1:096	1·1 1·1 1·1	23 1 13 1 02 1	·181 ·121 ·111 ·100 ·091	1·129 1·119 1·108 1·097 1·089	1·127 1·116 1·106 1·095 1·086	1·125 1·114 1·104 1·093 1·094	1·128 1·112 1·102 1·090 1·081	1·121 1·110 1·099 1·088 1·079
1.093 1.082 1.071 1.052 1.053	1.090 1.080 1.069 1.060 1.051	1.088 1.078 1.067 1.058 1.049	1 · 0 7 1 · 0 3 1 · 0	76 1 65 1 56 1	·088 ·078 ·058 ·054 ·046	1.080 1.071 1.061 1.058 1.044	1.078 1.069 1.059 1.051 1.048	1.075 1.065 1.057 1.049 1.041	1.073 1.064 1.055 1.047 1.089	1.070 1.061 1.053 1.045 1.087
1.042 1.081 1.020 1.010 1.000	1.040 1.029 1.018 1.008 0.998	1.038 1.027 1.016 1.005 0.995	7 1·0 5 1·0 5 1·0	25 1 14 1 03 1	·084 ·028 ·011 ·001 ·091	1.038 1.021 1.009 0.999 0.989	1.081 1.019 1.007 0.997 0.987	1.029 1.017 1.005 0.995 0.965	1.027 1.015 1.003 0.993 0.993	1.025 1.013 1.001 0.991 0.961
0.990	0.988	0.085	0.9	88 0	-981	0.979	0.977	0.975	0.978	0.971

8. ANALYSIS OF HYDROCHLORIC ACID.

(a) Estimation of HCl.—Measure off, by means of an accurate pipette, 10 c.c. of the acid, the specific gravity of which should be known, dilute to 200 c.c., take out 10 c.c. Or else employ a glasstap pipette, as described p. 145, for fuming sulphuric acid; in this case its contents are run into water and employed directly for

titration. Add sodium carbonate, free from chloride, till the reaction is neutral or faintly alkaline. This point will be hit quickly, and without the loss of many drops for testing, if the percentage of the acid is ascertained from its specific gravity by the table (p. 152) and the corresponding quantity of sodium carbonate solution is run in from a burette. Now add a little neutral potassium chromate, and titrate with decinormal silver solution till a faint pink colour is produced (cf. p. 146). Deduct 0·2 c.c. from the silver solution employed; the remainder, multiplied by 72·94 and divided by the specific gravity of the acid, indicates its percentage of HCl. This test would fail in the presence of metallic chlorides, which are, however, hardly ever present in appreciable quantity in ordinary hydrochloric acid. The free HCl can also be ascertained by estimating the total acidity and deducting therefrom that due to sulphuric acid, making allowance for any sodium sulphate present.

(b) Estimation of Sulphuric Acid.—Neutralise the acid almost, but not quite, with sodium carbonate free from sulphate, and precipitate the sulphuric acid by barium chloride, as on p. 108. If the acid be partially saturated with NH₃, or not saturated at all, the result is too low. Each part of BaSO₄ is equal to 0.3430SO₃.

(c) Estimation of Iron.—Reduce this to ferrous iron by digesting the acid for a short time with a rod of zinc free from iron, wash the rod, dilute the whole with water, add some manganous chloride or sulphate (in order to counteract the action of HCl on permanganate), and titrate with a twentieth normal solution of potassium permanganate, each cubic centimetre of which indicates of 002792 g. Fe. In case of SO₂ being present, this must first be oxidised to sulphuric acid, before reducing the ferric salt and titrating.

(d) Free Chlorine.—Introduce a sample of the acid into a flask, remove the air from the empty space by CO₂; shake the acid with a strip of clean metallic copper. The latter is converted into chloride by the free chlorine, and the copper thus dissolved can be detected by potassium ferrocyanide, etc. This will show the smallest traces of chlorine. For ordinary purposes it is sufficient to heat the acid gently and hold a strip of KI starch paper in the vapour; this will at once turn blue in the presence of free Cl.

(e) Sulphur dioxide.—Oxidise with permanganate, or iodine, or H_2O_2 to sulphuric acid, estimate the total H_2SO_4 now present as in No. 2, and deduct the quantity there found; the remainder $=SO_2$.

(f) Arsenic.—Reduce all to trichloride by passing in SO_2 for some time, and precipitate by H_2S as As_2S_3 . Wash the precipitate, dissolve it on the filter in ammonia, evaporate the solution in a glass or porcelain dish, dry at 100° , and weigh. One part $As_2S_3 = 0.6091$ As = 0.8041 As_2O_3 .

IV. BLEACHING POWDER AND CHLORATE OF POTASH MANUFACTURE.

A .- Natural Manganese Ore.

1. Manganese Dioxide.—Weigh 10866 g. of manganese ore, ground as fine as possible, and dried for some time at 100°C.; put it into the flask (Fig. 13) closed by a rubber (Bunsen) valve, or, preferably, into a flask provided with a Contat-Göckel bulb (Fig. 14), which has been half-filled with a concentrated solution of sodium carbonate; put into the flask 75 c.c. (in three portions with a 25 c.c. pipette) of a solution containing







Fig. 14.

100 g. pure crystallised ferrous sulphate and 100 c.c. pure concentrated sulphuric acid, diluted to 1 litre, and standardised on the same day by means of the same 25 c.c. pipette, with decinormal potassium permanganate. Close the flask with its cork or valve, and heat till the manganese is completely decomposed, leaving a light-coloured residue. On cooling, the valve must act properly, which will be seen by the collapsing of the rubber tube, Fig. 13, or by the running in of sodium carbonate solution, Fig. 14. After complete cooling add 200 c.c. of water, and titrate with potassium permanganate to a faint pink coloration. Deduct the quantity of permanganate required from that corresponding to the 75 c.c. of iron solution; the remainder indicates for each cubic centimetre 0 02173 g., equal to 2 per cent. MnO₂.

2. Carbon Dioxide is estimated gravimetrically by expelling it with dilute sulphuric or nitric acid and absorbing it with soda-lime, by means of the apparatus and process described (p. 111, No. 6). Or more quickly by Lunge and Rittener's gas-volumetric process,

see p. 171.

3. Estimation of the Hydrochloric Acid required for Decomposing the Ore.—Dissolve 1 g. of manganese ore in a flask provided with a reflux condenser in 10 c.c. of ordinary strong hydrochloric acid the titre of which is known, employing heat as far as necessary. Allow the solution to cool, and add standard alkali till reddishbrown flakes of ferric hydroxide appear, which do not redissolve on agitation. Calculate the standard alkali corresponding to the acid employed for dissolving the ore, and deduct the quantity thus found from the 10 c.c. first employed.

B.—Recovered Manganese Mud and Weldon Liquors.

1. MnO₂ in Weldon Mud.—Standardise an acid iron solution (100 g. pure crystallised ferrous sulphate+100 c.c. pure concentrated sulphuric acid in 1 litre) by seminormal potassium permanganate (cf. Appendix), by diluting 25 c.c. of the former with 100 c.c. of 200 c.c. of cold water, and adding the permanganate from a stopcock burette, till, on agitating, the pink colour is not discharged immediately, but remains at least for half a minute. Subsequent decolorisation is not taken into account. This test should be made once each day. Call the cubic centimetres of permanganate employed x. Now, put another 25 c.c. of the iron solution into a beaker. Take 10 c.c. of manganese mud out of the well-shaken bottle (mere stirring does not ensure a proper mixture) containing it; wash the pipette outside, run its contents into the beaker containing the iron solution, and wash the mud remaining inside into the same beaker. When all has dissolved, on agitating, add 100 c.c. of water, and titrate by potassium permanganate. The number of cubic centimetres now used we call y. The quantity of MnO₂ in grams per litre of mud equals 2.173(x-y).

2. Total Manganese of the Mud, expressed in Grams of theoretically possible MnO₂ per Litre.—Take 10 c.c. of the mud, with the same precautions as in test No. 1. Boil with strong hydrochloric acid till all chlorine is driven off; saturate the excess of acid by ground marble or precipitated calcium carbonate; add a concentrated filtered solution of bleaching powder; boil a few minutes till the colour turns a decided pink, and the excess of bleaching powder can be smelt, and again destroy the pink colour by adding alcohol drop by drop. All manganese is now present as MnO₂; filter and wash. The filtrate should not produce any brown colour with a bleaching-powder solution, which would show the presence of Mn in solution. Continue the washing till starch and KI do not give any reaction. Transfer the filter with the precipitate into 25 c.c. of the acid iron solution employed in test No. 1. If all MnO₂ is not dissolved, add another 25 c.c. of

iron solution; dilute with 100 c.c. of water, and titrate with

permanganate. Calculation as in No. 1.

3. Estimation of the "Base," i.e. the Monoxides, etc., of the Mud which combine with HCl without yielding Free Chlorine.—Dilute 25 c.c., or in case of a very rich base 50 c.c., of normal oxalic acid (63.03 g. crystallised oxalic acid in 1 litre) to 100 c.c.; heat to 60° to 80° C., add 10 c.c. manganese mud by means of a pipette, with the precautions stated in No. 1, and agitate till the colour of the precipitate is no longer yellowish but pure white, which ought to take place very soon at the above temperature. Dilute to 202 c.c. (2 c.c. correspond to the volume of the precipitate, and are marked on the neck of the 200 c.c. flask); pour through a dry filter, and titrate 100 c.c. of the filtrate with standard alkali, employing phenolphthalein as indicator. (Methyl orange is not applicable for oxalic acid.) Call the number of cubic centimetres of standard alkali used, z. The oxalic acid serves (1) for reducing the MnO2 with formation of MnO and CO2; (2) for saturating the MnO thus formed; (3) for saturating the monoxides originally present, i.e. the base. The oxalic acid not thus used is equal to The acid used for reducing MnO2 is equal to that used for neutralising the MnO formed, and both amounts together are equal to the value x-y obtained by the MnO₂ test, since the oxalic acid is normal and the permanganate half normal. The amount of oxalic acid consumed by the bases of the mud is found by deducting from the total acid used that required for the MnO₂ (x-y), and that which was not neutralised at all by the mud = 2z, therefore in all x-y-2z. The "base" is equal to the ratio of this

value to that found in test No. 1, viz., $\frac{x-y}{2}$.

It is, therefore, if 25 c.c. of oxalic acid had been employed, equal to:

$$\frac{50-2x-4z+2y}{x-y} = \left(\frac{50-4z}{x-y}\right) - 2;$$

or, if 50 c.c. had been employed, equal to :-

$$\left(\frac{100-4z}{x-y}\right)-2.$$

C.-Limestone.

1. Insoluble Matter.—Dissolve 1 g. in hydrochloric acid, filter the residue, wash, dry, and ignite. In the presence of appreciable quantities of organic matter, weigh the filter after drying at 100°, and ignite afterwards. The difference is calculated as organic matter.

2. Lime.—Dissolve 1 g. in 25 c.c. normal hydrochloric acid

and titrate with normal alkali. Deduct the volume of the latter used from 25 and multiply the remainder with 2.8 to find the percentage of CaO, or with 5 to find that of CaCO₃. (N.B.—Here MgO is calculated as CaO. This is admissible for most limestones employed in alkali and bleaching-powder making, because they contain but little MgO; otherwise the MgO or MgCO₃ found as in No. 3 must be deducted.)

3. Magnesia need only be estimated in limestone used for manganese recovery. Dissolve 2 g. of limestone in HCl, precipitate the CaO by NH₃ and ammonium oxalate, and precipitate the magnesia in the filtrate by sodium phosphate (cf. p. 148).

4. Iron is usually estimated only in limestone used for bleaching-powder making. Dissolve 2 g. HCl, reduce by zinc, dilute, add some manganese solution free from iron, and titrate by permanganate (cf. p. 143).

D.—Quicklime.

1. Free CaO.—Weigh 100 g. of an average sample carefully taken, slake it completely, put the milk into a half-litre flask, fill up to the mark, shake well, take 100 c.c. out, run it into a half-litre flask, fill up, mix well, and employ 25 c.c. of the contents, equal to 1 g. quicklime, for the test. Titrate by normal oxalic acid and phenolphthalein as indicator, adding the acid very slowly and shaking well after each addition. The colour is changed when all free lime has been saturated and before the CaCO₃ is attacked. One c.c. normal HCl=0.02804 g. CaO.

2. Carbon Dioxide.—Titrate CaO and CaCO₃ together by dissolving in an excess of standard hydrochloric acid and titrating back with standard alkali. By deducting the CaO estimated as in No. 1 the quantity of CaCO₃ is obtained. For very accurate estimations the CO₂ is expelled by HCl, absorbed in soda-lime, and weighed; or it is estimated by volume in Lunge and

Rittener's apparatus (p. 171).

E.—Slaked Lime.

1. Water.—Weigh about 1 g. in a stoppered glass tube, and heat it gradually in a platinum crucible, at last to a strong red heat (cf. p. 146); allow to cool in the exsiccator, and weigh. The loss of weight is equal to $H_2O + CO_2$.

2. Carbon Dioxide is estimated as above in D, 2.

3. Estimation of the percentage of Caustic Lime in Milk of Lime by means of the specific gravity (Blattner).—Thin milk of lime is poured into the cylinder and the reading of the hydrometer is taken quickly, before the lime subsides. For thick milk of lime employ a somewhat wide cylinder, put the hydrometer in without

using any force and turn the cylinder slowly round, so that it receives a slight shaking, until the hydrometer ceases to sink. The following table is valid for 15° C.

TABLE SHOWING AMOUNT OF LIME IN MILK OF LIME.
(Calculated from Blattner.)

Degrees Twaddell.	Grms. CaO per litre.	Lbs. CaO per cubic foot.	Degrees Twaddell.	Grms. CaO per litre.	Lbs. CaO per cubic foot.
2	11.7 24.4	0.7 1.5	28 30	177 190	11·1 11·9
4 6 8	37·1 49·8	2·3 3·1	32 34	203 216	12·7 13·5
10	62.5	3.9	36	229	14.3
12 14	75·2 87·9	4·7 5·5	38 40	$\frac{242}{255}$	15·1 15·9
16 18	100 113	6·3 7·1	42 44	268 281	16·7 17·6
20	126	7.9	46	294	18.4
22	138	8.7	48 50	307	19·2 20·0
24 26	152 164	9.5 10.3	อบ	321	20.0

F.—Bleaching Powder.

1. Available Chlorine (Penot's Method).—Weigh 7092 g. of the sample, previously well mixed; grind it with a little water in a porcelain mortar (the lip of which has been greased a little underneath) till a completely homogeneous thin past has been obtained; dilute with more water, wash the whole into a litre flask, fill up to the mark, and take for each test 50 c.c.=0°3546 g. bleaching powder, having shaken up the flask immediately before. Run into the above, with continuous agitation, an alkaline decinormal arsenite solution, containing 4°948 g. As₂O₃ per litre (cf. Appendix) till the expected point is not very far off. Then place a drop of the mixture on to a piece of filter paper, moistened with a starch solution containing potassium iodide. If there is very much chlorine left, a brown spot will be produced; if less chlorine, the spot will be blue. According to the depth of this colour more or less arsenite solution is run in, and the above test is repeated tilt the paper is coloured hardly perceptibly, or not at all. Each cubic centimetre of the arsenite solution indicates 1 per cent. available chlorine. (For sampling of bleach, cf. Appendix.)

Another very accurate method, requiring no standard solution.

consists in decomposing the bleaching powder by hydrogen peroxide in a nitrometer or gas-volumeter (Lunge, S.C.I., 1890,

22).

2. Comparison of the Percentage of Bleaching Powder with the French (Gay-Lussae) Degrees.—The latter are understood to mean the number of litres of chlorine gas at 0° C. and 760 mm. pressure which can be given off by 1 kilogram of bleaching powder. The oxygen given off in the hydrogen peroxide method (cf. last paragraph) shows this directly.

French Degrees.	Per cent. Chlorine.	French Degrees.	Per cent. Chlorine.	French Degrees.	Per cent. Chlorine.	French Degrees.	Per cent. Chlorine.
63 64 65 66 67 68 69 70 71	20·28 20·60 20·92 21·25 21·57 21·89 22·25 22·55 22·86 23·18	81 82 83 84 85 86 87 88 89	26.07 26.40 26.72 27.04 27.31 27.36 28.01 28.33 28.65 28.97	99 100 101 102 103 104 105 106 107 108	31·87 32·10 32·51 32·83 33·16 33·48 33·80 34·12 34·47 34·78	116 117 118 119 120 121 122 123 124 125	37·34 37·66 37·99 38·31 38·63 38·95 39·27 39·27 39·92 40·24
73 74 75 76 77 78 79 80	23·50 23·82 24·14 24·47 24·79 25·11 25·40 25·75	91 92 93 94 95 96 97 98	29·29 29·62 29·94 30·26 30·53 30·90 31·23 31·55	109 110 111 111 112 113 114 115	35·09 35·41 35·73 36·05 36·38 36·70 37·02	126 127 128 129 130 131 132	40 · 56 40 · 88 41 · 20 41 · 53 41 · 85 42 · 17 42 · 49

3. Carbon Dioxide in Bleaching Powder or Bleach Liquors by Lunge and Rittener's Process.—The same apparatus is employed as that described later on for sodium carbonate solutions (p. 171), and the operation is carried out in the same way, but no aluminium must be used in this case for expelling the gases, but 2 or 3 c.c. of a 3 per cent. solution of hydrogen peroxide which during the final boiling gives out oxygen gas.

Employ only so much of the substance that not more than 50 or 60 c.c. of gas $(CO_2 \text{ and } Cl_2)$ is formed; read off the volume of the gases =c in the Bunte burette, charged with concentrated sodium chloride solution, after allowing twenty minutes for cooling, and after putting the level-bottle in the proper position. Introduce into the burette funnel an excess of decinormal arsenic solution =d c.c.; run this slowly into the burette, so that it forms a layer above the salt solution; wash the funnel two or three times with a few c.c. of water; shut off the connection with the level-bottle,

shake for two minutes; run into the burette so much of a 30 per cent. solution of sodium hydroxide that, on shaking, no more will run in; read off the volume of gas=b. The figure c-b, or, after reduction to 0° and 760 mm. c_1-b_1 indicates the absorbed c.c. CO_2+Cl_2 . Now run the contents of the burette into a flask, wash the burette with water, add to the whole an excess of NaHCO₃, and titrate with decinormal iodine; the c.c. used=e. Since 20,000 c.c. $\frac{n}{10}$ arsenic solution indicate 22,030 c.c. Cl_2 , we have had in the burette,

$$\frac{22030}{20000} \times (d-s)$$
 c.c. chlorine.

and together with this,

$$(c_1-b_1) - \frac{22030}{20000}(d-e) \text{ c.c. } CO_2.$$

4. Testing the Atmosphere of the Chambers for Chlorine before opening them.—In England a maximum of 5 grains chlorine per

cubic foot (=11.5 g. per cubic metre) is prescribed before the chamber may be opened. This is ascertained by the apparatus, Fig. 15. A is a rubber pressure ball holding about 100 c.c., B a hole in its mouthpiece, D a glass tube reaching nearly to the bottom of the glass jar E; its lower end is contracted so that only a thin needle can pass through. E is charged with 26 c.c. of a solution, so prepared that ten deliveries of the bulb indicate 21 grains (or five deliveries 5 grains) chlorine per cubic foot. It is prepared by dissolving 0.3485 g. arsenious acid in sodium carbonate solution, neutralising with sulphuric acid, adding 25 g. potassium iodide, 5 g. precipitated calcium carbonate, 6 to 10 drops liquor ammoniæ, and diluting the whole to I litre. To the 26 c.c. of this solution add a little starch solution, introduce the outer end of D into the bleaching-powder chamber 2 feet above the bottom, compress A and close the hole B by a finger, whereupon the pressure on A is relieved. By the expansion of the rubber ball A chamber air is aspirated into the liquid contained in E. Note the number of times the ball A must be employed as de-

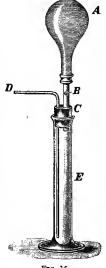


Fig. 15.

scribed, before the liquid is coloured by the separation of iodine. According to the prescribed limit, this number should be at least 5.

G.—Deacon Process.

1. Proportion of HCl and Cl in the Gases.—Aspirate 5 litres of gas, issuing from the decomposer, placing the apparatus as near to the outlet of the decomposer as possible, and absorb the hydrochloric acid and chlorine in a solution of caustic soda, sp. gr. 1°075, of which about 250 c.c. are distributed into two or three absorbing-bottles. The time of absorption ought to agree with the time occupied by the charge in the saltcake pan. Unite the contents of the several bottles and dilute to 500 c.c.

(a) Take 100 c.c. of this solution, and add it gradually to 25 c.c. of an iron solution (prepared and standardised as directed on page 155) in a flask as shown in Fig. 13, p. 155, and heat to boiling. Allow to cool, dilute with 200 c.c. of water, and titrate with seminormal permanganate solution. Say it required y c.c. Suppose that when standardising the iron solution 25 c.c. of iron

solution required x c.c.

(b) Take 10 c.c. of the solution to be tested, add a little solution of sulphurous acid, acidify with dilute sulphuric acid; if it does not smell of sulphurous acid, add a little more. Heat to boiling. When cool, add, if necessary, a few drops of permanganate to oxidise any sulphurous acid in excess. Neutralise with pure carbonate of soda, dilute with water, and after adding a few drops potassium chromate, titrate with decinormal silver solution. Suppose it requires z c.c. of silver sodium. Then

$$\frac{50x-y}{z}$$

is the percentage of hydrochloric acid decomposed, and

$$\frac{44.94 + \frac{x-y}{8}}{2}$$

equals the amount of air present for every volume of hydrochloric acid. If any other volume, l, of gas instead of 5 litres be employed, the constant 44'94 becomes

$$\frac{1.639n}{50 \times 0.003647}$$

assuming that the other directions are strictly followed, and that 1 litre of hydrochloric acid weighs 1.639 g. at 15° C. at 760 mm. pressure.

2. Carbon Dioxide.—Pass 20 litres of the gas, from which the HCl has been removed by water, into an ammoniacal solution of barium chloride, heat this finally, filter the BaCO₃ and estimate

this by igniting, or by converting it into BaSO, of which 1 g.

=0.1885 g. CO₂. Cf. also below, sub H.

3. Steam.—Pass the gas through a weighed tube, containing pumice moistened with strong sulphuric acid, and before reweighing remove the other gases by a current of air.

H .- Electrolytic Chlorine.

Examination for Carbon Dioxide.—Chlorine gas produced by means of gas-carbon electrodes may contain up to 12 per cent. carbon dioxide. This CO₂ is estimated by Ferchland's process,

as modified in Lunge's laboratory.

A dry Bunte burette, the content of which (from tap to tap = v) is exactly known, is filled with the chlorine by passing this through for some time, the gas passing in from below, so as to rise regularly below the lighter air. When filled with the chlorine gas under atmospheric pressure, the burette is fixed in a clamp in a vertical position, and a level tube is attached by means of a strong rubber tube, filled with mercury to the bottom tap, which has a single bore. The rubber tube must be entirely filled with mercury, so that no air can get into the burette, and it is secured against slipping off by iron wire. When the bottom tap of the burette is opened, mercury enters into the burette and absorbs the chlorine, at first pretty quickly, but later on its surface is covered by a pellicle, which precludes further action. Then the bottom tap is closed, and by agitating the burette the complete absorption of the chlorine is effected. The sides of the burette are thereby covered with a non-transparent layer, and a mixture of mercurous chloride and mercury floats on the top of the mercury, which prevent reading off the volume. When the absorption of the chlorine is finished, open the bottom tap, put the level of the mercury approximately equal in the burette and the level tube, and allow ten or fifteen minutes for the equalisation of the temperature. Now put 1 c.c. saturated solution of sodium chloride into the top beaker, and allow this to enter the burette by lowering the level tube. This causes the pulverulent mixture on the top of the mercury to subside, and an easily readable surface to be formed. Then adjust the levels for atmospheric pressure, as described in the case of the nitrometer (p. 137) and read the volume of gas = a. Now introduce a little concentrated solution of potassium hydroxide through the funnel into the burette, absorb the CO2 by shaking, re-establish atmospheric pressure, and read the new volume of gas = b. The formula (a-b) 100 shows the percentage of CO₂ in the crude chlorine gas.

No correction for vapour tension of water need be made in this case, if concentrated solutions have been used.

I.—Chlorate of Potash.

1. Chlorate Liquors contain calcium chlorate and chloride, but these are calculated as potassium salts for the sake of con-

venience.

(a) Chlorate is estimated both in order to check the work and to calculate the necessary addition of KCl. Measure 2 c.c. of liquor in an accurate pipette, run it into a flask (Fig. 13, p. 155), add a little hot water and one drop of alcohol, boil (without the valve) till all smell of chlorine and the pink colour have disappeared, allow to cool, add 25 c.c. of the strongly acid ferrous sulphate solution (cf. p. 155, and requiring α c.c. of seminormal permanganate), close the flask with its valve, and boil for ten minutes. After cooling, titrate with seminormal permanganate. The number of cubic centimetres required to produce a faint pink=b. The liquor then contains calcium chlorate equivalent to 5·105 (α -b) g. KClO₃ per litre, and it will theoretically require an amount of 3·106 (α -b) g. of pure KCl per litre.

(b) Chloride is estimated in order to check the work, and is therefore calculated as KCl, although present as CaCl₂. Treat 1 c.c. of liquor as above, to destroy the free chlorine and pink colour, allow to cool, add a little neutral potassium chromate, and titrate with decinormal silver nitrate (as described p. 146). Each cubic centimetre of the latter indicates chloride equivalent to

7.456 g. KCl per litre.

2. Commercial Chlorate of Potash is only tested for chlorides, calculated as KCl. As their quantity is very small, it is advisable to dissolve 50 g. of the salt in water absolutely free from chlorine, and to test with decinormal silver nitrate, as in 1 (b). Each cubic centimetre of this solution=0.007456 g. KCl=0.015 per cent. KCl.

K.—Bleach Liquors.

These are tested like Bleaching Powder, p. 159. Electrolytic Bleach Liquor, see p. 193.

L.—PRESSURE AND SPECIFIC GRAVITY OF LIQUID CHLORINE. (Knietsch).

Temperature.	Pressure.	Specific Gravity.	Mean coefficient of expansion.
- 88° - 85 - 80 - 75 - 70 - 65 - 60 - 55 - 50	87.5 mm. Hg. 45.0 ,, 62.5 ,, 88.0 ,, 118 ,, 120 ,, 210 ,, 275 ,, 350 ,, 445 ,,	1.6602 1.6490 1.6382 1.6273 1.6167 1.6055 1.5945	0.001409
- 40 - 35 - 33 ·6 - 30 - 25	560 ,, 705 ,, 760 ,, 1-20 atm. 1-50 ,,	1.5720 1.5589 1.5575 1.5485 1.5358	
- 20 - 15 - 10 - 5 ± 0	1.84 ,, 2.23 ,, 2.63 ,, 3.14 ,, 3.66 ,,	1.5230 1.5100 1.4965 1.4830 1.4690	0.001793
$+5 \\ +10 \\ +15 \\ +20$	4·25 ,, 4·95 ,, 5·75 ,, 6·62 ,,	1·4548 1·4405 1·4273 1·4118	} 0.001978 } 0.002030
+ 25 + 30 + 35	7·63 ,, 8·75 ,,	1·3984 1·3815 1·3683	0.002190
+ 40 + 40 50 60	11·50 ,, 14·70 ,, 18·60 ,,	1·3510 1·3170 1·2830	\ \ \ 0.002260 \ \ \ \ 0.002690
70 80 90	23·00 ,, 28·40 ,, 34·50	1·2430 1·2000	} 0.003460
100 110 120 130 146	41·70 ,, 50·80 ,, 60·40 ,, 71·60 :, 93·50 ,,	Critical	Point

V. SODA ASH MANUFACTURE BY THE LEBLANC PROCESS.

A.—Raw Materials.

- 1. Saltcake.—(Cf. p. 147.)
- 2. Limestone or Chalk, for mixing.

(a) *Insoluble*.—(*Cf.* p. 157.)

(b) Lime (+MgO).—(P. 158.)

- (c) Magnesia (only in limestones containing much magnesia).— (P. 156.)
- 3. MIXING COAL (slack).

(a) Moisture.—(P. 93.)

(b) Fixed Carbon.—(P. 93.)

(c) Ash (p. 93).—In the case of unknown descriptions of coal it is not sufficient to estimate the total percentage of ash, but the latter should be analysed, and silica, alumina, and ferric oxide estimated according to the methods for the analysis of silicates.

(d) Sulphur.—(P. 94.)

(e) Nitrogen is estimated by igniting with soda-lime and absorbing the ammonia formed in standard sulphuric acid, according to the method employed in organic analysis.

B.-Black-Ash.

Digest 50 g. of the finely powdered average sample with 480 c.c. of water at 45° C., which have been previously freed from CO₂ and O by boiling and cooling down in a corked bottle. This will produce 500 c.c. of liquid. Shake at once and afterwards frequently, at least during two hours. The following tests are made partly with the muddy mixture, partly with the clear portion; the former ones must be made to begin with.

1. Tests made with the Muddy Mixture.—Each time before taking out a sample, the flask is thoroughly shaken up, and before the deposit settles again a sample is taken by means of a 5 c.c. pipette, with a short and somewhat wide outlet (to prevent obstruction by the mud). The mud outwardly adhering is washed off, the contents of the pipette are run out into a beaker, and the mud adhering to the inside of the pipette is washed into the same beaker.

(a) Free Lime (or its equivalent of sodium hydroxide) is estimated by adding to 5 c.c. of the mixture an excess of

barium chloride solution, as well as a drop of phenolphthalein solution, and titrating with $\frac{1}{5}$ normal oxalic acid, till the red colour has just vanished. Each c.c. of the acid =0.005607 g. CaO.

(b) Total Lime.—5 c.c. of the muddy mixture are put into a flask, a few c.c. of concentrated hydrochloric acid are added, and the whole is boiled till all the gases have been expelled. Cool down a little, add a drop of methyl orange solution, and neutralise exactly with sodium carbonate, i.e. till the red colour has just gone. Then add 30 c.c. of \(\frac{1}{2} \) normal sodium carbonate solution, measured exactly, and heat to boiling, to precipitate all the lime as CaCO₃ (together with any ferric oxide, alumina, and magnesia, the quantity of which is too insignificant to be regarded for this test). Wash the whole into a 200 c.c. flask, fill up to the mark, take 100 c.c. of the clear liquid, and titrate back with \(\frac{1}{5} \) normal hydrochloric acid. Deduct the c.c. used \(\times 2 \) from 30; the difference \(\times 0.005607 = \) total lime, or \(\times 0.010007 = \) calcium carbonate.

(N.B.—These tests cannot be expected to give very accurate results, owing to the almost insurmountable difficulty of obtaining a real average sample of black-ash ball. This, however, applies to all tests made with black-ash.)

2. Tests made with the Clear Portion.—After having made all the tests described under 1, allow the mixture to settle down in the well-corked flask, and take samples of the supernatant,

clear liquid for the following tests:-

(a) Available Alkali and Sodium Carbonate.—10 c.c. (=1 g. black-ash) is titrated cold with hydrochloric acid and methyl orange. This indicates the total available alkali, i.e., Na₂CO₃, NaOH, and Na₂S. (The small quantity of alumina and silica present causes no appreciable error.) By deducting the quantities found in tests Nos. 2 and 3 the quantity of sodium carbonate is found, viz., 005300 g. for each cubic centimetre of normal HCl. It is, however, expressed, like all other sodium compounds, in terms of Na₂O, by multiplying the cubic centimetres of normal acid used by 0.03100.

(b) Caustic Soda is estimated by adding to 20 c.c. of solution, contained in a 100 c.c. flask, an excess of barium chloride (10 c.c. of a 10 per cent. solution of BaCl₂, 2H₂O, will always more than suffice for this), adding boiling water up to the mark, shaking up, and corking the flask. After a few minutes the precipitate settles. Take out 50 c.c. of the clear portion, without filtering,* and titrate with normal hydrochloric acid. When employing methyl orange as indicator, the liquid must be cooled first and the titration must be made slowly, with constant shaking. Each cubic centimetre of the standard acid indicates 0'04001 g. of NaOH in 1 g. of black-ash=0'03100 g. Na₂O, but sodium sulphide is also included.

^{*} The filter paper absorbe an appreciable portion of barium salt.

(c) Sodium Sulphide.—Dilute 10 c.c. of solution to about 200 c.c., employing water freed from oxygen by boiling, acidulate with acetic acid, and titrate quickly with iodine solution, using starch as an indicator. When employing a decinormal iodine solution (12.692 g. I per litre), each cubic centimetre indicates 0.003904 g. Na₂S (=0.003100 g. Na₂O). A solution containing 3.251 g. I per litre would indicate 0.001 g. Na₂S per cubic centimetre. In the former case the number of cubic centimetres of decinormal solution divided by 10 can be deducted at once from the acid employed in test No. 1, whereby the sulphide is eliminated from the alkali test. Other sulphur compounds (except sulphate) need not be taken account of in fresh black-ash.

(d) Sodium Chloride.—Neutralise 10. c.c. of the liquor as accurately as possible with nitric acid, preferably by adding exactly as many cubic centimetres of standard nitric acid (63'02 g. HNO₃ per litre) as had been employed in test No. 1. Boil till all H₂S has been expelled, filter from any sulphur precipitated, add a little neutral potassium chromate, and titrate with silver solution (as described p. 146). Each cubic centimetre of decinormal silver solution indicates 0'005846 g. NaCl. A solution containing 2'9061 g. AgNO₃ per litre corresponds to 0'001 g. NaCl per

cubic centimetre.

(e) Sodium Sulphate.—Acidulate 10 c.c. with a very slight excess of HCl, boil, add barium chloride, filter, wash, and ignite the precipitated BaSO₄. Since the quantity is very small, it can be washed with hot water on the filter itself, which is then placed in the moist state in a platinum crucible and ignited. Each part of BaSO₄=0.6086 Na₂SO₄.

(f) Prepare an average sample of all batches by pouring a certain quantity of the liquor belonging to each batch into a common vessel; carbonate this by passing CO₂ through it, filter, evaporate the filtrate to dryness, and estimate Na₂CO₃, Na₂SO₄,

and NaCl in the residue.

C.—Tank Waste (Vat Waste).

Take a large, really representative, average sample, which should be kept protected from air, and of which 50 g. should be weighed out quickly and in the moist state. Drying in contact with air would considerably change its composition. Moist tank waste may be assumed, without any great error, to contain 40 per cent, of water. Digest the above 50 g. waste with 490 c.c. water of 40° C., which will yield 500 c.c. of liquid.

1. Available Soda (Na₂CO₃, or Na₂S).—Take 100 c.c. of the liquor, pass into it a current of well-washed carbon dioxide, heat the liquid to boiling, bring up the volume again to 100 c.c., pour through a dry filter, and titrate 50 c.c. of the clear portion with

decinormal hydrochloric acid, of which each c.c. will indicate 0.003100 g. Na₂O, or, in this case, 0.0620 per cent. Na₂O on the

moist waste.

2. Total Soda (inclusive of Insoluble Sodium Salts).—Heat 1771 g.* tank waste in a porcelain or iron dish with sulphuric acid of specific gravity 1.5, till all has been decomposed and converted into a stiff paste, evaporate to dryness, heat till all free sulphuric acid has been driven off, add hot water, scrape out the mass, and put it into a 250 c.c. cylinder. Neutralise any free acid left, and precipitate any magnesia present by adding pure milk of lime (obtained from ordinary slaked lime by pouring off the first water, which may contain some alkali), fill up to the mark, allow to settle, take out 50 c.c. of the clear liquor, add 10 c.c. of saturated baryta water, pour the mixture through a dry filter, take 50 c.c. of the filtrate, precipitate all baryta by passing through the liquid CO₂ and boiling, filter, and titrate the filtrate with decinormal hydrochloric acid. Each cubic centimetre of this will indicate 0.1 per cent. of Na₂O in the waste, taking into account its bulk.

3. Total and Oxidisable Sulphur.—Boil 2 g. of the waste with hydrochloric acid, filter, wash with dilute HCl, neutralise the filtrate almost completely by adding sodium carbonate, precipitate with barium chloride, filter, wash, and ignite the barium sulphate. From this the sulphur present as sulphate is calculated (a). Another sample of 2 g. waste is oxidised by a strong bleaching-powder solution and hydrochloric acid, or by a solution of bromine in strong hydrochloric acid. When a strong smell of chlorine persists, all S is oxidised to sulphuric acid. Filter and estimate the $\mathrm{SO_4H_2}$ in the filtrate. This indicates the total sulphur (b). The difference b-a is the oxidisable sulphur, i.e. the theoretically

recoverable maximum of sulphur in the waste.

D.—Tank Liquor (Vat Liquor).

Vat liquor is tested while hot, or else it is kept at about 40° C., to prevent crystallisation. Take out only small samples (2 to 5 c.c.) with an accurate pipette. This greatly facilitates the work.

1. Sodium Carbonate.—Titrate 2 c.c. with standard hydrochloric acid. When employing methyl orange as indicator, first add some cold water. From the volume required deduct that found in test No. 2, and one-tenth of that in test No. 3.

2. Sodium Hydroxide (estimated as on p. 167).

3. Sodium Sulphide is estimated by decinormal iodine solution

^{*} This amount is correct, not 18.6 g., as calculation would seem to show, because an allowance must be made for the bulk of the insoluble residue in the measuringvessels.

(as on p. 168). The error caused by other sulphur compounds is hardly appreciable, and for practical purposes of no consequence. In any case this test must be made in order to correct test No. 1.

4. Sodium Sulphate (as on p. 168).

5. Total Sulphur.—Oxidise the liquor with bleaching powder and hydrochloric acid (as described, C. 3, p. 169), and precipitate with barium chloride.

6. Sodium Chloride (as on p. 168).

7. Sodium Ferrocyanide.—Acidulate 20 c.c. of liquor (or more) with HCl, and add strong bleaching-powder solution from a burette, constantly agitating. From time to time mix a drop of the mixture on a white slab with a drop of dilute ferric chloride When no more Prussian solution, free from ferrous chloride. blue is formed, but the mixture of both drops turns brown, all is oxidised, hence also all ferrocyanide is turned into ferricyanide. A drop of bleach solution in excess does no harm, but if too much excess has been used, or if too much liquor has been lost by taking out test drops, a fresh sample is taken out, which can then be oxidised by running the requisite quantity of bleach liquor from the burette without losing much by making the drop-tests. This method gives quicker and more accurate results than adding an excess of bleach and driving out the chlorine by heating, in which case some ferricyanide may be decomposed. The oxidised liquor is titrated with decinormal copper solution, containing 3.1785 g. Cu. or 12.486 g. crystallised cupric sulphate per litre, which precipitates yellow Cu₃Fe₃Cy₁₂. From time to time test a drop of the liquid by bringing it together on a porcelain slab with a drop of a dilute ferrous sulphate solution. So long as a blue colour is produced by the action of FeSO₄ on Na₃FeCy₆ more copper solution is added, till the test on the slab does not turn blue or grey, but reddish. Now no more Na₃FeCy₆ is present, and the FeSO₄ on the slab reduces the yellow copper ferricyanide to red ferrocyanide. The first sensible reddening must be taken as the final reaction, although it vanishes after a short time. According to theory, each cubic centimetre of the copper solution ought to indicate 0.01013 g. Na₄FeCy₆; but direct experiments (Chem. Ind., 1882, p. 79) have shown this not to be Too little copper solution is employed, and each cubic centimetre of this must therefore be regarded as equal to 0 0123 g. Na₃FeCy₆, or, still better, the copper solution must be standardised by pure potassium ferrocyanide.

8. Silica, Alumina, and Ferric Oxide (Parnell).—Supersaturate 100 c.c. of liquor with HCl, boil, add a large quantity of ammonium chloride and ammonia in excess, and boil till all smell of NH₃ has ceased. The precipitate settles easily, and can be well washed. On washing with hot water it turns intensely blue (owing to the formation of Prussian blue?); on igniting it leaves SiO₂, Al₂O₃,

and Fe₂O₃.

9. A large sample of the liquor is carbonated by passing $\rm CO_2$ through it; it is then filtered, evaporated to dryness, and the residue tested for available alkali, $\rm Na_2SO_4$ and $\rm NaCl$.

E.—Carbonated Liquor.

This is tested like tank liquor (No. D); also for bicarbonate. This is done with sufficient accuracy for practical purposes as follows:—Titrate 10 c.c. of liquor, without diluting it, in the cold

with normal hydrochloric acid, employing phenolphthalein as indicator, until this is decolorised. The temperature should not be much above 0°. The c.c. of $\frac{n}{1}$ HCl used =a. Now add a drop of methyl orange and more acid, until the colour changes; the c.c. $\frac{n}{1}$ HCl used for this =b. Then b-a indicates the bicarbonate, 2a the soda present as Na₂CO₃, a+b the total soda. For other methods, see "Bicarbonate," p. 186.

The most accurate and at the same time the quickest method for estimating carbon dioxide, both in small and in large quantities, is that of Lunge and Rittener (Z. angew. Chem., 1906, p. 1849). Their apparatus is shown in Fig. 16. The small flask B, holding

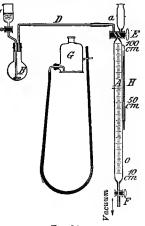


Fig. 16.

about 30 c.c., is provided with a tap funnel C and a long capillary D, which is connected with the lateral capillary of the two-way tap E of the gas-burette A. D should be cut off at the lower surface of the rubber stopper of B. Introduce so much substance (solid or liquid) into B that it cannot yield more than 80 c.c. CO₂; also 15 c.c. of very fine aluminium wire, rolled up in a spiral. Then close B and connect D with tap E of burette A. This is an ordinary Bunte burette; as usual, it is divided in c.c., beginning below the tap E with 100, going downwards to B, then again to -10 c.c., leaving a few c.c. of undivided space down to the tap F. A level-bottle, G, can be connected with F in the ordinary manner; it contains a saturated solution of sodium chloride. At the beginning of the operation F is not connected with G, but with a water-pump which is turned on for two or three minutes, in order to evacuate the apparatus B-D-A. F is then closed

and the capillary below this tap connected with the rubber tube of the level-bottle G. By cautiously opening F, a little of the salt solution is allowed to pass from G through F, till it appears just above this tap in the capillary space of A. This is done in

order to check any leak at F.

If a solution is to be tested which is not previously contained in flask B, it is poured into funnel C, and by cautiously opening the tap it enters into B. Rinse C twice or thrice with a little water, and then introduce through C enough hydrochloric acid to decompose the carbonate and dissolve the aluminium wire. If B contains initially a solid substance or a solution, the acid is of course run in directly through C. In any case this is done drop by drop, to avoid a violent reaction. When the reaction slackens, heat B gently, until the aluminium is dissolved, and then bring the solution to the boil, until drops of water condense in E. Now close E and allow water to enter through C, to completely fill the flask B and the capillary C. If a few small bubbles of gas should remain in C, they are transferred to A by cautiously opening E for a few moments. Next detach the capillary D from E, and wait twenty to twenty-five minutes, so that the gas in A is cooled down to the temperature of the outer air. Read the thermometer H, attached to the upper part of A by means of rubber rings, note also the barometer, cautiously open tap E, until the liquid in G and A stands at the same level, close F, and read the volume of gas in A, preferably by means of a Göckel reading-screen.

Now run a strong solution of caustic soda (1:2 water) through E into A, without taking notice of any precipitation of calcium carbonate, which will take place in A, if a solution of impure common salt has been used in the level-bottle G. Close E, shake A, in order to promote the absorption of CO₂, adjust the liquid in G and A to the same level, read off the volume in A, and introduce more caustic soda solution until this causes no further contraction

of the volume of gas.

The difference between the first reading a and that taken after absorption of the $CO_2=b$ shows the volume of the CO_2 originally present, which is reduced to 0° and 760 mm. in the usual way. Of course regard must be had to the fact that the tension of a saturated NaCl solution is less than that of pure water; for ordinary temperatures it may be put=80 per cent. of the tension of pure water (Table 24, p. 53), so that, e.g., at 15° C. it will be 12 mm. instead of 15 mm.

If you call the volumes of gas, reduced to the normal state, a_1 and b_1 and the weight (or volume) of substance employed n, its percentage of CO_2 is:—

$$\frac{0.19768(a^1-b^1)}{u}$$
.

might be transferred, by raising G, into a Hempel's or Drehschmidt's absorption-pipette, attached to α . This pipette is filled with caustic soda solution. After the CO₂ has been absorbed, the remaining gas is retransferred to A, by raising G. E is then closed, the liquid adjusted to the same level in A and G, and the volume of the gas read and reduced to normal conditions as above.

F.-Mother Liquor.

This is tested like uncarbonated tank liquor, p. 169. But in this case it is necessary to estimate sulphide, sulphate, sulphite, and thiosulphate in the presence of one another. The most convenient method for this purpose is that of Lunge and Smith (Chem. Ind., 1883, p. 301), which is as follows:—

(a) Sulphate is estimated by displacing the air in the flask by CO₂ (to prevent oxidation by air), heating, acidulating, and pre-

cipitating with BaCl₂.

(b) Other Compounds of Sulphur.—In a second sample determine the consumption of decinormal iodine solution, after diluting

with water free from air and acidulating with acetic acid.

(c) To a sample, four times the amount of (b), add zinc acetate or cadmium carbonate, in order to remove the Na₁S, dilute it to a known volume, allow to settle, and take a quarter of the clear liquid for each of the following tests:—

(1) The consumption of decinormal iodine = M.

(2) To another quarter add, without acidulating it, a large excess of permanganate solution of the value W (see below), the solution to be tested being run into the permanganate solution; then an acid solution of ferrous sulphate, of known value against KMnO₄, is added in excess, and the excess is titrated back by permanganate. The total permanganate solution used, less that corresponding to the ferrous sulphate, is called N.

(The value W signifies the quantity of permanganate solution

used in accordance with the equation :—

$$3Na_2S_2O_3 + 8KMnO_4 + H_2O = 3Na_2SO_4 + 3K_2SO_4 + 8MnO_2 + 2KOH$$
,

which is found by calculation, or else experimentally by titration of pure sodium thiosulphate.)

If we call the sulphur of thiosulphate S, that of sulphate s, we

have:-

$$S = \frac{1}{2}(8WN - 0.0064M)$$

 $s = 2WN - 2S$.

By deducting M from the result of the original iodine titration (b) you find the amount of Na₂S.

Another method for the same purpose, by Richardson and Ackroyd, has been published in *Journ. Soc. Chem. Ind.*, 1896, p. 172.

G.—Tables.

1. SPECIFIC GRAVITIES OF SOLUTIONS OF SODIUM
CARBONATE AT 15° C.

Specific	Degrees	Degrees	Per cent.	by weight.		etre contains og.
gravity.	Twaddell.	Baumė.	Na ₂ CO ₃ .	Na ₂ CO ₃ , 10 aq.	Na ₂ CO ₃ .	Na ₂ CO ₃ , 10 aq.
1.000	0	0	0.00	0.00	0.00	0.00
1.005	ľ	0.7	0.45	1.21	4.52	12.16
1.010	$\overline{2}$	1·4	0.91	2.46	9.19	24.85
1.015	3	2.1	1.39	3.75	14.11	38.06
1.020	4	2.7	1.90	5.13	19.38	52.33
1.025	5	3.4	2.35	6:34	24.09	64.99
1.030	6	4.1	2.82	7.61	29.05	78:38
1.035	7	4.7	3.27	8.82	33.84	91.29
1.040	8	5.4	3.74	10.09	38.90	104.94
1.045	9	6.0	4.21	11.36	43.99	118.71
1.050	10	6.7	4.70	12.68	49.35	133.14
1.055	11	7•4	5.17	13.95	54.54	147.17
1:060	12	8.0	5.65	15.24	59-89	161.54
1.065	13	8.7	6.15	16.59	65.50	176.68
1 070	14	9.4	6.63	1.7 .89	70.94	191.42
1.075	15	10.0	7.08	19:10	76.11	205:33
1.080	16	10.6	7.56	20 40	81.65	220:32
1.085	17	11.2	8.03	21.67	87:13	235 12
1.090	18	11.9	8.48	22.88	92.43	249:39
1.095	19	12.4	8.90	24.01	97.46	262.91
1.100	20	13.0	9.31	25.12	102.41	276:32
1.105	21	13.6	9.80	26.44	108.29	292 16
1.110	22	14.2	10.27	27.71	114.00	307.58
1·115 1·120	23	14.9	10.75	29.00	119.86	323 35
1.120	24	15.4	11.22	30.27	125.66	339.02
1.125	25 26	16.0	11.67	31.49	131.29	354.26
1.135	26 27	16.5 17.0	12.17	32.83	137.52	370.98
1.140	28	17.7	12.64 13.08	34.10	143.46	387.04
1.145	29	18.3	13.20	35·29 36·42	149·11 154·58	402.31
1.150	30	18.8	13.94	37.61	160:31	417.01
1.155	31	19.3	14.34	38 69	165.63	432.52
1 100		***	AT UT	90 00	100 09	446.87
!	!	!				

2. SPECIFIC GRAVITIES OF CONCENTRATED SOLUTIONS OF SODIUM CARBONATE AT 80° C.*

Spacific	Dagrees	Degrees	Per cent.	by weight.		tra contains log.
gravity at 80°.	Twaddell.	Baumé.	Na ₂ CO ₃ .	Na ₂ CO ₃ , 10 aq.	Na ₂ CO ₃ .	Na ₂ CO ₃ , 10 aq.
1·310 1·305 1·300 1·295 1·290 1·285 1·280 1·275 1·265 1·265 1·260 1·255 1·245 1·245 1·230 1·225 1·220 1·215 1·210 1·205 1·200 1·195	62 61 60 59 58 57 56 55 54 52 51 50 49 48 47 46 45 44 43 42 41 40 39	34·2 33·7 33·3 32·8 32·4 32·0 31·5 31·1 30·6 20·7 20·3 28·8 28·9 27·4 26·9 26·0 25·5 24·0 23·5	28·08 27·66 27·25 26·84 26·42 26·00 25·60 25·18 24·74 24·28 23·85 23·43 22·22 21·80 21·37 20·96 20·55 20·12 19·67 19·26 18·83 18·42	75·76 74·63 73·52 72·41 70·15 69·07 67·94 66·75 65·51 64·35 63·21 62·14 61·06 59·95 58·95 58·95 55·54 55·54 54·28 53·07 51·96 50·80 49·70	367·85 360·96 354·25 347·58 340·82 334·10 327·68 321·05 314·20 307·14 300·51 294·05 287·88 281·74 275·53 262·85 256·76 244·46 238·01 232·08 225·96 220·42	992·46 973·92 955·76 937·71 919·51 901·43 884·10 866·24 847·73 828·70 810·81 798·29 776·75 760·20 743·38 776·20 743·38 776·20 743·38 766·21 692·73 676·37 659·50 642·15 626·12 609·60 594·22
1·190 1·185 1·180 1·175 1·170 1·165 1·160 1·155 1·150 1·145 1·140	38 37 36 35 34 33 32 31 30 29 28	23.0 22.5 22.0 21.4 20.9 20.3 19.8 19.8 19.3 18.8 18.3	18:00 17:55 17:09 16:62 16:16 15:70 15:25 14:84 14:42 14:02 13:61	48.56 47.35 46.11 44.84 43.60 42.36 41.14 40.04 38.91 37.83 36.72	214·20 207·97 201·66 195·29 189·07 182·91 176·90 171·40 165·83 160·58 155·15	577·84 561·10 526·87 510·12 493·49 477·22 462·46 447·47 433·15 418·61

^{*} This temperature has been specially chosen, because the higher concentrations of sodium carbonate cannot exist in solution at lower temperatures.

8. INFLUENCE OF TEMPERATURE ON THE SPECIFIC

0° C.	5°.	10°.	15°.	20°.	25°	30°.	85°.	40°.	45°	50°.
						1·285 1·274 1·263 1·252	1.282 1.271 1.260 1.250	1·279 1·267 1·257 1·247	1.276 1.265 1.254 1.244	1·273 1·262 1·251 1·240
	:••		1.240	1.238	 1 ·236	1.241	1.239	1.236	1.233	1.230
			1·230 1·220 1·210 1·200	1·228 1·218 1·208 1·198	1·225 1·215 1·206 1·196	1·223 1·213 1·204 1·194	1.221 1.210 1.201 1.192	1·219 1·208 1·199 1·189	1·216 1·205 1·196 1·186	1·213 1·201 1·192 1·183
1·198	1·195	1·193	1·190	1·188	1·186	1·184	1·182	1·179	1·176	1·173
1·188	1·185	1·183	1·180	1·178	1·176	1·174	1·172	1·169	1·166	1·163
1·177	1·174	1·172	1·170	1·168	1·166	1·164	1·162	1·160	1·157	1·154
1·166	1·164	1·162	1·160	1·158	1·156	1·154	1·152	1·150	1·148	1·145
1·156	1·154	1·152	1·150	1·148	1·146	1·144	1·142	1·139	1·136	1·134
1·146	1·144	1·142	1·140	1·138	1·136	1·134	1·132	1·129	1·126	1·123
1·136	1·134	1·132	1·130	1·128	1·126	1·124	1·122	1·120	1·117	1·114
1·126	1·124	1·122	1·120	1·118	1·116	1·114	1·112	1·110	1·107	1·104
1·116	1·114	1·112	1·110	1·108	1·106	1·104	1·102	1·100	1·098	1·095
1·106	1·104	1·102	1·100	1·098	1·096	1·094	1·092	1·090	1·088	1·085
1.096	1:094	1.092	1.090	1.088	1.086	1.084	1.082	1.080	1.078	1.075
1.086	1:084	1.082	1.080	1.078	1.076	1.074	1.072	1.070	1.068	1.065
1.075	1:073	1.071	1.070	1.069	1.067	1.065	1.063	1.061	1.059	1.056
1.064	1:063	1.061	1.060	1.059	1.057	1.056	1.054	1.052	1.050	1.047
1.053	1:052	1.051	1.050	1.049	1.048	1.046	1.044	1.042	1.040	1.037
1.043	1:042	1.041	1.040	1.039	1.038	1.036	1:034	1:032	1:030	1.027
1.033	1:032	1.031	1.030	1.029	1.028	1.026	1:024	1:022	1:020	1.017
1.023	1:022	1.021	1.020	1.019	1.018	1.016	1:014	1:012	1:010	1.007
1.013	1:012	1.011	1.010	1.009	1.008	1.006	1:004	1:002	1:000	0.997

GRAVITIES OF SOLUTIONS OF SODIUM CARBONATE,

55°.	60°.	65°.	70°.	75°.	80°.	85°.	90°.	95°.	100°.
1·270	1·267	1.264	1·260	1.256	1.252	1·247	1·243	1·238	1·234
1·259	1·256	1.253	1·249	1.244	1.240	1·236	1·232	1·228	1·224
1·248	1·245	1.241	1·237	1.233	1.229	1·226	1·222	1·218	1·215
1·237	1·234	1.230	1·227	1.224	1.220	1·217	1·213	1·210	1·206
1·226	1·223	1.220	1·216	1.213	1.210	1·207	1·204	1·200	1·197
1.220	1.217	1.213	1·210	1.206	1·203	1·199	1·195	1·191	1·188
1.209	1.206	1.202	1·199	1.195	1·192	1·188	1·184	1·181	1·178
1.198	1.194	1.191	1·188	1.184	1·181	1·178	1·174	1·171	1·168
1.189	1.185	1.182	1·178	1.175	1·172	1·168	1·165	1·162	1·159
1.179	1.176	1.172	1·168	1.165	1·162	1·158	1·155	1·152	1·149
1·169	1·166	1·163	1·159	1·156	1·153	1·149	1·146	1·143	1·140
1·160	1·156	1·153	1·150	1·147	1·144	1·140	1·137	1·134	1·131
1·151	1·147	1·144	1·141	1·138	1·135	1·131	1·128	1·125	1·122
1·142	1·139	1·136	1·133	1·130	1·126	1·123	1·120	1·117	1·114
1·131	1·128	1·125	1·122	1·119	1·116	1·113	1·110	1·107	1·104
1·120	1·118	1·115	1·112	1.109	1·106	1.103	1.100	1:097	1:094
1·111	1·108	1·105	1·102	1.099	1·096	1.093	1.090	1:087	1:084
1·101	1·098	1·095	1·092	1.089	1·086	1.083	1.080	1:077	1:074
1·092	1·089	1·086	1·083	1.080	1·077	1.074	1.071	1:068	1:065
1·082	1·079	1·076	1·073	1.070	1·067	1.064	1.061	1:058	1:055
1.072	1.070	1.067	1.064	1.061	1.058	1:055	1.052	1.049	1.046
1.062	1.060	1.057	1.054	1.052	1.049	1:046	1.043	1.040	1.038
1.053	1.051	1.048	1.045	1.043	1.040	1:037	1.034	1.032	1.029
1.044	1.041	1.038	1.036	1.032	1.030	1:028	1.025	1.023	1.020
1.034	1.032	1.029	1.027	1.024	1.021	1:019	1.016	1.014	1.011
1.024	1.022	1.019	1.017	1.015	1.012	1.010	1.007	1.005	1.003
1.014	1.012	1.009	1.007	1.005	1.002	1.000	0.997	0.995	0.993
1.004	1.002	0.999	0.997	0.995	0.992	0.990	0.987	0.985	0.983
0.994	0.992	0.989	0.987	0.985	0.982	0.980	0.977	0.975	0.973

H.—Analysis of Commercial Soda Ash.

When merely the available alkali (alkalimetrical degree) has to be ascertained, it is convenient to weigh out 15.5 g., to dissolve in a 500 c.c. flask, and to take for each test 50 c.c. (in Germany, without filtering; in England, sometimes with, sometimes with, out). In this case each cubic centimetre of standard acid indicates 0.03100 g. Na₂O, or just 2 per cent. of available alkali (Na₂O). The standard acid is normal hydrochloric acid, containing 36.468 g. HCl per litre, and is standardised both with pure sodium carbonate and with silver nitrate. (Cf. Appendix.) The indicator is either litmus (in which case the solution has to be boiled for some time) or more conveniently, methyl orange (which is used with cold solutions).

If the percentage of alkali is to be calculated in terms of Na_2CO_3 , as is usual in Germany and other countries, 2.6500 g. is weighed out, dissolved, and titrated (without filtering) with normal hydrochloric acid, each c.c. of which indicates 2 per cent. Na_2CO_3 in this case. In Germany the samples are ignited before weighing, and the percentage is always stated for soda ash in

this dry state.

For a complete analysis of commercial soda ash 50 g. are dissolved in warm water.

- 1. The Insoluble Residue is filtered and washed, the filtrate and washings are diluted up to 1 litre, and the following tests are made with this solution.
- 2. Sodium Carbonate is found by titrating 20 c.c. (equal to 1 g. of soda ash) with normal HCl, deducting the amount of No. 3. That of No. 4 is always too small to consider in this case.
- 3. Sodium Hydroxide is estimated by barium chloride, according to p. 167.
- 4. Sodium Sulphide.—100 c.c. (equal to 5 g. of ash) are titrated with ammoniacal silver nitrate (cf. Appendix), containing 13.818 g. Ag. per litre, and indicating 0.005 g. Na₂S per cubic centimetre. Heat the soda liquor to boiling, add ammonia, and run in the silver solution from a burette divided in $\frac{1}{10}$ c.c., till no further black precipitate of Ag₂S is produced. In order to observe this more accurately the liquid is filtered towards the end of the operation, and the titration is continued if necessary. This filtration is repeated several times. Each cubic centimetre of silver solution indicates 0.1 per cent. of Na₂S in the alkali.
- Sodium Sulphide.—Acidulate 100 c.c. (equal to 5 g. soda ash) with acetic acid, add starch solution, and titrate with iodine till a blue colour appears. A decinormal iodine solution corre-

sponds to 0.006304 g. Na₂SO₃ per cubic centimetre (in this case 0.126 per cent.). The solution mentioned on p. 169 of 3.251 g. iodine per litre, corresponds to 0.001615 g. Na₂SO₃ (in this case 0.0323 per cent.). From this should be deducted the amount corresponding to test No. 4; 1 c.c. of the silver solution can be regarded as equal to 1.3 c.c. of the decinormal, or equal to 5.0 c.c. of the weaker iodine solution.

- 6. Sodium Sulphate.—Acidulate 20 c.c. of the solution (equal to 1 g. soda ash) with hydrochloric acid, precipitate with barium chloride, as on p. 109, and weigh the BaSO₄, of which 1.000 part is equal to 0.6086 part Na₂SO₄.
- 7. Sodium Chloride.—Neutralise 20 c.c. (equal to 1 g. soda ash) exactly with nitric acid, preferably by adding exactly as many cubic centimetres normal nitric acid from a burette as had been used in test No. 1; then add neutral potassium chromate, and titrate with decinormal silver nitrate as described on p. 146. Each cubic centimetre of this corresponds to 005846 g. NaCl.
- 8. Iron.—Neutralise 100 c.c. (equal to 5 g. soda ash) with sulphuric acid free from iron, reduce with zinc free from iron (p. 143), and titrate with $\frac{1}{20}$ normal potassium permanganate, of which each cubic centimetre corresponds to 0.002793 g. Fe, or in this case 0.0559 per cent. Fe.
- 9. Sodium Silicate is not present in appreciable quantities in ordinary soda ash, but always in the ash recovered from the liquor used in the manufacture of wood "cellulose." It is estimated by acidulating 20 c.c. (equal to 1 g. soda ash) with HCl, filtering the SiO_2 , drying, and igniting. 1 g. $SiO_2 = 2.028$ g. Na_2SiO_3 .
- 10. Table for comparing French, German, and English Commercial Alkalimetrical Degrees.—The French or Descroizilles degrees mean the quantity of real sulphuric acid, SO₄H₂, neutralised by 100 parts of soda ash. The German degrees express the available alkali in terms of sodium carbonate, Na₂CO₃. In England some works invoice in real per cent. of soda, Na₂O, as found in the first column of the following tables. The Newcastle test is based on the equivalent 32 for Na₂O, or 59'26 degrees for pure Na₂CO₃, and invoices fractions of degrees.

FRENCH, GERMAN, AND ENGLISH COMMERCIAL ALKALIMETRICAL DEGREES.

Real Soda. Na ₂ O.	German degrees. Na ₂ CO ₃ .	New- castle degrees.	French degrees.	Real Soda. Na ₂ O.	German degrees. Na ₂ CO ₃ .	New- castle degrees.	French degrees.
0.5	0.86	0.51	0.79	18	30.78	18·23	28·45
1	1.71	1.01	1.58	18·5	31.64	18·74	29·24
1.5	2.57	1.52	2.37	19	32.49	19·25	30·03
2	3.42	2.03	3.16	19·5	33.35	19·76	30·82
2.5	4.28	2.54	3.95	20	34.20	20·26	31·61
3	5·13	3.04	4.74	20.5	35.06	20·77	32·40
3.5	5·99	3.55	5.53	21	35.91	21·27	33·19
4	6·84	4.05	6.32	21.5	36.77	21·78	33·98
4.5	7·70	4.56	7.11	22	37.62	22·29	34·77
5	8·55	5.06	7.90	22.5	38.48	22·80	35·56
5.5	9:41	5.57	8.69	23	39:33	23·30	36·35
6	10:26	6.08	9.48	23·5	40:19	23·81	37·14
6.5	11:12	6.59	10.27	24	41:04	24·31	37·93
7	11:97	7.09	11.06	24·5	41:90	24·82	38·72
7.5	12:83	7.60	11.85	25	42:75	25·32	39·51
8 8.5 9 9.5	13.68 14.54 15.39 16.25 17.10	8·10 8·61 9·12 9·63 10·13	12.64 13.43 14.22 15.01 15.81	25.5 26 26.5 27 27.5	43.61 44.46 45.32 46.17 47.03	25·83 26·34 26·85 27·35 27·86	40·30 41·09 41·88 42·67 43·46
10.5	17:96	10.64	16.60	28	47.88	28·36	44·25
11	18:81	11.14	17.39	28.5	48.74	28·37	45·04
11.5	19:67	11.65	18.18	29	49.59	29·38	45·83
12	20:52	12.17	18.97	29.5	50.45	29·89	46·62
12.5	21:38	12.68	19.76	30	51.30	30·39	47·42
13 13·5 14 14·5	22·23 23·09 23·94 24·80 25·65	13·17 13·68 14·18 14·69 15·19	20·55 21·34 22·13 22·92 23·71	30.5 31 31.5 32 32.5	52·16 53·01 53·87 54·72 55·58	30·90 31·41 31·91 32·42 32·92	48.21 49.00 49.79 50.88 51.37
15.5	26.51	15·70	24.50	33	56·43	33·43	52·16
16	27.36	16·21	25.29	33·5	57·29	33·94	52·95
16.5	28.22	16·73	26.08	34	58·14	34·44	53·74
17	29.07	17·22	26.87	34·5	59·00	34·95	54·53
17.5	29.93	17.73	27.66	35	59.85	35.46	55.32

FRENCH, GERMAN, AND ENGLISH COMMERCIAL ALKALIMETRICAL DEGREES—Continued.

		1		1			
Reel Sods. Na ₂ O.	German degrees. Na ₂ CO ₃ .	New- castle degrees.	French degrees.	Resl Sods. Na ₂ O.	German degrees. Na ₂ CO ₃ .	New- castle degrees.	French degrees.
35.5	60·71	35·96	56·11	53	90.63	53·70	83·77
36	61·56	36·47	56·90	53·5	91.49	54·20	84·56
36.5	62·42	36·98	57·69	54	92.34	54·71	85·35
37	63·27	37·48	58·48	54·5	93·20	55·22	86·14
37·5	64·13	37·98	59·27	55	94·05	55·72	86·93
38	64.98	38.50	60.06	55.5	94·91	56·23	87.72
38•5	65.84	39.00	60.85	56	95·76	56·74	88.52
39	66.69	39.51	61.64	56.5	96·62	57·24	89.31
39•5	67.55	40.02	62.43	57	97·48	57·75	90.10
40	68.40	40.52	63.22	57.5	98.33	58.26	90.89
40.5	69.26	41.03	64.01	58	99·18	58.76	91.68
41	70.11	41.54	64.81	58·5	100·04	59.72	92.47
41.5	70.97	42.04	65.60	59	100·89	59.77	93.26
42	71.82	42.55	66.39	59·5	101·75	60.28	94.05
42.5	72.68	43.06	67·18 67·97	60 60·5	102.60	60.79	94.84
43·5	74·39	44.07	68·76	61	104·31	61·80	96·42
44	75·24	44.58	69·55	61·5	105·17	62·31	97·21
44.5	76·10	45.08	70·34	62	106.02	62·82	98·00
45	76·95	45.69	71·13	62·5	106.88	63·32	98·79
45.5	77.81	46·10	71·92	63	107·73	63.83	99.58
46	78.66	46·60	72·71	63·5	108·59	64.33	100.37
46.5	79.52	47·11	73·50	64	109·44	64.84	101.16
47	80.37	47·62	74·29	64·5	110·30	65.35	101.95
47.5	81·23	48·12	75·08	65	111·15	65·85	102·74
48	82·08	48·63	75·87	65·5	112·01	66·36	103·53
48.5	82.94	49·14	76.66	66	112·86	66.87	104·32
49	83.79	49·64	77.45	66·5	113·72	67.37	105·11
49.5	84.65	50·15	78.24	67	114·57	67.88	105·90
50	85·50	50·66	79·03	67·5	115·43	68·39	106·69
50•5	86·36	51·16	79·82	68	116·28	68·89	107·48
51	87·21	51.67	80.61	68.5	117·14	69·40	108·27
51·5	88·07	52.18	81.40	69	117·99	69·91	109·06
52	88·92	52.68	82.19	69.5	118·85	70·41	109·85
52·5	89·78	53.19	82.98	70	119·70	70·92	110·64

FRENCH, GERMAN, AND ENGLISH COMMERCIAL ALKALI-METRICAL DEGREES—Continued.

Real Soda. Na ₂ O.	German degrees. Na ₂ CO ₃ .	New- castle degrees.	French degrees.	Real Soda. Na ₂ O.	German degrees. Ns ₂ CO ₃ .	New- caetle degrees.	French degrees.
70·5 71 71·5 72 72·5	120.56 121.41 122.27 123.12 123.98	71·43 71·93 72·44 72·95 73·45	111.43 112.23 113.02 113.81 114.60	75·5 76 76·5 77 77·5	129·11 129·96 130·82 131·67 132·53	76·49 77·00 77·51 78·01 78·52	119·34 120·13 120·92 121·71 122·50
73 73·5 74 74·5 75	124·83 125·69 126·54 127·40 128·25	73·96 74·47 74·97 75·48 75·99	115·39 116·18 116·97 117·76 118·55				į.

I.—Sulphur Recovery (Chance Process).

1. Estimation of Sulphur as Sulphide in Vat Waste.—The apparatus consists of a small flask fitted with a stopcock funnel and outlet tube connected with two Mohr's potash bulbs, the first one being empty, the second containing a strong solution of caustic potash. (In lieu of Mohr's bulbs a tube of the shape shown in Fig. 8, p. 119, can be employed with great advantage.) It is preferable to connect the last potash bulb to an aspirator or Bunsen pump, to produce a slight vacuum. About 2 g. of vat waste is put into the flask, and a sufficient quantity of water is added. Then hydrochloric acid, diluted with its volume of water. is run in from the funnel gradually. After the decomposition has ceased, the solution is boiled, until the whole of the gases are displaced by steam, most of the steam condensing in the first empty potash bulbs. When enough steam has been produced to bring the first bulb of the second set, filled with potash solution, up to boiling, the tap of the funnel is opened, and the apparatus allowed to cool down. The potash solution is then transferred to a $\frac{1}{4}$ or $\frac{1}{2}$ litre flask, made up to the mark, an aliquot part taken, diluted with a large quantity of previously boiled water (free from air), neutralised with acetic acid, and titrated with decinormal iodine, each c.c. of which indicates 0 001604 g. S.

2. Sulphur as Sulphide in Carbonated Mud.—About 6 g. is taken for analysis; otherwise the test is conducted just like the preceding one.

3. Sulphide-sulphur + Carbonic Acid in Vat Waste.—This test

(which is only exceptionally made) is carried out in a small flask, fitted with stopcock funnel, connected with a U-tube containing sodium sulphate to absorb any traces of HCl passing over, and a sufficient number of chloride of calcium tubes to thoroughly dry the gases. To the last of these are connected two weighed potash bulbs containing a strong solution of caustic potash, followed by weighed CaCl₂ tubes. The whole apparatus being connected, 2 g. of vat waste is put into the flask, and some water added. current of nitrogen is then passed through the apparatus to displace the air. The nitrogen for this purpose is conveniently made by passing lime-kiln gases through a solution of caustic soda, then through a red-hot tube containing bright copper clippings to absorb any oxygen, and finally through solutions of caustic potash and barium hydroxide.] The vat waste is then decomposed by hydrochloric acid, and the contents of the flask are boiled. Afterwards a current of nitrogen is passed through the apparatus for a considerable time to displace the H2S and CO2 in the flask and drving tubes. The potash bulbs and the last drying tubes are reweighed, the increase showing the amount of HoS+COo in the vat waste employed. The potash solution is then transferred to a measuring flask, and the H₂S estimated as described in 1. Deducting the amount from the increase of weight of the absorbing apparatus, we find the amount of CO₂ present.

4. Sulphur as Sulphide in Solutions of Calcium or Sodium Sulphydrates and Sulphides.—10 c.c. is diluted to 250, and of this liquid a convenient portion is taken out, largely diluted with air-free water, acidulated with acetic acid, and titrated with iodine, as in test 1. If thiosulphates are present, they are estimated as in 5, and deducted. If polysulphides are present, the sulphur which would be precipitated by an acid is not estimated by this method, but only that which would be liberated as H₂S

by an acid.

5. Soda, Lime, and Thiosulphate in Sulphur Liquors.—In one sample of the liquor, say 5 c.c., estimate the total alkalinity, i.e. Na₂O+CaO, by standard hydrochloric acid and methyl orange. Take another sample, say 50 c.c., pass pure CO₂ in till lead paper shows the absence of all sulphides, boil to decompose calcium bicarbonate, dilute with water to 500 c.c., allow the precipitate to settle, take 50 c.c. of the clear liquor and titrate again, the alkalinity this time being due to Na₂O only. CaO is found from the difference between the two titrations.

Another sample of the carbonated liquor is titrated with decinormal iodine for thiosulphate. Each c.c. of iodine solution

indicates 0.006414 g. S. as thiosulphate.

6. Lime-kiln Gases.—CO₂ is estimated by an Orsat apparatus, or a Honigmann burette, or any other similar apparatus. When using an Orsat apparatus, the test for oxygen can be made as on p. 95.

7. Gas from Gas-holder.

(a) Hydrogen Sulphide + Carbon Dioxide are estimated by an

Orsat apparatus or a Honigmann burette, etc.

(b) Hydrogen Sulphide only.—A wide-mouthed bottle of known capacity, holding about 500 c.c., is fitted with a rubber cork and two tubes, one nearly reaching to the bottom, the other ending just below the cork, both of them with stopcocks outside. Gas is passed through for some time, till it has entirely displaced the air in the bottle. Then 20 or 25 c.c. of standard potash solution is run in from a pipette, through one of the stopcocks, the bottle is well shaken until the whole of the H₂S and CO₂ are absorbed, the contents of the bottle are poured into a measuring flask, the bottle is rinsed out completely, and the total liquid made up to the mark.

An aliquot portion is taken out, largely diluted with previously boiled water, acidified with acetic acid, and the H₂S estimated by iodine. In this case a solution of iodine is employed containing 11:463 g. I per litre, each c.c. of which indicates 1 c.c. of gaseous H₂S at 0° C. and 760 mm. pressure. For somewhat exact estimations, the temperature, pressure, and vapour tension have to be taken into account; but it is unnecessary to observe the thermometer and barometer, and to make any complicated calculations, if a Lunge's gas-volumeter be used (p. 139). In this case the level-tube, C, of the instrument is placed so that the mercury stands at the same height in C as in the reduction tube B; the height of mercury in the latter is read off, which gives the volume occupied by 100 c.c. of dry air of 0° and 760 mm. under the prevailing atmospheric conditions; the number of c.c. of iodine solution, multiplied by 100, is divided by this figure, and thus the correction of the normal volume effected.

8. Exit Gases from the Claus Kilns.—These contain SO2 and H₂S. Both these gases, on being passed through iodine solution, produce 2HI for each atom of S; but whilst H₂S does not further increase the acidity of the solution, SO₂ produces its equivalent of H2SO4. Hence SO2 and H2S are measured together by the amount of iodine converted into HI, and SO, by the acidity present after the HI has been saturated with caustic soda. Since the current of gases carries away some iodine from the decinormal solution, the gases must be passed through caustic soda, or, better, through sodium thiosulphate, to intercept this iodine. The manipulation is hence as follows: Aspirate one or more litres of the gases through 50 c.c. of decinormal iodine solution, contained in a bulb apparatus (Fig. 8, p. 119), or other efficient absorbing-tubes, followed by another apparatus containing 50 c.c. of decinormal thiosulphate solution. Empty the contents of both apparatus into a beaker, and titrate with decinormal iodine and starch solution, till a blue colour appears. The number of c.c. of iodine solution used, if multiplied by 0.001604 g. indicates the total sulphur present as SO_2 and H_2S . Now add a drop of thiosulphate solution to discharge the blue colour, then a drop of methyl orange, and decinormal caustic soda from a burette, till the pink colour of the liquid is discharged. The number of c.c. of caustic soda used, less those of iodine used in the preceding test, multiplied by 0 001604, indicates the sulphur present as SO_2 .

VI. MANUFACTURE OF SODA BY THE AMMONIA PROCESS.

A.—Raw Materials.

1. Rock Salt, compare p. 146.

2. Brine.—The following determinations are made: --

(a) Specific Gravity, by the hydrometer.

(b) Chlorine, expressed as NaCl. Dilute 10 c.c. to 1 litre, and

titrate 10 c.c. of the diluted solution as on p. 146.

(c) Sulphates.—Dilute 50 c.c. brine to 150 or 200 c.c., add a little hydrochloric acid, and precipitate with barium chloride as

on p. 109.

(d) Ferric Oxide and Alumina.—To 500 c.c. brine add a little nitric acid, heat to 80°, precipitate by an excess of ammonia, digest for half an hour at 80°, filter, and wash well. As a check, redissolve the precipitate in hydrochloric acid and reprecipitate it by ammonia.

In the filtrate lime and magnesia may be estimated as on

p. 147.

(e) Bicarbonates of Iron, Lime, and Magnesia.—Destroy the bicarbonates as such by prolonged boiling of 500 c.c., replace the water driven off, filter the precipitate formed, wash it, dissolve it in hydrochloric acid, and in the solution estimate the iron by precipitation with NH₃, and lime and magnesia in the ordinary way.

3. Concentrated Gas Liquor or Sulphate of Ammonia, cf.

Chapter XI., pp. 217 and 219.

4. Limestone, cf. p. 157.
5. Quicklime, cf. p. 158.
6. Coals or Coke, cf. p. 93.

B.—Tests made during the Process of Manufacture.

1. Ammoniacal Brine from the receivers.

(a) Sodium Chloride.—Acidulate with nitric acid and estimate the NaCl by AgNO₃ gravimetrically, or volumetrically in the neutral or faintly alkaline solution as on p. 146.

(b) Ammonia, free and combined.—Dilute 10 c.c. to 100 c.c. and boil in a distilling flask until all the free ammonia and ammonium carbonate has been expelled; absorb this in a measured volume of normal sulphuric acid, and titrate back. To the solution remaining in the flask add caustic soda solution, distil again, and absorb this "combined" ammonia also in sulphuric acid. Cf. Chapter XI., p. 217.

2. Carbonators.—Free and combined NH₃ are estimated as

in No. 1 (b).

3. Mother Liquor.—Estimate:—

(a) NH₃, free and combined, as above.

(b) Undecomposed NaCl, by evaporating 10 c.c. in a platinum dish, heating until all NH₄Cl is expelled, and weighing.

4. Crude Bicarbonate. - Estimate :-

(a) The Alkalimetrical Degree, as on p. 167.

(b) CO_2 as on p. 171.

(c) Moisture, by igniting and allowing for the CO₂ present as bicarbonate and found in (b).

5. Distillation of Ammonia:

(a) NH_3 , free and combined, in the mother liquor, as in No. 1 (b).

(b) Milk of lime, as on p. 158.

(c) Excess of lime in the stills. Boil 100 c.c. until all NH_3 has been expelled, add a little ammonium sulphate, and boil again. The NH_3 now set free, which corresponds to the excess of lime, is absorbed in standard sulphuric acid and titrated.

6. Lime-kiln Gases.—Estimate the CO₂ as on p. 95.

C.—Commercial Products.

1. Soda Ash, as on p. 178.

2. Commercial Bicarbonate is tested like the crude, No. 1, or very accurately by heating in an air-bath to 270° and receiving the gas in a Lunge's gas-volumeter, p. 139 (compare Lunge, Z. angew. Chem., 1897, p. 522).

VII. CAUSTIC SODA.

A.—Caustic Liquor.

(a) Test for available alkali and sodium carbonate (as described p. 167). An exact estimation of CO₂, which is rarely necessary in this case, could be made by expelling it with dilute sulphuric acid, and absorbing it in soda-lime, or, preferably, by Lunge and Rittener's method, p. 171.

(b) SPECIFIC GRAVITIES OF SOLUTIONS OF SODIUM HYDROXIDE AT 15 $^{\circ}$ C.

Specific	Degrees	Degrees	Per cent.	Per cent.	1 cb.m. c	ontains kg.
Gravity.	Twaddell.	Baumé.	Na ₂ O.	NaOH.	Na ₂ O.	NaOH.
1.000	0	0_	0	0.00	0	0
1.005	1	0.7	0.33	0.43	3.31	4.32
1.010	2	1.4	0.67	0.86	6.77	8.69
1.015	3	2.1	0.99	1.28	10.05	12.99
1.020	4	2.7	1.31	1.69	13.36	17.24
1.025	5	3.4	1.65	2.13	16.91	21.83 26.78
1.030 1.035	6 7	4·1 4·7	2·02 2·37	2.60 3.06	20·81 24·53	31.67
1.040	- 8	5.4	2.71	3.00	28.18	36.40
1.040	9	6.0	3.02	3.90	31.26	40.76
1.050	10	6.7	3.36	4.34	35.28	45.57
1.055	11	7.4	3.69	4.76	38.93	50.22
1.060	12	8.0	4.03	5.20	42.72	55.12
1.065	13	8.7	4.39	5.67	46.75	60.39
1.070	14	9.4	4.75	6.13	50.83	65.59
1.075	15	10.0	5.10	6.58	54.83	70.74
1.080	16	10.6	5.46	7.05	58.97	76.14
1.085	17	11.2	5.81	7.50	63.04	81.38
1.090	18	11.9	6.16	7.95	67.14	86.66
1.095	19	12.4	6.50	8.39	71.18	91.87
1.100	20	13.0	6.81	8.78	74.91	96.58
1.105	21	13.6	7.15	9.23	79.01	101.99
1.110	22	14.2	7.50	9.67	83.25	107:34
1.115	23	14.9	7.84	10.12	87.42	112.84
1.120	24	15.4	8.18	10.56	91.62	118.27
1.125	25	16.0	8.57	11.06	96.41	124.43
1.130	26	16.5	8.95	11.55	101.14	130.52
1.135	27	17.0	9.32	12.02	105.78	136.43
1.140	28	17.7	9.68	12.49	110.35	142.39
1.145	29	18:3	10.03	12.94	114.84	148.16
1.150	30	18.8	10.34	13.34	118.91	153.41
1.155	31	19.3	10.67	13.76	123.24	158 93
1.160	32	19.8	11.00	14.19	127.60	164.60
1.165	33	20.3	11.33	14.62	131.99	170.32
1.170	34	20.9	11.67	15.06	136.54	176.20
1.175	35	21.4	12.04	15.53	141.47	182.48
1.180	36	22.0	12.40	16.00	146.32	188.80
1.185	37	22.5	12.75	16.45	151.09	194.93
1.190	38	23.0	13.11	16.91	156.01	201.23
1.195	39	23.5	13.46	17:36	160.85	207.45
1.200	40 41	24.5	13·80 14·15	17.81 18.26	165·60 170·51	213·72 220·03
1.205	41	24.5	14.10	10.50	710.9T	420.03
		1				

(b) SPECIFIC GRAVITIES OF SOLUTIONS OF SODIUM HYDROXIDE AT 15° C.—Continued.

	,			. —		
Specific	Degrees	Degrees	Per cent,	Per cent.	1 cb.m. c	ontaine kg.
Gravity.	Twaddell.	Baumé.	Na ₂ O.	NaOH.	Na ₂ O.	NaOH.
1.210	42	25.0	14.50	18.71	175.45	226:39
1.215	43	25.5	14.87	19.18	180.67	233.04
1.220	44	26.0	15.23	19.65	185.81	239.73
1.225	45	26.4	15.59	20.12	190.98	246.47
1.230	46	26.9	15.97	20.60	196.43	253.38
1.235	47	27.4	16.30	21.03	201:31	259.72
1.240	48	27.9	16.64	21 .47	206.34	266.23
1.245	49	28.4	16.97	21.90	211.28	272.66
1.250	50	28.8	17:31	22.33	216.38	279.13
1.255	51	29.3	17.65	22.77	221.51	285.76
1.260	52	29.7	18.01	23.23	226.93	292.70
1.265	53	30.2	18.35	23.68	232.13	299.55
1.270	54	30.6	18.70	24.13	237.62	306.45
1.275	55	31.1	19.05	24.58	242.89	313.40
1.280	56	31.5	19.41	25.04	248.45	320.51
1 285	57	32.0	19.77	25.50	254.04	327.68
1.290	58	32.4	20.12	25.96	259.55	334 88
1.295	59	32.8	20.47	26.41	265.09	342.01
1.300	60	33.3	20.81	26.85	270.53	349.05
1.305	61	33.7	21.20	27.35	276.66	356.92
1.310 1.315	62	34.2	21.59	27.85	282.83	364.83
1.319	63 64	34.6	21.97	28.34	288.91	372.67
1.320	65	35·0 35·4	22:35	28.83	295.02	380.56
1.330	66	35.8	22.73	29.32	301.17	388.40
1.335	67	36.2	23·10 23·47	29.80	307.23	396.34
1.340	68	36.6	23.83	30·28 30·74	313.32	404.24
1.345	69	37·0	24.18	30.74	319.32	411.92
1.350	70	37.4	24.61	31.75	325.22	419.64
1.355	71	37.8	25.02	32.28	332·24 339·02	428.63 437.39
1.360	72	38.2	25.42	32.79	345.71	445.94
1.365	73	38.6	25.78	33.26	351.90	454.00
1.370	74	39.0	26.14	33.73	358.12	462.10
1.375	75	39.4	26.52	34.22	364.65	470.53
1.380	76	39.8	26.90	34.71	371.22	479.00
1.385	77	40.1	27.28	35.20	377.83	487.52
1.390	78	40.5	27.66	35.68	384.47	495.95
1 • 395	79	40.8	28.02	36.15	390.88	504.29
1.400	80	41.2	28.42	36.67	397.88	513.38
1.405	81	41.6	28.81	37.17	404.78	522.24
1.410	82	42.0	29.18	37.65	411.44	530.87
1.415	83	42.3	29.58	38.16	418.56	539.96
	<u> </u>					

(b) SPECIFIC GRAVITIES OF SOLUTIONS OF SODIUM HYDROXIDE AT 15° C.—Continued.

Specific Degrees		Degrees	Per cent.	Per cent.	1 cb.m. contains kg.			
Gravity.	avity. Twaddell. Bau		Na ₂ O.	NaOH.	Na ₂ O.	NaOH.		
1.420	84	42.7	29.97	38.67	425.57	549:11		
1.425	85	43.1	30.36	39.17	432.63	558.17		
1.430	86	43.4	30.75	39.67	439.72	567.28		
1.435	87	43.8	31.14	40.18	446.86	576.58		
1.440	88	44.1	31.53	40.68	454.03	585.79		
1.445	89	44.4	31.93	41.20	461.39	595.34		
1.450	90	44.8	32.32	41.70	468-64	604.65		
1.455	91	45.1	32.72	42.22	476.07	614.30		
1.460	92	45.4	33.14	42.75	483.84	624.15		
1.465	93	45.8	33.54	43.27	491.36	633.91		
1.470	94	46.1	33.95	43.80	499.07	643.86		
1.475	95	46.4	34.36	44.33	506.81	653.87		
1.480	96	46.8	34.76	44 85	514.45	663.78		
1.485	97	47.1	35.17	45.37	522.27	673.74		
1.490	98	47.4	35.57	45.89	529.99	683.76		
1.495	99	47.8	35.98	46.42	537.90	693.98		
1.500	100	48.1	36.38	46.94	545.70	704.10		
1.505	101	48.4	36.79	47-47	553.69	714.42		
1.510	102	48.7	37.20	48.00	561.72	724.80		
1.515	103	49.0	37.61	48.53	569.79	735.23		
1.520	104	49.4	38.02	49.05	577.90	745.56		
1.525	105	49.7	38.42	49.58	585.91	756.10		
1.530	106	50.0	38.83	50.10	594.10	766.53		

(c) INFLUENCE OF TEMPERATURE ON THE SPECIFIC

										_
0° C.	5° .	10°.	15°.	20°.	25°.	80°.	35°.	40°•	45°.	50°.
1:367	1:364	1.362	1:360	1·357	1·355	1·853	1·350	1·348	1·345	1·342
1:357	1:354	1.352	1:350	1·347	1·345	1·343	1·340	1·337	1·335	1·332
1:347	1:344	1.342	1:340	1·338	1·335	1·333	1·330	1·327	1·325	1·322
1:338	1:385	1.332	1:330	1·328	1·325	1·323	1·320	1·317	1·316	1·312
1:323	1:325	1.322	1:320	1·313	1·315	1·318	1·310	1·307	1·305	1·302
1:318	1.315	1.813	1·310	1:308	1·305	1·303	1.800	1·297	1·294	1-292
1:308	1.305	1.303	1·300	1:297	1·294	1·292	1.289	1·287	1·284	1-282
1:298	1.295	1.293	1·290	1:287	1·284	1·282	1.279	1·277	1·274	1-272
1:288	1.285	1.283	1·280	1:277	1·274	1·272	1.269	1·267	1·264	1-262
1:278	1.275	1.273	1·270	1:267	1·265	1·262	1.260	1·258	1·255	1-252
1·268	1·265	1·263	1·260	1·257	1·255	1:262	1·250	1·248	1·245	1·242
1·257	1·255	1·252	1·250	1·247	1·245	1:242	1·240	1·238	1·236	1·233
1·247	1·245	1·242	1·240	1·237	1·235	1:232	1·230	1·228	1·225	1·223
1·237	1·235	1·232	1·230	1·227	1·224	1:222	1·220	1·218	1·215	1·212
1·227	1·225	1·222	1·220	1·217	1·214	1:212	1·210	1·208	1·205	1·202
1·217	1·215	1·212	1·210	1·207	1·204	1·203	1·200	1·198	1·196	1·192
1·207	1·205	1·202	1·200	1·197	1·195	1·193	1·190	1·188	1·186	1·184
1·197	1·195	1·192	1·190	1·187	1·185	1·183	1·180	1·178	1·178	1·174
1·187	1·185	1·182	1·180	1·177	1·175	1·173	1·170	1·168	1·168	1·164
1·176	1·174	1·172	1·170	1·167	1·165	1·163	1·161	1·158	1·158	1·154
1·166	1·164	1·162	1·160	1·157	1·155	1·153	1·151	1·148	1·146	1·144
1·156	1·154	1·152	1·150	1·148	1·146	1·144	1·142	1·140	1·137	1·185
1·146	1·144	1·142	1·140	1·138	1·136	1·134	1·132	1·130	1·127	1·125
1·135	1·134	1·132	1·130	1·128	1·126	1·124	1·122	1·120	1·118	1·116
1·126	1·124	1·122	1·120	1·118	1·116	1·114	1·112	1·110	1·108	1·106
1·115	1·118	1·112	1·110	1.108	1:106	1:104	1·102	1·100	1.090	1.097
1·105	1·108	1·102	1·100	1.098	1:096	1:095	1·098	1·092	1.090	1.087
1·094	1·093	1·091	1·090	1.088	1:087	1:086	1·094	1·082	1.030	1.078
1·084	1·083	1·081	1·080	1.078	1:077	1:076	1·074	1·072	1.070	1.068
1·074	1·078	1·071	1·070	1.068	1:067	1:066	1·064	1·082	1.060	1.058
1.064	1.063	1:061	1.060	1.058	1·057	1.056	1.054	1.052	1:050	1.048
1.054	1.053	1:051	1.050	1.048	1·047	1.046	1.044	1.042	1:040	1.038
1.044	1.043	1:041	1.040	1.038	1·037	1.036	1.034	1.032	1:030	1.028
1.034	1.033	1:031	1.030	1.028	1·027	1.028	1.024	1.022	1:020	1.018
1.024	1.023	1:021	1.020	1.018	1·017	1.016	1.014	1.012	1:010	1.008
1.014	1.013	1.011	1.010	1.008	1.007	1.008	1.004	1.002	1.000	0.098

GRAVITIES OF SOLUTIONS OF CAUSTIC SODA.

65°.	60°.	65°.	70°.	76°.	80°.	85°.	90°.	95°.	100°.
1.339	1.836	1·333	1.331	1.828	1·826	1.323	1.821	1·818	1·316
1.330	1.827	1·324	1.322	1.319	1·816	1.814	1.811	1·808	1·306
1.320	1.817	1·314	1.312	1.309	1·806	1.804	1.801	1·298	1·296
1.310	1.807	1·304	1.302	1.299	1·296	1.294	1.291	1·288	1·286
1.800	1.297	1·294	1.292	1.289	1·236	1.283	1.280	1·277	1·274
1-289	1·286	1·284	1·281	1·278	1.275	1·272	1·269	1.266	1·263
1-279	1·276	1·274	1·271	1·268	1.266	1·262	1·259	1.256	1·258
1-269	1·266	1·264	1·261	1·268	1.256	1·252	1·249	1.245	1·242
1-259	1·256	1·264	1·261	1·248	1.245	1·242	1·289	1.285	1·282
1-250	1·247	1·245	1·242	1·239	1.286	1·283	1·281	1.228	1·225
1·240	1·287	1·285	1·282	1·229	1·226	1·228	1·221	1·218	1·215
1·281	1·228	1·226	1·228	1·220	1·218	1·216	1·213	1·209	1·207
1·221	1·218	1·216	1·213	1·210	1·208	1·205	1·203	1·200	1·197
1·210	1·208	1·206	1·202	1·200	1·198	1·196	1·192	1·190	1·187
1·200	1·198	1·196	1·192	1·190	1·188	1·185	1·182	1·180	1·177
1·191	1·189	1·186	1·184	1·181	1·179	1·176	1·178	1·171	1·168
1·182	1·180	1·177	1·175	1·172	1·169	1·166	1·168	1·161	1·158
1·172	1·169	1·166	1·164	1·161	1·158	1·155	1·158	1·150	1·147
1·162	1·159	1·156	1·158	1·161	1·148	1·145	1·143	1·140	1·137
1·152	1·149	1·146	1·148	1·140	1·138	1·186	1·182	1·180	1·127
1·142	1·139	1·136	1·188	1·180	1·128	1·126	1·122	1·120	1·117
1·182	1·130	1·127	1·124	1·121	1·118	1·116	1·113	1·110	1·107
1·122	1·120	1·117	1·114	1·111	1·108	1·106	1·108	1·100	1·097
1·113	1·110	1·107	1·104	1·101	1·099	1·096	1·093	1·090	1·087
1·103	1·100	1·097	1·094	1·092	1·089	1·086	1·088	1·080	1·077
1.094	1.091	1.089	1.086	1.088	1.080	1.077	1.074	1.071	1.068
1.084	1.082	1.079	1.076	1.078	1.070	1.067	1.064	1.061	1.058
1.075	1.073	1.070	1.067	1.064	1.061	1.068	1.058	1.052	1.048
1.066	1.063	1.080	1.057	1.054	1.061	1.048	1.046	1.048	1.040
1.056	1.053	1.050	1.047	1.044	1.042	1.089	1.086	1.083	1.030
1.046	1.048	1.040	1.087	1.084	1.032	1.029	1.026	1.028	1.020
1.036	1.033	1.080	1.027	1.024	1.021	1.019	1.016	1.018	1.010
1.026	1.023	1.020	1.017	1.014	1.011	1.009	1.006	1.008	1.000
1.016	1.013	1.010	1.007	1.004	1.001	0.999	0.996	0.998	0.990
1.006	1.003	1.000	0.997	0.904	0.991	0.989	0.986	0.983	0.980
0.996	0.998	0.090	0.987	0.984	0.081	0.979	0.976	0.978	0.970

B.-Lime Mud.

- (a) Sodium as Carbonate and Hydroxide.—Evaporate to dryness with addition of ammonium carbonate (in order to decompose the insoluble sodium compounds), repeat this, digest with hot water, filter, wash, and test the filtrate for alkali. The soda may have been originally present as NaOH or as Na₂CO₃. It is expressed in terms of Na₂O (0.03100 g. per cubic centimetre of normal acid).
- (b) Caustic Lime.—Titrate as described (p. 158) with normal hydrochloric acid and phenolphthalein. This indicates NaOH as well, for which half of the amount found in test (a) may be assumed without any serious error.
- (c) Calcium Carbonate.—Titrate with normal hydrochloric acid and methyl orange, deduct from the cubic centimetres required those required in tests (a) and (b).

C.—Fished Salts.

Dissolve 50 g. in 1 litre of water, and take 50 c.c. of the solution for every test.

- (a) Available Alkali is tested for with normal hydrochloric acid.
- (b) Sodium Chloride.—Neutralise with nitric acid, preferably running normal acid out of a burette, and proceed in other respects as described on p. 146.
- (c) Sodium Sulphate.—Add a slight excess of hydrochloric acid, precipitate with barium chloride, and weigh the BaSO₄ (p. 109).
- (d) Sodium Sulphite, Thiosulphate, etc.—Add an excess of bleaching-powder solution, then hydrochloric acid, till the reaction is acid, and a smell of chlorine is produced (p. 168); precipitate with BaCl₂, weigh the BaSO₄, and deduct the amount found in test (c). The remainder is calculated as "Na₂SO₄ from oxidisable sulphur compounds."

D.—Caustic Bottoms.

Dissolve 10 g. in water, and filter. The washed residue is dried and ignited, and yields:—

(a) Insoluble Matter.—If necessary, the contained iron is estimated by dissolving in concentrated hydrochloric acid, reducing with zinc, adding manganous sulphate, and titrating with permanganate as on p. 112.

- (b) Available Alkali is estimated in the aqueous solutions by normal hydrochloric acid, using litmus or lacmoid as indicator. (Methyl orange is not available in this case, owing to the presence of alumina.)
- (c) Sodium Carbonate is estimated as in commercial soda ash (p. 178).

E.—Commercial Caustic Soda.

The sample must be very carefully taken. (Cf. Appendix.) The single pieces must be freed from the outer crust by scraping it off, before weighing. Dissolve 50 g. of the prepared sample in 1 litre of water, and take aliquot portions for each of the following tests with a pipette.

- (a) Available Alkali is tested in at least 20 c.c. (equal to 1 g.) by normal HCl. If the caustic soda contains more than traces of alumina, methyl orange cannot be used as indicator, but litmus or lacmoid should be employed. In the case of strong caustic this is unnecessary.
- (b) Sodium Carbonate is estimated by expelling the $\rm CO_2$ with dilute sulphuric acid, and absorbing it in soda-lime (the pumice saturated with cupric sulphate is left out here), or by Lunge and Rittener's process, p. 171. The quantity of $\rm CO_2$ being so small, any estimation by difference yields unsatisfactory results. Very approximate results can, however, be obtained by titrating first with phenolphthalein till the pink colour is discharged (when all $\rm Na_2\rm CO_3$ will have been changed into $\rm NaHCO_3$), noting the amount of standard acid used, adding methyl orange and more standard acid till the pink colour appears. The acid used in the second test $\times 2$ indicates $\rm Na_2\rm CO_3$.
- (c) The Table for comparing English, French, and German Degrees is given on pp. 180 to 182.

VIII. ELECTROLYTIC ALKALI LIQUORS.

These are analysed just like bleach liquor, p. 164.

- 1. Hypochlorites are titrated as on p. 159.
- 2. Free Hypochlorous Acid.—Estimate the bleaching chlorine as in No. 1, then chloride, chlorate, and other acids on the one hand, and all bases on the other; the acidity in excess represents free HOCl.
- 3. Chlorate may be estimated as on p. 164, but since there is but little chlorate in presence of much hypochlorite, it is prefer-

able to use the direct method of Fresenius, as follows:—To the solution add an excess of neutral lead acetate solution; this produces a precipitate which gradually turns brown, and which contains a quantity of PbO₂ corresponding to the chlorate. Allow to stand for eight or ten hours, until there is no more smell of chlorine, filter, wash, evaporate the filtrate to a small volume, precipitate lead and lime by means of a little sodium carbonate, and estimate the chlorate in the filtrate according to p. 164.

In mixtures of chlorate and hypochlorite, containing large quantities of the latter, Ditz and Knöpfelmacher estimate the chlorate iodometrically, by decomposing it at the ordinary temperature with concentrated hydrochloric acid and potassium bromide. Put the substance, together with a sufficient excess of KBr, into a small flask provided with a hollow glass stopper with dropping funnel and lateral absorbing vessel for the retention of bromine vapours. The latter is charged with 10 c.c. of a 5 per cent. solution of KI. Pour 50 c.c. concentrated hydrochloric acid through the dropping funnel into the flask, allow it to act for an hour, pour in 300 c.c. water, then 20 c.c. of the solution of KI, shake well, transfer the contents of the absorbing vessel to the flask, and titrate the iodine which has been set free by thiosulphate. The quantity of chlorate + hypochlorite is thus ascertained. If there is very much of the latter present, it should be removed beforehand.

- 4. Chloride.—Employ the solution from No. 1, in which all hypochlorite has been converted into chloride, with formation of sodium arsenate, which is an excellent indicator for the titration of the total chlorides by silver nitrate, p. 148, making no deduction for any excess of silver nitrate required to produce the colour. From the quantity of chloride thus found, deduct that which corresponds to the hypochlorite.
- 5. Carbon Dioxide.—Destroy the hypochlorite by boiling with liquor ammoniæ, free from CO₂, expel the CO₂ by a strong acid, and estimate it as on p. 171.
- 6. Bases.—Convert these into sulphates, by evaporation with sulphuric acid, and estimate them in the residue by the ordinary methods.
- 7. Free Alkali.—Add to the solution a little of Merck's chemically pure hydrogen peroxide, which reacts as follows with the hypochlorite:—

$$NaOCl + H_2O_2 = NaCl + H_2O + O_2$$

NaOH and Na_2CO_3 remain unchanged in solution, and are titrated as on p. 167.

In regard to the estimation of carbon dioxide in electrolytic chloring gas, see p. 163.

IX. NITRIC ACID MANUFACTURE.

A.—Commercial Nitrate of Soda.

According to the custom of the trade, which has held for many years, no direct estimation of the nitrate is made in the commercial nitrate of soda exported from Chili. The rule is, to estimate moisture, sodium chloride, sodium sulphate, and insoluble substances. The sum of these impurities is called the "refraction," and everything else is assumed to be real nitrate of soda. But as Chili saltpetre sometimes contains potassium nitrate (in which the percentage of NO₃ is less than in NaNO₃), errors up to 1 per cent. NaNO₃ or even more may be caused by this indirect method of testing. Therefore, besides the above estimations, it ought to be insisted upon to estimate the potassium present and to calculate the results accordingly, or even better, to estimate the nitric-nitrogen directly.

The sampling ought to be done very carefully, since especially the amount of moisture may vary considerably in different parts of a cargo, and the reduction of the large sample to a smaller bulk

ought to yield a really representative average sample.

1. Moisture.—Heat 10 g. or more of a good average sample in a small glass or porcelain dish to 130° for four or five hours, till the weight is constant.

- 2. Insoluble.—Dissolve 10 g. in water, filter, wash, and ignite. If there is a very appreciable quantity of organic matter present, first dry at 100° C. and weigh the filter with the precipitate before igniting it. The solution is used for the tests Nos. 4 to 6.
- 3. Sodium Nitrate.—In order to obtain a really representative sample, take about 20 g. of the carefully taken, large, average sample, dry this at 110°, grind it very finely, mix it thoroughly, and use it for the estimation of nitrate, etc. For the nitrate test, weigh out about 0.35 g. (that is, a quantity which will yield between 100 and 120 c.c. NO at the ordinary temperature and barometric pressure) in a narrow weighing-tube. Pour its contents as completely as possible into the decomposition vessel D of the gas-volumeter, Fig. 10, p. 140, so that the substance gets as much as possible to the bottom of the beaker of D. Weigh the weighing-tube again, with the small quantity of nitrate still adhering to it, so as to ascertain the weight of nitrate taken=a, in D. The three-way tap must be closed. Now run in 0.5 c.c. water, wait until the nitrate has been entirely or nearly all dissolved, draw the solution with any small crystals into the inside

of D, by lowering the level-tube E and cautiously opening the tap, rinse the beaker with or at most 1 c.c. water, and then allow 15 c.c. of pure concentrated sulphuric acid to enter in the same way. (It is important not to employ more than 1.5 c.c. water altogether to 15 c.c. of strong acid, for if the acid is too much diluted, a froth of basic mercuric sulphate is formed which prevents an exact reading of the volume. On the other hand, the addition of a little water to the strong acid prevents the solution

of an appreciable quantity of NO in the liquid.)

The reaction is finished by vigorous shaking of the acid solution with the mercury (as in the ordinary nitrometer, p. 137). During this period the level-tube should be roughly put into position, to avoid any considerable differences of pressure and possible leakages through the tap. When the agitating has been finished, wait half an hour for cooling. Then connect tube c of vessel D (Fig. 10, p. 140) with tube e of the measuring tube A, so that glass touches glass, as described p. 141, and transfer all the, gas to A, by raising E and lowering C, but not allowing any acid to get into A. Then shut both taps, and by adjusting the tubes A, B, C, in the manner described, p. 141, compress the gas volume to that corresponding to 0° and 760 mm. pressure.

Of course it is also possible to employ, in lieu of the gasvolumeter, an ordinary nitrometer, that is, to leave out the "reduction-tube" B. In this case the volume NO is read off under the prevailing atmospheric pressure, by adjusting the leveltube accordingly; the volume of NO is then reduced to 0° and 760 mm. by reading the thermometer and barometer, and employing the Tables 20, I. and II., pp. 36 et seq. The reduced volume of NO we call x. Each c.c. of it corresponds to 0.0037963 g. NaNO3 (compare the table, p. 139); the whole, divided by the weight of the nitrate employed a and multiplied by 100, indicates the percentage

of real nitrate; that is:—

 $\frac{0.37963x}{a}$.

(N.B.—The nitrometer should be tested whether it really contains exactly 100 c.c. to the mark 100, by inverting it, filling in mercury to the mark 100, running it off, and weighing. It should weigh 1360 g. reduced to 0°, or 1355 g. at 15° C. If there is an error, this must be allowed for in each reading.)

4. Sodium Sulphate is estimated in the solution No. 2 by precipitation with BaCl₂ and weighing the BaSO₄. (Cf. pp. 109

and 148.)

5. Sodium Chloride is titrated with silver nitrate.

p. 146.)

6. Iodine is detected by reducing the iodic acid with zinc, heating the solution with concentrated sulphuric acid, which liberates the iodine, diluting and agitating with carbon disulphide, which

takes up the iodine, and is thereby coloured pink. The faintest traces of iodate are found by dissolving 5 g. in 100 c.c. of boiled water, adding a little nitric acid, a few drops of a solution of potassium iodide in boiled water, and a drop of starch solution. In the presence of as little as 0.01 mg. I in 1 g. of nitre, a blue colour will appear. A check test must, however, be made with the potassium iodide employed for this test, as this often contains some iodate.

- 7. Potassium.—Evaporate a special sample several times with strong hydrochloric acid until all the nitrate is decomposed, and estimate the K as in the analysis of potassium chloride, p. 205. Calculate it as KNO₃, 100 parts of which is equivalent with 84.08 of NaNO₃.
- 8. Perchlorate (Gilbert).—Treat 20 g.of the dried substance with 2 or 3 c.c. concentrated hydrochloric acid in a flat platinum dish; add about 1 g. manganese dioxide, free from chlorine, dry by heating over a small flame; bring to fusion, put on the lid and keep the dish at a red heat during one-quarter hour. Dissolve the melt in hot water and dilute the solution to 250 c.c. Take out 50 c.c. (=4 g. nitre), acidulate with nitric acid and add a 1 per cent. solution of KMnO₄, until the red colour persists for a full minute. Then add ferric potassium sulphate (iron-alum), and titrate the chloride by means of silver nitrate (Volhard's method). From the Cl thus found, deduct that which was originally present (No. 5), and calculate the remainder as perchlorate. 1 part NaCl corresponds to 2.095 NaClO₃.

B.-Nitre-Cake.

- 1. Free Acid is titrated with standard alkali (p. 147). If considerable quantities of ferric oxide or alumina are present, no indicator is employed, but normal alkali is added till the first flakes of a precipitate indicate the end of the reaction.
- 2. Nitric Acid should be estimated in the gas-volumeter (p. 139), or in the nitrometer (p. 137); the method employed is exactly the same as described there, viz., dissolving in the beaker in very little water, and decomposing with a large excess of sulphuric acid.
 - 3. Ferric Oxide and Alumina (as pp. 143 and 148).

C.-Nitric Acid.

1. SPECIFIC GRAVITY OF NITRIC ACID AT 15° C., COMPARED WITH WATER OF 4° C. (IN VACUO).

(Lunge and Rey.)

Degrees	Percentage	by weight.	Grams	per litre.
Twad- dell.	N ₂ O ₅ .	HNO3.	N ₂ O ₅ .	HNO3*
0	0.08	0.10	1	1
1	0.85	1.00	8	10
$\frac{1}{2}$	1.62	1.90	16	19
3 1	2.39	2.80	24	28
4	3.17	3.70	33	38
5 6 7 8	3.94	4.60	40	47
6	4.71	5.20	49	57
7	5.47	6.38	57	66
	6.22	7:26	64	75
9	6.97	8.13	73	85
10	7.71	8-99	81	94
11	8.43	9.84	89	104
12	9.15	10.68	97	113
13	9.87	11.51	105	123
14	10.57	12.33	113	132
15	11.27	13.15	121	141
16 17	11.96	13.95	129	151
	12.64	14.74	137	160
18 19	13.31	15.33	145	169
19	13.99	16.32	. 153	179
20	14.67	17:11	161	188
21	15.34	17.89	170	198
22	16.00	18.67	177	207
23	16.67	19.45	186	217
24	17:34	20.23	195	227
25	18.00	21.00	202	236
26 27	18.66	21.77	211	246
27	19.32	22.54	219	256
28 29	19.98	23.31	228	266
29	20.64	24.08	237	276
30	21.29	24.84	245	286
31	21.94	25.60	254	296
32 33	22.60	26.36	262	306
33	23.25	27.12	271	316
04	23.90	27.88	279	326

SPECIFIC GRAVITY OF NITRIC ACID AT 15° C., COMPARED WITH WATER OF 4° C. (IN VACUO)—Continued.

Degrees	Percentage	by weight.	Grams	per litre.
dell.	N ₂ O ₅ .	HNO3.	N ₂ O ₅ .	HNO3.
35	24.54	28.63	288	336
36	25.18	29.38	297	347
37	25.83	30.13	306	357
38	26.47	30.88	315	367
39	27.10	31.62	324	378
40	27.74	32.36	333	388
41	28.36	33.09	342	399
42	28.99	33.82	351	409
43	29.61	34.55	360	420
44	30.24	35.28	369	430
45	30.88	36.03	378	441
46	31.53	36.78	387	452
47	32.17	37.53	397	463
48	32.82	38.29	407	475
49	33.47	39.05	417	486
50	34.13	39.82	427	498
51	34.78	40.58	437	509
52	35.44	41.34	447	521
53	36.09	42.10	457	533
54	36.75	42.87	467	544
55	37.41	43.64	477	556
56	38.07	44.41	487	568
57	38.73	45.18	498	581
58	39.39	45.95	508	593
59	40.05	46.72	519	605
60	40.71	47.49	529	617
61	41.37	48.26	540	630
62	42.06	49.07	551	643
63	42.76	49.89	562	656
64	43.47	50.71	573	669
65	44.17	51.53	585	683
66	44.89	52.37	597	697
67	45.62	53.22 .	609	710
68	46.35	54.07	621	725
69	47.08	5 4·9 3	633	789

SPECIFIC GRAVITY OF NITRIC ACID AT 15° C., COMPARED WITH WATER OF 4° C. (IN VACUO)—Continued.

Degrees	Percentage	by weight.	Grams	per litre.
Twad- dell.	N ₂ O ₅ .	HNO3.	N ₂ O ₅ .	HNO3.
70	47.82	55.79	645	753
71	48.57	56.66	658	768
72	49.35	57.57	671	783
73	50.13	58.48	684	798
74	50.91	59.39	698	814
75	51.69	60.30	711	829
76	52.52	61.27	725	846
77	53:35	62:24	739	862
78	54.20	63.23	753	879
79	55.07	64.25	768	896
80	55.97	65.30	783	914
81	56.92	66.40	800	933
82	57·86	67.50	816	952
83	58.83	68.63	832	971
84	59.83	69.80	849	991
85	60.84	70.98	867	1011
86	61.86	72.17	885	1032
87	62.91	73:39	903	1053
88	64.01	74.68	921	1075
89	65.13	75.98	941	1098
90	66:24	77.28	961	1121
91	67:38	78.60	981	1144
92	68 56	79.98	1001	1168
93	69 79	81.42	1023	1193
94	71.06	82.90	1045	1219
95	72.39	84.45	1068	1246
96	73.76	86.05	1092	1274
97	75.18	87.70	1116	1302
98	76.80	89.60	1144	1335
99	78.52	91.60	1174	1369
100	80.65	94.09	1210	1411
101	82.63	96.39	1244	1451
102	84.09	98.10	1270	1481
103	84.92	99.07	1287	1501
104	85.44	99.67	1299	1515

2. INFLUENCE OF TEMPERATURE ON THE SPECIFIC GRAVITY OF NITRIC ACID.

0° C.	5°	10° `	15°	20°	25°	80°	35*	40°	45°	50
1:424 1:418 1:402 1:391 1:380	1·414 1·404 1·394 1·383 1·378	1·407 1·397 1·387 1·377 1·367	1·400 1·300 1·380 1·370 1·360	1·392 1·382 1·372 1·363 1·353	1.885 1.375 1.355 1.356 1.346	1·378 1·367 1·357 1·349 1·340	1.371 1.361 1.351 1.342 1.333	1.363 1.854 1.344 1.335 1.826	1.356 1.347 1.339 1.330 1.320	1.84 1.35 1.35 1.31
1·369	1:362	1:356	1.350	1:343	1.837	1.330	1·323	1:317	1.312	1·30
1·359	1:352	1:346	1.340	1:333	1.327	1.320	1·314	1:308	1.303	1·20
1·348	1:342	1:336	1.330	1:824	1.318	1.311	1·305	1:299	1.294	1·20
1·338	1:332	1:326	1.320	1:314	1.308	1.302	1·296	1:290	1.285	1·20
1·327	1:321	1:316	1.310	1:804	1.299	1.293	1·287	1:281	1.276	1·20
1·317	1.311	1·306	1·300	1·294	1·289	1.283	1·278	1·273	1.268	1.28
1·307	1.301	1·296	1·290	1·284	1·279	1.273	1·258	1·263	1.258	1.28
1·297	1.291	1·286	1·280	1·274	1·269	1.263	1·258	1·253	1.248	1.28
1·287	1.281	1·276	1·270	1·265	1·269	1.264	1·248	1·243	1.238	1.28
1·277	1.271	1·266	1·260	1·256	1·249	1.244	1·238	1·233	1.228	1.28
1·266	1.260	1·256	1.250	1·245	1.240	1.236	1·229	1.224	1·219	1·21
1·256	1.250	1·245	1.240	1·235	1.230	1.225	1·220	1.215	1·210	1·20
1·245	1.240	1·235	1.230	1·225	1.220	1.215	1·210	1.205	1·201	1·19
1·285	1.230	1·226	1.220	1·215	1.210	1.205	1·200	1.196	1·191	1·18
1·224	1.219	1·214	1.210	1·205	1.200	1.196	1·191	1.187	1·182	1·18
1·213 1·202 1·192 1·182 1·172	1·208 1·198 1·188 1·178 1·168	1·204 1·194 1·184 1·174 1·164	1·200 1·190 1·180 1·170 1·160	1·195 1·185 1·177 1·166 1·156	1·190 1·181 1·171 1·162 1·152	1·186 1·177 1·167 1·158 1·148	1·181 1·172 1·163 1·154 1·144	1·177 1·168 1·158 1·149 1·140	1·172 1·163 1·154 1·145 1·136	1·16 1·18 1·18 1·18
1·161 1·151 1·139 1·129 1·118	1·158 1·147 1·136 1·126 1·115	1·154 1·144 1·133 1·123 1·112	1·150 1·140 1·180 1·120 1·110	1·146 1·136 1·126 1·116 1·107	1·142 1·132 1·123 1·113 1·104	1·189 1·129 1·119 1·110 1·101	1·135 1·125 1·116 1·105 1·097	1·130 1·121 1·112 1·103 1·094	1·127 1·118 1·109 1·100 1·091	1·19 1·10 1·00 1·00
1:108	1·190	1·102	1·100	1.007	1.094	1.091	1.088	1.085	1.082	1.07
1:098	1·096	1·092	1·090	1.087	1.084	1.081	1.078	1.076	1.073	1.07
1:088	1·085	1·082	1·080	1.077	1.074	1.071	1.068	1.065	1.063	1.06
1:077	1·076	1·072	1·070	1.067	1.064	1.061	1.058	1.056	1.054	1.08
1:067	1·064	1·062	1·060	1.067	1.055	1.052	1.050	1.048	1.045	1.04
1·057	1 054	1.052	1.050	1.047	1.046	1.048	1.040	1.038	1.085	1.05
1·047	1 044	1.042	1.040	1.087	1.085	1.038	1.030	1.028	1.025	1.05
1·037	1 034	1.082	1.030	1.027	1.025	1.028	1.020	1.018	1.015	1.05
1·027	1 024	1.022	1.020	1.017	1.015	1.018	1.010	1.008	1.005	1.06
1·017	1 014	1.012	1.010	1.007	1.005	1.003	1.000	0.908	0.995	0.06

INFLUENCE OF TEMPERATURE ON THE SPECIFIC GRAVITY OF NITRIC ACID—Continued.

55°	60°	65°	70°	76°	80°	85°	90°	95°	100*
1·342	1.835	1·329	1·328	1.316	1·310	1·303	1·296	1·290	1·288
1·333	1.827	1·320	1·314	1.308	1·302	1·294	1·288	1·282	1·276
1·325	1.319	1·312	1·305	1.300	1·293	1·286	1·280	1·274	1·267
1·316	1.810	1·304	1·298	1.292	1·286	1·279	1·274	1·267	1·260
1·308	1.302	1·296	1·290	1.284	1·278	1·272	1·266	1·260	1·264
1.800	1·294	1·288	1·282	1·276	1-270	1·265	1·259	1·253	1·247
1.291	1·286	1·280	1·274	1·268	1-263	1·257	1·252	1·246	1·240
1.282	1·278	1·272	1·256	1·261	1-255	1·260	1·245	1·240	1·234
1.274	1·269	1·264	1·258	1·253	1-248	1·243	1·238	1·238	1·228
1.266	1·261	1·256	1·251	1·246	1-240	1·235	1·230	1·225	1·220
1·258 1·248 1·238 1·229 1·219	1·263 1·244 1·234 1·226 1·215	1-248 	1·243 1·284 1·224 1·215 1·205	1·238 1·229 1·219 1·210 1·200	1·232 1·223 1·214 1·205 1·195	1·227 1·218 1·209 1·199 1·190	1·222 1·218 1·204 1·195 1·186	1·217 1·208 1·199 1·190 1·180	1·212 1·203 1·194 1·185 1·176
1·210	1·206	1·201	1·196	1·191	1·186	1·181	1·178	1·171	1·167
1·200	1·196	1·191	1·186	1·181	1·177	1·172	1·167	1·162	1·158
1·191	1·187	1·182	1·177	1·172	1·168	1·163	1·158	1·153	1·149
1·182	1·177	1·172	1·167	1·168	1·158	1·153	1·148	1·144	1·139
1·173	1·168	1·163	1·160	1·154	1·149	1·144	1·140	1·185	1·130
1·168	1·168	1·154	1·150	1·145	1·140	1·186	1·181	1·126	1·122
1·154	1·150	1·146	1·141	1·136	1·132	1·128	1·128	1·119	1·116
1·145	1·141	1·137	1·138	1·128	1·124	1·120	1·116	1·112	1·107
1·137	1·182	1·128	1·124	1·120	1·116	1·118	1·108	1·105	1·100
1·128	1·124	1·120	1·116	1·112	1·108	1·105	1·101	1·097	1·094
1·119	1·115	1·112	1·108	1·104	1·100	1.097	1.096	1.090	1.086
1·110	1·107	1·103	1·100	1·096	1·093	1.090	1.086	1.082	1.070
1·102	1·099	1·094	1·091	1·088	1·084	1.081	1.078	1.075	1.071
1·093	1·090	1·086	1·083	1·080	1·076	1.078	1.070	1.087	1.064
1·084	1·081	1·078	1·076	1·072	1·088	1.065	1.068	1.060	1.056
1.076	1.078	1.070	1.057	1.064	1.081	1.058	1.055	1.052	1·049
1.067	1.064	1.061	1.058	1.055	1.052	1.050	1.048	1.045	1·042
1.058	1.055	1.052	1.050	1.047	1.044	1.042	1.040	1.088	1·088
1.049	1.046	1.044	1.042	1.089	1.037	1.034	1.081	1.029	1·027
1.040	1.088	1.036	1.034	1.031	1.029	1.026	1.028	1.021	1·018
1.030	1.028	1.026	1-024	1.021	1·019	1.015	1·014	1·012	1·009
1.020	1.018	1.016	1·014	1.011	1·009	1.007	1·004	1·002	1·000
1.010	1.008	1.008	1·004	1.001	0·099	0.997	0·994	0·998	0·990
1.001	0.909	0.997	0·995	0.902	0·990	0.988	0·985	0·988	0·981
0.991	0.989	0.987	0·985	0.982	0·980	0.978	0·976	0·978	0·071

- 3. Total Acidity.—Titrate a diluted sample by standard caustic soda solution. Methyl orange can be quite well used as indicator, if the titration is performed as described, p. 135, although it would be destroyed by prolonged contact with nitrous acid. Strong fuming acid is weighed in a bulb-tap pipette, Fig. 11, 144; from this the acid is slowly run on to the bottom of a flask, containing ice-cold water, and the titration is performed quickly, to prevent a decomposition of the nitrous acid. Less concentrated nitric acids may be measured by pipettes or burettes, in lieu of weighing.
- 4. Chlorine.—Saturate with sodium carbonate, free from chloride, till the reaction is neutral or faintly alkaline, and titrate with silver nitrate according to p. 146.
- 5. Sulphuric Acid.—Saturate almost completely with sodium carbonate and precipitate with barium chloride as on p. 108. If the acid on evaporating leaves any appreciable fixed residue, this usually consists of sodium sulphate.
- 6. Nitrous Acid or Nitrogen Tetroxide are estimated by running the acid from a burette into a measured volume of warm, dilute potassium permanganate (cf. p. 135). The result is usually expressed in terms of nitrogen peroxide, N_2O_4 . Each c.c. $\frac{1}{2}$ normal permanganate = 0°023005 g. N_2O_4 . Hence, if m c.c. acid have been used and n c.c. permanganate required, the amount of N_2O_4 is :—

 $\frac{0.023005 n}{m}$ g.

The quantity of N_2O_4 is often so considerable that the specific gravity tables give a very deceptive result as to the real percentage of HNO_3 , and an actual determination should be made.

- 7. Fixed Residue, consisting chiefly of sodium sulphate, with a little ferric oxide, etc., is estimated by evaporating to dryness in a place protected from dust, igniting, and weighing.
- 8. Iron.—Precipitate with excess of ammonia, filter, weigh, and ignite the Fe_2O_3 .
- 9. Iodine is detected by digesting for a short time with pure zinc, which reduces iodic acid and generates some nitrous acid; the latter sets the iodine of the HI free, and this can then be recognised by shaking up with carbon disulphide, which thereby assumes a pink colour.
- N.B.—Tests Nos. 8 and 9 are only made with nitric acid sold as chemically pure.

D.-Mixtures of Sulphuric Acid and Nitric Acid.

Such mixtures are sold for the manufacture of explosives and other nitrating purposes. They are analysed by the methods described by Lunge and Berl, Z. angew. Chem., 1905, p. 1681; Chem. Zeit., 1907, p. 485.

- 1. Total Acidity.—Weigh about 1 g. in a bulb-tap pipette, Fig. 11, p. 144, and titrate with normal caustic soda solution. When employing methyl orange as indicator, either add it only towards the end of the titration (or else renew it as destroyed), or else add an excess of soda, then the indicator, and titrate back with normal hydrochloric acid.
- 2. Nitrous Acid is estimated as on p. 135, by running the mixed acid into a measured quantity of seminormal permanganate. It may be calculated as HNO_2 , or $\mathrm{N_2O}_3$, or even as $\mathrm{N_2O}_4$. In the latter case each c.c. of the $\frac{1}{2}$ normal permanganate indicates 0.023005 g. $\mathrm{N_2O}_4$. If we call the c.c. of permanganate used x, the c.c. of mixed acid required for decolorising it y, and s the specific gravity of the latter, the $\mathrm{N_2O}_4$ is $=\frac{23\,x}{y}$ g. per litre, or $\frac{2\cdot3x}{ys}$ per cent. by weight of $\mathrm{N_2O}_4$ in the mixed acid.
- 3. Total Nitrogen Acids are estimated by the nitrometer, p. 137. From the NO given off deduct that corresponding to the nitrous acid found in No. 2, and calculate the remainder as HNO_3 .

4. Sulphuric Acid is found by deducting the nitrogen acids,

found in No. 3, from the total acidity found in No. 1.

If for 1 g. mixed acid we have used a c.c. $\frac{1}{6}$ normal soda solution and found b c.c. NO (reduced to 0° and 760 mm.), and c c.c. of seminormal permanganate to be required, the percentage of the individual components is found by one of the following formulæ, according as to whether we assume N_2O_4 or N_2O_3 to be present:—

X. POTASSIUM SALTS.

A.—Crude Salts (Carnallite, Kainite, etc.).

- 1. Moisture.—Heat 10 g. to 150° for some time, and allow to cool in a desiccator.
 - 2. Percentage of Potassium:*-
- (a) In the Absence of more than 0.5 per cent. Potassium Sulphate.—Obtain a well-mixed sample; dissolve 7.640 g. in a half-litre flask, fill up to the mark, and filter. Place 20 c.c. of the filtrate (=0.3056 of the crude salt) in a porcelain dish; add 5 c.c. of a solution of platinum chloride containing 10 g. Pt. in 100 c.c. Evaporate on the water-bath to a syrupy condition, with frequent agitation, so that most of the HČl is driven off and the mass appears dry after cooling. When cool crush it with a flattened glass rod, add 20 c.c. strong alcohol (at least 94 per cent.), mix well through and pour the liquid portion through a filter which has been previously dried at 120° to 130° till the weight is constant, then weighed and moistened with alcohol. The filter should not be filled up to the top. Pour fresh alcohol on the residue, and heat it on the water-bath nearly to boiling. the solid portion on to the filter, remove most of the liquid by suction, press it between layers of filter paper and dry it till the weight is constant at 120° to 130° (this will usually require only twenty minutes). Each milligram of the potassium-platinum chloride corresponds to 01 per cent. KCl in the quantity of substance employed.
- (b) In the Presence of more than 0.5 per cent. Potassium Sulphate. —Dissolve 30.56 g. of the crude salt in a ½-litre flask in 300 c.c. water+15 c.c. strong hydrochloric acid by boiling, allow to cool, and fill the flask up to the mark. Put 50 c.c. of the clear solution into a 200 c.c. flask, heat to boiling, and precipitate the sulphate with the exactly necessary quantity of barium chloride, adding the principal portion of the reagent quickly, the remainder in single drops, always waiting till the liquid shows a clear layer and throwing into this a minute crystal of barium chloride, until this ceases to produce a cloud. If too

^{*} These are the methods given by Tietjens in Tech. Meth., vol. i., p. 520, as worked out and practised at all the Stassfurt works. This applies also to the figures employed for the calculation of the results which are not based on the real atomic weight of platinum (=194:80) and on the formula K_2PtOl_6 , but are empirical data, based on many years' experience. The difference is mainly caused by the fact that the precipitate is not pure K_2PtCl_6 , but contains some chemically combined water which is not given up even after prolonged drying.

much BaCl₂ should have been accidentally added, it must be removed by a drop or two of dilute sulphuric acid. After cooling, fill up to the mark and take 20 c.c. of the clear solution=0.3056 g. salt, which is then treated with platinum chloride as described in No. 1. One mg. of the precipitate corresponds to 0.1 per cent. KCl, if the K is to be calculated as such.

For the analysis of salts consisting essentially of K_2SO_4 , like kainite, dissolve 35.71 g., in which case each mg. of the platinum precipitate indicates 0.1 per cent. K_2SO_4 . When testing rich sulphate (90 to 97 per cent. K_2SO_4) it is necessary to add to the percentage thus found a correction of +0.3 per cent., but this should not be made in the case of potasso-magnesium sulphates.

3. Percentage of Sodium Chloride:-

- (a) In High-Grade Salts.—If there is little or no sulphate present, the NaCl is calculated from the difference between the KCl found directly by gravimetric analysis and the total chlorides as found by titration with silver solution, p. 147. If there is an appreciable proportion of sulphate present, the percentage of (combined) SO_3 must be estimated, as well as that of potassium and chlorine. The barium sulphate obtained is calculated to KCl (1 part $BaSO_4=0.7465$ $K_2SO_4=0.6388$ KCl); this amount is deducted from the total quantity of K, calculated as KCl; the remaining KCl, which was present as such and must be quoted as such in the analysis, is deducted from that which is found when calculating all the Cl as Kcl. The now remaining nominal amount of KCl is calculated as NaCl, 100 parts KCl being equivalent to 78.41 NaCl. The SO_3 found is calculated as K_2SO_4 .
- (b) In Low-Grade Salts it is not usual to estimate the NaCl. If it is to be done, a complete analysis is required. KCl is estimated as above, in addition: Ca (p. 147), Mg (pp. 143 and 207), SO₃ (p. 108), insoluble matter, and moisture. SO₃ is calculated as CaSO₄; if there is not enough Ca present for all the SO₃, the remainder is calculated as MgSO₄, and after that as K₂SO₄. If more Mg is present than is required to saturate the SO₃ at disposal, the remaining Mg is calculated as MgCl₂. Any excess of Cl over that required to form KCl and MgCl₂ is calculated as NaCl.
- 4. Magnesium Chloride.—In order to distinguish the carnallite salts (which give up the MgCl₂ to alcohol) from the non-carnallitic salts (which do not do this), shake 10 g. of the crude salt for ten minutes in a ½-litre flask with 100 c.c. 96 per cent. alcohol and titrate 10 c.c. of the filtrate with ½ normal silver solution. Such salts as contain upwards of 6 per cent. Cl soluble in alcohol are regarded as belonging to the carnallite group.

5. Total Magnesium.—Boil 10 g. of finely ground, crude salt with 300 c.c. of water in a ½-litre flask for an hour; after cooling add 50 c.c. twice-normal sodium hydroxide solution, in the case of much lime being present also 20 c.c. of a 10 per cent. solution of neutral potassium oxalate, fill the flask up to the mark, filter after a quarter of an hour, and titrate 50 c.c. of the filtrate by normal hydrochloric acid. Each c.c. of the twice-normal alkali used up is =0.04032 g. MgCl₂. To the percentage of MgO 0.2 per cent. should be added (Precht. Z. anal. Chem., 1879, p. 438).

B.—Commercial Potassium Chloride.

Weigh out 7.640 g. and proceed exactly as described under A, 2 (a), p. 205. The calculation is also made in the same manner.

Potassium chloride made from vinasses contains much sulphate and a little carbonate, which is estimated alkalimetrically.

C.—Potassium Sulphate.

Proceed just as in the case of sodium sulphate, p. 148. The potassium must sometimes be estimated, which is done as on p. 205 for A, 2 (b).

D.—Leblanc Process for the Manufacture of Potassium Carbonate.

Both the raw materials and the intermediate products are tested like those for the soda process, pp. 166 et seq.

E.—Beet Ashes.

For this material, which seldom occurs in the English trade, special methods have been worked out by Heyer (*Chemiker-Zeitung*, 1891, p. 1489 et seq.), and by Alberti and Hempel (*ibid.*, p. 1623).

F.—Commercial Carbonate of Potash.

- Available Alkali is titrated with normal hydrochloric acid, as on p. 178.
- 2. Total Potassium is estimated according to p. 205, A (b), so that all sulphate is converted into chloride. Of course, initially,

more hydrochloric acid must be employed in order to decompose the carbonate.

- 3. Chloride is estimated by decinormal silver solution, p. 146. 1 c.c. of this=0.007456 g. KCl.
- 4. Sulphate is estimated as BaSO₄, p. 109. 1 g. BaSO₄=0.7465 K_2 SO₄.
 - 5. Insoluble matter, as on p. 178.
- 6. Silicate.—Saturate the salt with hydrochloric acid, evaporate to dryness, moisten with HCl, evaporate again, dissolve in dilute HCl, filter, wash, and strongly ignite the SiO₂. This test is only made exceptionally, and the potassium silicate is calculated together with the carbonate.
- 7. Phosphate is estimated by the magnesia method, and is treated like the silicate.
 - 8. Calculation of the Analyses.—Calculate:—
- (a) K_2CO_3 from the difference between the total potassium and that corresponding to the Cl and SO_3 found.
- (b) Na_2CO_3 from the difference between the total available alkali and the K_2CO_3 as calculated in (a).
 - (c) KCl and
 - (d) K₂SO₄ as above.
 - (e) Water and
 - (f) Insoluble matter, if necessary also iron, by a special test.

1. SPECIFIC GRAVITIES OF SOLUTIONS OF POTASSIUM CARBONATE AT 15°.

	Specific Gravity.	Degrees Twaddell.	Degrees Baumé.	Per cent. K ₂ CO ₃ .	1 cb.m. contains kg. K ₂ CO ₃ .
	1.000	0	0	0	0
- 1	1.005	1	0.7	0.50	5.0
- 1	1.010	2	1.4	1.04	10.50
	1.015	3	2.1	1.60	16.24
	1.020	4	2.7	2.10	21.42
ļ	1.025	5	3.4	2.64	27.06
	1.030	6	4.1	3.21	33.06
	1.035	7	4.7	3.77	39.02
	1.040	8	5.4	4.34	45.14
	1.045	9	6.0	4.90	51.21
	1.050	10	6.7	5.47	57.44
	1.055	11	7.4	6.00	63.30
	1.060	12	8.0	6.50	68.90
	1.065	13	8.7	7.07	75.30
	1.070	14	9.4	7.60	81.32
	1.075	15	10.0	8.10	87.08
	1.080	16	10.6	8.67	93.64
	1.085	17	11.2	9.20	99.82
i i	1.090	18	11.9	9.70	105.73
	1.095	19	12.4	10.20	111.69
	1.100	20	13.0	10.70	117.70
	1.105	21	13.6	11.26	124.42
	1.110	22	14.2	11.80	130.98
	1.115	23	14.9	12:30	137.15
	1.120	24	15.4	12.80	143.36
	1.125	25	16.0	13.30	149.63
	1.130	26	16.5	13.80	155.94
	1.135	27	17.0	14.30	162:31
	1.140	28	17.7	14.80	168.72
	1.145	29	18:3	15.30	175.19
	1.150	- 80	10.0	15.80	181.70
	1.150	30	18·8 19·3	16:30	188.27
	1.155	31	19.8	16.80	194.88
	1.160	32	20.3	17:30	201.55
	1.165	33	20.3	17.80	201 33
	1.170	34	20.9		
	1 175	35	21.4	18.30	215.03
	1.180	36	22.0	18.80	221.84
	1.185	37	22.5	19.26	228.23

SPECIFIC GRAVITIES OF SOLUTIONS OF POTASSIUM CARBONATE AT 15°—Continued.

Specific Gravity.	Degrees Twaddell.	Degrees Baumé.	Per cent. K ₂ CO ₃ .	1 cb.m. contains kg. K ₂ CO ₃ .
1.190	38	23.0	19:70	234.43
1.195	39	23.5	20.20	241.39
1.200	40	24.0	20.70	248:40
1.205	41	24.5	21.15	254.86
1.210	42	25.0	21.60	261.36
1.215	43	25.5	22.05	267.91
1.220	44	26.0	[,] 22·50	274.50
1.225	45	26.4	22.96	281-26
1.230	46	26.9	23.41	287.94
1.235	47	27.4	23.90	295.17
1.240	48	27.9	24.40	302.56
1.245	49	28.4	24.86	309.51
1.250	50	28.8	25.32	316.50
1.255	51	29 3	25.80	323.79
1.260	52	29.7	26.30	331.38
1.265	53	30.2	26.77	338.64
1.270	54	30.6	27.17	345.06
1.275	55	31.1	27.60	351-90
1.280	56	31.5	28.05	359.04
1.285	57	32.0	28.50	366.23
1.290	58	32.4	28.96	373.58
1.295	59	32.8	29.42	380.99
1.300	60	33.3	29.97	389.61
1.305	61	33.7	30.43	397.11
1.310	62	34.2	30.86	404.27
1 .315	63	34.6	31.24	A10·81
1.320	64	35.0	31.60	417.12
1.325	65	35.4	32.06	424.80
1.330	66	35.8	32.52	432.52
1.335	67	36.2	32.96	440.02
1.340	68	36.6	33.38	447 29
1.345	69	37.0	33.80	454.61
1.350	70	37.4	34.22	461 97
1.355	71	37.8	34.64	469.37
1 .360	72	38.2	35.06	476.82
1.365	73	38.6	35.48	484.30
1.370	74	39.0	35.90	491.83

SPECIFIC GRAVITIES OF SOLUTIONS OF POTASSIUM CARBONATE AT 15°—Continued.

Specific Gravity.	Degrees Twaddell.	Degrees Baumé.	Per cent. K ₂ CO ₃ .	1 cb.m. contains kg. K ₂ CO ₃ .
1:375 1:380	75 76	39·4 39·8	36·32 36·74	499·40 507·01
1.385	77	40.1	37.17	514.80
1.390	78	40.5	37.60	522.64
1.395	79	40.8	38.02	530:38
1.400	80	41.2	38.45	538.30
1.405	81	41.6	38.88	546.26
1.410	82	42.0	39.30	554.13
1.415	83	42.3	39.73	562.19
1.420	84	42.7	40.16	570.27
1.425	85	43.1	40.59	578.41
1.430	86	43.4	41.02	586.59
1.435	87	43.8	41 '45	594.81
1.440	88	44.1	41.85	602.64
1.445	89	44 • 4	42.22	610.08
1.450	90	44.8	42.58	617:41
1.455	91	45.1	42.97	625 21
1.460	92	45.4	43.37	633 20
1 465	93	45.8	43.77	641.23
1.470	94	46.1	44.17	649:30
1.475	95	46.4	44.57	657.41
1.480	96	46.8	44.96	665.41
1 485	97	47.1	45.38	673.89
1.490	98	47.4	45.81	682.57
1.495	99	47.8	46.24	691.29
1.500	100	48.1	46.66	699.90
1.505	101	48.4	47.03	707.80
1.510	102	48.7	47.40	715.74
1.515	103	49.0	47.78	723.87
1.520	104	49.4	48.15	731.88
1.525	105	49.7	48.53	740 08
1.530	106	50.0	48.90	748.17
1.535	107	50.3	49.26	756.14
1.540	108	50.6	49.61	763.99
1.545	109	50.9	49.96	771 -88
1.550	110	51 •2	50.33	780.12
1.555	111	51.5	50.70	788-39
1.560	112	51.8	51.07	796 69
1.565	113	52.1	51.45	805 19

2. INFLUENCE OF TEMPERATURE ON THE SPECIFIC

0° C.	5°.	10°.	15°.	20°.	25°.	30°.	35°.	40°.	45°.	60°.
1.588	1.586	1·583	1.580	1 577	1.574	1.571	1.568	1.566	1.563	1.559
1.577	1.575	1·573	1.570	1 568	1.565	1.568	1.560	1.557	1.554	1.551
1.567	1.565	1·563	1.560	1 558	1.555	1.553	1.550	1.548	1.545	1.543
1.557	1.554	1·552	1.550	1 548	1.546	1.544	1.541	1.538	1.586	1.583
1.547	1.544	1·542	1.540	1 538	1.536	1.584	1.531	1.528	1.526	1.528
1.536	1.534	1.532	1.530	1.528	1.526	1.524	1.521	1.518	1.615	1.512
1.526	1.524	1.522	1.520	1.518	1.516	1.514	1.511	1.508	1.505	1.502
1.516	1.514	1.512	1.510	1.508	1.506	1.503	1.500	1.498	1.495	1.492
1.506	1.504	1.502	1.500	1.498	1.496	1.493	1.490	1.488	1.485	1.482
1.496	1.494	1.492	1.490	1.488	1.486	1.484	1.481	1.478	1.475	1.472
1.486	1.484	1.482	1.480	1.478	1.476	1·474	1·471	1.468	1.465	1·462
1.476	1.474	1.472	1.470	1.468	1.466	1·464	1·461	1.458	1.455	1·452
1.466	1.464	1.462	1.460	1.458	1.456	1·454	1·451	1.448	1.445	1·442
1.456	1.454	1.452	1.450	1.448	1.446	1·444	1·441	1.438	1.435	1·432
1.446	1.444	1.442	1.440	1.438	1.436	1·484	1·431	1.428	1.425	1·422
1.436	1.434	1·432	1·430	1.428	1.426	1·424	1.420	1:418	1·414	1·411
1.426	1.424	1·422	1·420	1.418	1.416	1·414	1.410	1:408	1·404	1·401
1.416	1.414	1·412	1·410	1.408	1.406	1·404	1.401	1:398	1·395	1·392
1.406	1.404	1·402	1·400	1.898	1.396	1·394	1.891	1:388	1·385	1·382
1.396	1.394	1·392	1·390	1.388	1.386	1·384	1.881	1:378	1·376	1·373
1.356	1.384	1.382	1.380	1.378	1.376	1·374	1.371	1.868	1:365	1.853
1.376	1.374	1.372	1.370	1.368	1.366	1·364	1.361	1.358	1:356	1.859
1.866	1.864	1.362	1.360	1.358	1.366	1·354	1.351	1.348	1:346	1.843
1.356	1.854	1.352	1.350	1.348	1.346	1·344	1.341	1.338	1:336	1.838
1.346	1.344	1.342	1.340	1.838	1.336	1·334	1.331	1.328	1:326	1.828
1.336	1:334	1·382	1.830	1.328	1·326	1 824	1:321	1·318	1·316	1·318
1.326	1:324	1·822	1.820	1.318	1·316	1 314	1:311	1·308	1·306	1·308
1.316	1:314	1·812	1.310	1.308	1·806	1 303	1:300	1·299	1·295	1·292
1.306	1:304	1·302	1.300	1.298	1·296	1 298	1:290	1·288	1·285	1·282
1.296	1:294	1·292	1.290	1.288	1·286	1 283	1:280	1·276	1·275	1·273
1.285	1·284	1.282	1·280	1·278	1·276	1·278	1·270	1·268	1·265	1·263
1.276	1·274	1.272	1·270	1·268	1·265	1·263	1·260	1·257	1·255	1·252
1.266	1·264	1.262	1·260	1·258	1·255	1·253	1·250	1·247	1·245	1·242
1.266	1·254	1.252	1·250	1·249	1·246	1·243	1·240	1·288	1·285	1·282
1.246	1·244	1.242	1·240	1·238	1·236	1·233	1·230	1·228	1·225	1·222
1.236	1.284	1·232	1·280	1·228	1·226	1·224	1·222	1·219	1·217	1·214
1.226	1.224	1·222	1·220	1·218	1·216	1·214	1·212	1·209	1·207	1·204
1.216	1.214	1·212	1·210	1·208	1·206	1·204	1·202	1·199·	1·197	1·194
1.206	1.204	1·202	1·200	1·198	1·196	1·194	1·192	1·189	1·187	1·164
1.196	1.194	1·192	1·190	1·188	1·186	1·184	1·182	1·179	1·177	1·174
1·186	1·184	1·182	1·180	1·178	1·176	1·174	1·172	1·170	1·167	1·164
1·175	1·173	1·171	1·170	1·168	1·166	1·164	1·162	1·160	1·167	1·155
1·165	1·163	1·161	1·160	1·158	1·156	1·154	1·152	1·150	1·147	1·145
1·156	1·158	1·151	1·160	1·148	1·146	1·144	1·142	1·140	1·137	1·185
1·144	1·143	1·141	1·140	1·138	1·136	1·134	1·132	1·130	1·127	1·125
1·138	1·132	1·131	1·130	1·128	1·126	1·124	1·122	1·120	1·117	1·114
1·123	1·122	1·121	1·120	1·118	1·116	1·114	1·112	1·110	1·107	1·104
1·113	1·112	1·111	1·110	1·108	1·106	1·104	1·102	1·100	1·097	1·094
1·103	1·102	1·101	1·100	1·098	1·096	1·094	1·092	1·090	1·087	1·084
1·093	1·092	1·091	1·090	1·089	1·087	1·086	1·088	1·081	1·079	1·077
1.083	1.082	1.081	1.080	1.079	1·077	1.076	1:073	1·071	1.069	1·067
1.078	1.072	1.071	1.070	1.069	1·067	1.066	1:054	1·062	1.060	1·058
1.068	1.062	1.061	1.060	1.050	1·057	1.050	1:054	1·052	1.050	1·048
1.053	1.052	1.051	1.050	1.049	1·047	1.046	1:044	1·042	1.040	1·039
1.043	1.042	1.041	1.040	1.039	1·037	1.086	1:084	1·082	1.030	1·028
1.033	1.082	1.031	1.080	1.028	1.027	1.025	1·024	1·022	1.020	0.008
1.023	1.022	1.021	1.020	1.018	1.017	1.015	1·014	1·012	1.010	1.008
1.018	1.012	1.011	1.010	1.008	1.007	1.005	1·004	1·002	1.000	0.008

GRAVITIES OF SOLUTIONS OF POTASSIUM CARBONATE.

55°.	60°.	65°.	70°.	75°.	80°.	85°.	90°.	96°.	100°.
1.556	1.558	1.550	1:546	1.542	1.538	1.584	1.580	1.526	1.521
1.548	1.545	1.641	1:587	1.533	1.530	1.526	1.522	1.518	1.518
1.589	1.536	1.582	1:528	1.525	1.522	1.517	1.518	1.609	1.505
1.530	1.527	1.524	1:521	1.517	1.513	1.509	1.504	1.601	1.498
1.520	1.517	1.514	1:511	1.508	1.504	1.500	1.497	1.494	1.490
1.509	1·507	1.504	1.500	1·497	1·494	1·491	1.488	1.485	1·481
1.499	1·497	1.494	1.490	1·487	1·484	1·481	1.478	1.475	1·471
1.489	1·487	1.484	1.480	1·477	1·474	1·471	1.468	1.465	1·461
1.479	1·476	1.474	1.470	1·467	1·464	1·461	1.458	1.465	1·451
1.469	1·466	1.464	1.460	1·457	1·454	1·450	1.447	1.444	1·441
1.459	1·456	1·454	1.450	1·447	1:444	1:440	1:437	1·484	1·431
1.449	1·446	1·444	1.440	1·487	1:484	1:481	1:428	1·424	1·421
1.439	1·436	1·434	1.430	1·427	1:424	1:421	1:418	1·414	1·411
1.429	1·426	1·423	1.420	1·417	1:414	1:410	1:408	1·405	1·402
1.419	1·416	1·413	1.410	1·407	1:404	1:400	1:398	1·396	1·392
1.409	1.406	1:404	1.401	1:398	1·895	1·391	1:388	1:386	1.382
1.399	1.396	1:394	1.891	1:388	1·385	1·381	1:378	1:375	1.372
1.390	1.387	1:384	1.880	1:377	1·874	1·371	1:368	1:365	1.362
1.380	1.877	1:374	1.370	1:367	1·364	1·361	1:358	1:355	1.352
1.370	1.867	1:364	1.861	1:358	1·365	1·351	1:348	1:345	1.342
1.360	1·357	1·854	1·351	1·348	1·345	1.841	1.338	1·335	1·382
1.350	1·347	1·844	1·341	1·338	1·835	1.882	1.329	1·326	1·328
1.340	1·337	1·834	1·381	1·328	1·825	1.822	1.319	1·316	1·813
1.380	1·327	1·324	1·321	1·318	1·815	1.812	1.309	1·306	1·303
1.320	1·317	1·314	1·311	1·308	1·305	1.802	1.299	1·296	1·293
1·310	1·807	1.804	1·801	1·298	1·295	1·292	1·289	1·286	1·284
1·300	1·297	1.294	1·291	1·283	1·285	1·282	1·279	1·276	1·274
1·290	1·287	1.284	1·281	1·278	1·276	1·273	1·270	1·267	1·264
1·280	1·277	1.274	1·271	1·268	1·266	1·263	1·260	1·257	1·254
1·270	1·267	1.264	1·261	1·258	1·256	1·258	1·250	1·247	1·244
1.260	1·257	1·254	1·261	1·243	1.246	1·248	1·240	1·237	1.284
1.250	1·247	1·244	1·242	1·239	1.286	1·234	1·231	1·228	1.225
1.240	1·287	1·234	1·232	1·229	1.226	1·224	1·221	1·218	1.215
1.280	1·227	1·224	1·221	1·218	1.216	1·218	1·210	1·208	1.205
1.220	1·217	1·214	1·211	1·208	1.206	1·208	1·200	1·198	1.195
1·212	1·209	1·205	1·202	1·198	1·196	1·194	1-192	1·188	1·186
1·202	1·199	1·196	1·198	1·190	1·187	1·184	1-182	1·178	1·176
1·192	1·189	1·186	1·183	1·180	1·178	1·175	1-172	1·169	1·167
1·182	1·179	1·176	1·178	1·171	1·168	1·165	1-162	1·159	1·157
1·172	1·169	1·166	1·164	1·161	1·158	1·155	1-152	1·149	1·146
1·162	1·159	1·156	1·154	1·151	1·148	1·145	1·142	1·139	1·186
1·152	1·150	1·147	1·144	1·141	1·138	1·135	1·132	1·129	1·126
1·142	1·140	1·187	1·184	1·181	1·128	1·125	1·122	1·119	1·116
1·132	1·130	1·128	1·125	1·122	1·118	1·115	1·112	1·109	1·106
1·122	1·120	1·118	1·115	1·112	1·108	1·105	1·102	1·099	1·096
1·112	1:110	1·108	1·105	1·102	1.098	1.095	1.092	1.089	1.086
1·102	1:100	1·098	1·095	1·092	1.038	1.085	1.082	1.078	1.076
1·092	1:090	1·087	1·084	1·082	1.079	1.075	1.072	1.069	1.067
1·082	1:080	1·077	1·074	1·072	1.069	1.065	1.062	1.059	1.057
1·074	1:071	1·068	1·065	1·063	1.060	1.057	1.054	1.050	1.048
1.066	1:062	1.059	1.056	1.054	1.051	1.048	1.045	1:041	1.038
1.056	1:053	1.050	1.047	1.045	1.042	1.089	1.036	1:082	1.029
1.046	1:044	1.041	1.088	1.086	1.033	1.030	1.026	1:028	1.020
1.036	1:088	1.031	1.028	1.025	1.022	1.019	1.016	1:013	1.010
1.026	1:023	1.021	1.018	1.015	1.012	1.009	1.006	1:003	1.000
1.016 1.007 0.998	1·014 1·004 0·994	1.012 1.002 0.992	0.989 0.999	1.006 0.996 0.986	1.002 0.998 0.988	0.980 0.990 0.990	0.996 0.987 0.977	0.998 0.984 0.974	0·990 0·981 0·971

8. SPECIFIC GRAVITY OF SOLUTIONS OF POTASSIUM HYDROXIDE AT $\frac{15^{\circ}}{4^{\circ}}$. Calculated from the results obtained by Pickering (*Journ. Chem. Soc.*, lxiii., 890).

Specific	Degrees Twaddell.	Degrees Baumé.	100 parts	by weight	1 cb.m. c	ontains kg.
Gravity.	Twadden.	Daume,	K ₂ O.	кон.	К₂О.	кон.
1.000	0	0	0.00	0.00	0.00	0.00
1.005	1	0·7	0.50	0.60	5.03	6.03
1.010	2	1·4	0.99	1.18	10.00	11.92
1.015	3	2·1	1.45	1.73	14.72	17.56
1.020	4	2·7	1.91	2.28	19.48	23.26
1.025	5	3·4	2·37	2·82	24·29	28·91
1.030	6	4·1	2·82	3·36	29·05	34·61
1.035	7	4·7	3·27	3·90	33·84	40·37
1.040	8	5·4	3·73	4·44	38·79	46·18
1.045	9	6·0	4·19	4·99	43·79	52·15
1.050	10	6·7	4.64	5.53	48.72	58.07
1.055	11	7·4	5.10	6.08	53.81	64.14
1.060	12	8·0	5.54	6.60	58.72	69.96
1.065	13	8·7	6.00	7.15	63.90	76.15
1.070	14	9·4	6.45	7.68	69.02	82.18
1.075	15	10.0	6.90	8·22	74·18	88·37
1.080	16	10.6	7.35	8·76	79·38	94·61
1.085	17	11.2	7.79	9·28	84·52	100·69
1.090	18	11.9	8.24	9·82	89·82	107·04
1.095	19	12.4	8.68	10·37	95·05	113·22
1·100	20	13.0	9.13	10.87	100.43	119:57
1·105	21	13.6	9.62	11.46	106.30	126:63
1·110	22	14.2	10.00	11.92	110.00	132:31
1·115	23	14.9	10.44	12.44	116.41	138:71
1·120	24	15.4	10.88	12.96	121.86	145:15
1·125	25	16.0	11:32	13·48	127·35	151.65
1·130	26	16.5	11:76	14·01	132·89	158.31
1·135	27	17.0	12:21	14·53	138·58	164.92
1·140	28	17.7	12:63	15·04	143·98	171.46
1·145	29	18.3	13:06	15·56	149·53	178.16
1·150	30	18.8	13.50	16.08	155 · 25	184.92
1·155	31	19.3	13.92	16.58	160 · 78	191.50
1·160	32	19.8	14.36	17.10	166 · 58	198.36
1·165	33	20.3	14.79	17.62	172 · 30	205.27
1·170	34	20.9	15.22	18.13	178 · 07	212.12
1.175	35	21.4	15.65	18.64	183-89	219.02

SPECIFIC GRAVITY OF SOLUTIONS OF POTASSIUM HYDROXIDE AT $\frac{15^{\circ}}{4^{\circ}}$ —Continued.

Specific	Degrees	Degrees	100 parts con	by weight tain	1 cb.m. co	ontains kg.
Gravity.	Twaddell.	Baumé.	K ₂ O	кон.	К2О.	кон.
1.180	36	22.0	16:08	19.15	189.74	225.97
1.185	37	22.5	16.51	19.66	195.64	232.97
1.190	38	23.0	16.93	20.17	201.47	240.02
1.195	39	23.5	17.35	20.66	207:33	246.89
1.200	40	24.0	17.77	21.17	213:24	254.04
1.205	41	24.5	18.18	21.66	219.07	261.00
1.210	42	25.0	18.60	22.16	225.06	268 14
1.215	43	25.5	19 03	22.67	231 21	275.44
1.220	44	26.0	19.45	23.17	237.29	282.67
1.225	45	26.4	19.86	23.66	243.29	289.84
1.230	46	26.9	20.27	24.14	249.32	296.92
1.235	47	27.4	20.69	24.64	255.52	304 30
1.240	48	27.9	21.10	25.13	261.64 267.80	311·61 318·97
1.245	49	28.4	21.51	25.62	207.80	919.91
1.250	50	28.8	21 .91	26.10	273.88	326.25
1.255	51	29.3	22.32	26.59	280.12	333.70
1.260	52	29.7	22.73	27.07	286.40	341.08
1·265 1·270	58 54	30·2 30·6	23·14 23·54	27·56 28·04	292.72	348.63 356.11
	"-					
1.275	55	31.1	23.94	28.52	305.24	363.63
1.280	56	31.5	24.35	29.00	311.68	371.20
1.285	57	32·0 32·4	24.75 25.15	29.48	318·04 324·44	378·82 386·48
1·290 1·295	58 59	32.4	25.55	30.43	330.87	394 07
				""		
1.300	60	33.3	25.95	30.91	337.35	401 83
1.305	61 62	33·7 34·2	26·34 26·73	31·37 31·84	343·74 350·16	409·38 417·10
1·310 1·315	63	34.6	27.13	32.31	356.76	424.88
1.320	64	35.0	27.52	32.78	363:26	432.70
1 325	65	35.4	27.91	33.24	369.81	440 43
1.330	66	35.8	28.29	33.70	376.26	448.21
1.335	67	36.2	28.68	34.16	382.88	456.04
1.240	68	36.6	29.07	34.63	389.54	464.04
1.345	69	37.0	29.46	35.09	396 24	471.96
1.350	70	37.4	29.85	35.55	402.98	479.98
1.355	71	37.8	30.23	36.01	409.62	487.94
1.360	72	38.2	30.61	36.46	416.30	495.86

SPECIFIC GRAVITY OF SOLUTIONS OF POTASSIUM HYDROXIDE AT $\frac{15^{\circ}}{4^{\circ}}$ —Continued.

Specific Gravity.	Degrees Twaddell.	Degrees Baumé.	100 parts by weight contain		1 cb.m. contains kg.	
			K ₂ O.	KO4.	K₂O.	КО₄.
1.365	73	38.6	30.99	36.92	423.01	503.96
1.370	74	39.0	31.37	37:37	429.77	511.97
1:375	75	39.4	31.76	37.83	436.70	520.16
1.380	76	39.8	32.14	38.28	443.53	528.26
1:385	77	40.1	32.52	38.73	450.40	536.41
1.390	78	40.5	32.89	39.18	457.17	544.60
1.395	79	40.8	33.27	39.63	464.12	552.84
1.400	80	41.2	33.66	40.09	471.24	561:26
1.405	81	41.6	34.03	40.53	478.12	569.45
1.410	82	42.0	34.40	40.98	485.04	577.82
1.415	83	42.3	34.77	41.42	492.00	586.09
1.420	84	42.7	35.15	41.87	499.13	594.55
1.425	85	43.1	35.53	42.32	506:30	603.06
1.430	86	43.4	35.90	42.76	513.37	611.47
1.435	87	43.8	36.27	43.20	520.47	619-92
1.440	88	44.1	36.63	43.63	527.47	628-27
1.445	89	44.4	36.99	44.06	534.51	636-67
1.450	90	44.8	37:36	44.50	541.72	645.25
1.455	91	45.1	37.72	44.93	548.83	653.73
1.460	92	45.4	38.09	45.37	556.11	662.40
1 .465	93	45.8	38.45	45.80	563.29	670.97
1.470	94	46.1	38.81	46.23	570.51	679.58
1.475	95	46.4	39.17	46.66	577.76	688-24
1.480	96	46.8	39.54	47.09	585.19	696-93
1.485	97	47.1	39.89	47.51	592.37	705.52
1.490	98	47.4	40.24	47.93	599.58	714.16
1.495	99	47.8	40.60	48.36	606.97	722.98
1.500	100	48.1	40.95	48.78	614.25	731 .70
1.505	101	48.4	41.31	49-20	621.72	740.46
1.510	102	48.7	41.68	49.64	629.37	749.56
1 515	103	49.0	42.03	50.06	636.75	758.41
1.520	104	49.4	42.38	50.48	644-18	767:30
1.525	105	49.7	42.73	50-90	651.63	776.23
1.530	106	50.0	43.09	51 32	659.28	785.20
1.535	107	50.3	43.44	51.74	666.80	794 21
1.540	108	50·6	43.78	52.15	674.21	803.11

XI. AMMONIA MANUFACTURE.

A.—Gas-Liquor.

This liquor generally contains the ammonia principally in the state of carbonate and sulphide, which can be driven off by boiling, without employing lime or alkali, and which are indicated by alkalimetrical testing (volatile ammonia). There is, however, always a certain quantity of ammonia present in the state of salts which are not appreciably volatilised by mere boiling, and not indicated by simple testing with standard acid. These are the chloride, thiocyanate, sulphite, thiosulphate, sulphate, ferrocyanide (fixed ammonia). No other salts need be enumerated.

For technical purposes, it is sufficient to make the following

tests:—

- 1. Volatile Ammonia.—Dilute 20 c.c. of gas-liquor with 100 c.c. water, add 30 c.c. of normal hydrochloric acid, and boil till all CO_2 and $\mathrm{H}_2\mathrm{S}$ is expelled. Titrate back with seminormal alkali, employing the ordinary indicators. If the liquor is too much coloured to see the change of the indicator, dilute it with water or employ litmus paper. Or else run 10 c.c. of the gas-liquor into a beaker containing 250 c.c. water, add 2 drops methyl orange solution (1:1000), and titrate at once in the cold with normal hydrochloric acid. If the indicator is destroyed by $\mathrm{H}_2\mathrm{S}$, add another drop of it. Each c.c. of normal acid corresponds to 001703 g. N H_3 , or to 008515 parts N H_3 by weight, in 100 vols. of gas-liquor; or to 04216 ounces of rectified oil of vitriol (of 93 per cent. $\mathrm{SO}_4\mathrm{H}_2$) per gallon of gas-liquor.
- 2. Total Ammonia.—Put 20 c.c. of gas-liquor, with about as much water, into the flask A, Fig. 17, and charge the receivers B and C with 30 c.c. of normal hydrochloric acid previously diluted to twice its volume. The greater portion of this mixture should be contained in the U-tube B. Make the connection and run 3 c.c. concentrated caustic soda solution into A through the pinch-cock funnel a. Apply heat and keep up a gentle distillation for one or two hours, when all NH₃ will be driven off and absorbed in B and C. Unite the contents of these vessels and titrate back with seminormal caustic soda. If a c.c. of this are used, $30 \frac{a}{2}$ indicates the c.c. of acid corresponding to the total ammonia, and calculated as in Test No. 1.
- 3. Total Sulphur.—Run 50 c.c. of gas-liquor, drop by drop, into bromine, covered by hydrochloric acid, evaporate to dryness

on the water-bath, and precipitate the sulphuric acid formed by

barium chloride, as described p. 109.

Sometimes it may be desirable to deduct from the total sulphur that originally present in the gas-liquor as sulphate, which is estimated by boiling the unoxidised gas-liquor with HCl and proceeding as above.

4. Thiocyanate.—Evaporate 50 c.c. of gas-liquor to dryness, heat the residue at 100° C., for three or four hours, digest it with strong alcohol, filter, wash on the filter with alcohol, evaporate all the alcoholic solutions to dryness, dissolve in water, filter from


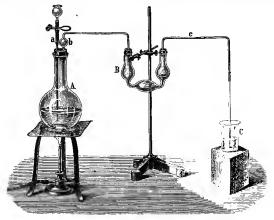


Fig. 17.

any residue, add a mixed solution of sulphurous acid and cupric sulphate, and heat gently, when cuprous thiocyanate will be precipitated. Wash the precipitate of CuCNS into a flask, dissolve it in nitric acid, boil for some time, and precipitate the Cu as CuO by NaOH. The weight of CuO \times 0°9561 = the equivalent amount of (NH₄) CNS (Dyson, S.C.I., 1883, p. 231). Or else proceed by titration, employing a solution containing 6°236 g. CuSO₄, 5H₂O per litre, 1 c.c. of which is equivalent to 0°00145 g. SCN = 0°00190 g. (NH₄) SCN, which is added to a boiling solution, to which some sodium bisulphite has been added, till a drop of the mixture, brought into contact with a drop of a solution of potassium ferrocyanide in 20 parts of water, produces immediately a brown coloration (Barnes and Liddell, S.C.I., 1883, p. 122).

B.—Sulphate of Ammonia.

1. Estimation of Ammonia.—The average sample, carefully drawn, is well ground up, passed completely through a sieve with 10 holes to the linear inch, and a smaller sample is taken from this. Weigh 17:03 g. of the latter sample in a stoppered tube, dissolve and dilute to 500 c.c., and place 50 c.c. of the solution without filtration into the apparatus, Fig. 17 (p. 218). The test is carried out exactly as in A, No. 2. Each c.c. of the quantity $30-\frac{a}{2}$ is = 0:01703 g. NH₃ or = 1:0 per cent. The analysis of sulphate of ammonia is, however, best, and much more quickly performed by the bromine method, in which the NH₃ is converted

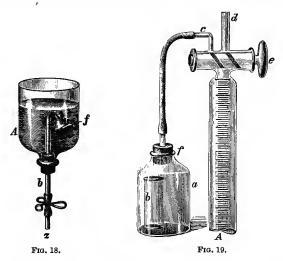

into nitrogen. This method can be carried out in the "Azotometer," or in Lunge's gas-volumeter (p. 139), if the latter is provided with a "decomposing flask," as shown in Fig. 18. The necessary "brominated soda" is prepared by dissolving 100 g. 70 per cent. caustic soda in 1250 g. water, and cautiously adding 25 g. bromine. The reagent must be kept in a dark, cool place, but even then does not keep more than a few days. The ammonium salt, preferably dissolved in water, is introduced into the outer space of the decomposing flask a, Fig. 19, and 25 or 30 c.c. brominated soda poured into the inner vessel b. The cork f, having been already attached to the volumeter-tube by means of

a short rubber tube, is pressed tightly down into the flask a. taking hold of this only by the neck; the pressure thus produced is relieved by momentarily pulling out the stopper of the volumeter-tap e. If thereby the mercury in A should sink a little, it is brought back to the zero point by raising the "level-tube," while A communicates through d with the outer air. When the temperatures are equalised and the mercury is up to the tap, this is put in such a position that a communicates through c with A; then the flask a is tilted so that the contents of b run into the outer space; the flask is then shaken till no more gas is evolved. The mercury levels in A and the level-tube are made to coincide, after waiting a quarter of an hour, or, better, half an hour, in order to cool down the flask. (This may be expedited by placing a both before and after the operation, in a large vessel filled with water of the temperature of the room.) When the levels have been exactly adjusted, as described p. 141, so as to bring the gas to the volume it would occupy at 0° and 760 mm. in the dry state, read off the number of c.c. of gas in A; each c.c. = 0.0012818 g. N=0.0015582 g. NH₃ (this includes the necessary correction for absorption or incomplete evolution of N). In order to save all calculations, dissolve 1.558 g. sulphate of ammonia in 100 c.c. of water, and employ 10 c.c. = 0.1558 g. for each test; in this case each c.c. of gas contained in A=1 per cent, NH₃.

2. Thiocyanate.—Cf. p. 118, A, No. 4.

3. Free Acid is found by titration with decinormal soda solution

and methyl orange.

4. Moisture is estimated by drying 50 g. in a stove at 100° up to constancy of weight.

C.—Liquor Ammoniæ.

This is mostly sold by specific gravity, the relation of which to the percentage of NH₃ is shown in the subjoined table No. 1.

The empyreumatic substances in liquor ammoniæ are detected qualitatively by the smell on exact neutralisation with sulphuric acid. The pyridine bases (which do not redden phenolphthalein) can be tested for by the method of Pennock and Morton (Journ. Amer. Chem. Soc., vol. xxiv., p. 377). Neutralise 100 c.c. of the liquor exactly by sulphuric acid, employing methyl orange as indicator and cooling the vessel used from the outside; distil into a flask charged with 30 c.c. water until this volume has increased to about 100 c.c., add phenolphthalein and a solution of mercuric chloride until the liquid is decolorised, then a few more drops of the mercury solution (thereby precipitating the NH₃), filter, and titrate with decinormal acid and methyl orange, each c.c. of which = 0.0079 g. pyridine.

The testing of liquid ammonia, as sent out in iron bottles, is

described in Tech. Meth., vol. ii.

1. SPECIFIC GRAVITIES OF SOLUTIONS OF AMMONIA AT 15°. (Lunge and Wiernik.)

Specific Gravity.	Per cent. $ m N\dot{H}_3$.	1 litre contains grams NH ₃ at 15°.	Correction of specific gravity for ± 1° C.	
1.000	0.00	0.00	0.00018	
0.995	1.14	11.34	0.00019	
0.990	2.31	22.87	0.00020	
0.985	3.55	34.97	0.00021	
0.980	4.80	47.04	0.00023	
0.975	6.05	58.99	0.00024	
0.970	7.31	70.91	0.00025	
0.965	8.59	82.89	0.000265	
0.960	9.91	95.13	0.00029	
0.955	11.32	108.11	0.000315	
0.950	12.74	121.03	0.00034	
0.945	14.17	133.91	0.000365	
0.940	15.63	146.92	0.00039	
0.935	17.12	160.07	0.00041	
0.930	18.64	173.35	0.00042	
0.925	20.18	186.67	0.000445	
0.920	21.75	200.10	0.00047	
0.915	23:35	213.65	0.000495	
0.910	24.99	227 •41	0.00052	
0.905	26.64	241.09	0.000545	
0.900	28.33	254.97	0.00057	
0.895	30.03	268.77	0.000595	
0.890	31.73	282.40	0.00061	
0.885	33.67	297 •98	0.000635	
0.880	35.60	313.28	0.00066	

2. SPECIFIC GRAVITIES OF SOLUTIONS OF COMMERCIAL AMMONIUM CARBONATE, AT 15°C. (Lunge and Smith.)

Degrees Twaddell.	Degrees Baumé.	Specific Gravity at 15°.	Per cent. Commercial Ammonium Car- bonate.	Change of Specific Gravity for ± 1° C.
1	0.6	1.005	1:66	0.0002
1 2	1.4	1.010	3.18	0.0002
3	2.1	1.015	4.60	0.0003
2 3 4	2.7	1.020	6.04	0.0003
5	3.4	1.025	7.49	0.0003
5 6 7 8	4.1	1.030	8.93	0.0004
7	4.7	1.035	10.35	0.0004
8	5.4	1.040	11.86	0.0004
9	6.0	1.045	13.36	0.0005
10	6.7	1.050	14.83	0.0005
11	7.4	1.055	16.16	0.0005
12	8.0	1.060	17.70	0.0005
13	8.7	1.065	19:18	0.0005
14	9.4	1.070	20.70	0.0005
15	10.0	1.075	22:25	0.0006
16	10.6	1.080	23.78	0.0006
17	11.2	1.085	25.31	0.0007
18	11.9	1.090	26.82	0.0007
19	12.4	1.095	28.33	0.0007
20	13.0	1.100	29.93	0.0007
21	13.6	1.105	31 · 77	0.0007
22	14.2	1.110	33.45	0.0007
23	14.9	1.115	35.08	. 0.0007
24	15.4	1.120	36.88	0.0007
25	16.0	1.125	38.71	0.0007
26	16.5	1.130	40.34	0.0007
27	17 1	1.135	42.20	0.0007
28	17.8	1.140	44.29	0.0007
29	17.9	1.1414	44.90	0.0007

XII. MANUFACTURE OF COAL-GAS (ILLUMINATING GAS).

A.--Coal-Gas.

For a satisfactory analysis of coal-gas the Orsat apparatus (p. 95) is not sufficiently accurate, and the gas-burettes of Bunte, Hempel, Drehschmidt, or Pfeiffer should be used. The following

rules are taken from the private notes, printed for Professor Bunte's

students, with his permission.

The analysis is performed by means of Bunte burettes, which must satisfy the following conditions:-The capillary tube below the bottom tap must not allow any water to come out, even on The upper (three-way) tap must be made so as to shut off communication with any one of the three outlets. (The Greiner-Friedrichs patent tap, with two oblique bores, as shown in Fig. 16, p. 171, admits of doing this without any difficulty.) The taps should be greased with a mixture of 2 parts para-gum, 2 parts beeswax, and 10 parts tallow, and they must be tight even in a strong vacuum. The confining water must have the temperature of the room, and this must remain unchanged during the whole time occupied by the work. The burette must be held only at the top funnel or at the capillary tubes. The correctness of its graduation must be controlled by running out its contents of water in portions of 10 c.c., and weighing these. When one of the components of the gas has been absorbed, first allow the water to rise from below and then adjust the pressure by allowing water to run in from the top funnel. To do this, fill it to the mark, open the tap and wait a minute, until the surface of the water inside the burette remains constant.

To take a sample of the gas to be tested, employ either an empty burette, or one filled with water. In the former case, connect the top tap (the funnel being charged with water) sideways with the gasholder or pipe, the bottom tap being open, and allow the gas to pass through, until it has driven out all the air; then shut first the bottom tap and immediately afterwards the top tap. In the second case fill the burette with water, connect the top tap with the gasholder or pipe, open the bottom tap, until the water has sunk a little below the zero mark, then shut first the top tap and afterwards the bottom tap.

If the gas is at a lower pressure than the atmospheric pressure, take the sample by means of a rubber bellows, or a water aspirating bottle, or a water-pump, and connect then with the bottom

capillary.

Measuring the gas in the burette.—Adjust the three-way tap so that all its bores are closed, fill the funnel with water up to the mark, connect the rubber tube of the pressure bottle (levelling bottle), previously entirely filled with water, with the bottom tap, and allow the water to rise up to about 0°2 c.c. above the zero mark. Now open the three-way tap, whereupon a little gas escapes and the pressures are equalised. The water then usually stands at the zero mark; if not, read the actual volume and calculate from this. Then turn the three-way tap, after having put a short rubber tube on its lateral outlet, so as to run a little water into this, and close the tube by a small piece of glass rod. As long as the tap is not used, it remains in this position.

Introduction of the absorbing liquids.—Draw off the confining liquid by means of the aspirating bottle, holding the bottom tap fast in its position, and shutting it at once when the water has got down to the capillary. Take the rubber tube off and draw the liquid back into the aspirating bottle, lest it should siphon itself off. Then pour the absorbing liquid into a small porcelain capsule, and allow it to rise in the burette.

The various gases are estimated, *seriatim*, as follows:—

1. Carbon Dioxide, CO₂, by absorption with a solution of caustic potash, 1 in 3 water—that is, specific gravity 1.23. Of this 1 c.c. takes up 90-100 c.c. CO₂. It is sufficient, if the inside of the burette is once wetted with the solution. Afterwards water is allowed to enter from below and to run in from the top, to wash the glass; then the normal pressure is re-established and the volume read off. In the case of crude gas the H₂S must be first removed by a tube containing pumice soaked with cupric sulphate.

2. Heavy hydrocarbons, C_mH_n .—Draw out the confining water as completely as possible, rinse off the potash solution with a little water (which is also drawn off), allow about 10 c.c. of water, saturated with bromine, to enter, and shake the burette. When the space above the liquid ceases to show the brown colour of the bromine, draw off the liquid and replace it by fresh bromine water. Finally, in order to absorb the bromine vapour, draw about 1 c.c. of caustic potash solution into the burette, shake this up in the burette, allow a little water to run in at the top, establish the normal pressure, and read off the volume. Thus all the illuminants are absorbed—i.e., ethylene and the other unsaturated hydrocarbons, also benzene vapour.

3. Oxygen is absorbed by drawing in about 2.5 c.c. of a solution of pyrogallol (1 to 5 water) and after this 7.5 c.c. caustic potash solution (1:3). Shake well for five minutes, run in water through the funnel until the pressure is equalised, shake again, and continue this until no more water will enter the burette. Run off the dark liquid at the hottom, allowing water to run in at the top, so that a layer of clear water remains at the top, which allows

a correct reading after re-establishing the pressure.

Accurate estimations of oxygen are made by titration with potassium iodide, manganous chloride, and thiosulphate, as des-

cribed in Tech. Meth., vol. i., pp. 209 and 334.

4. Carbon Monoxide.—Draw off the confining water, wash with more water, draw in 10 c.c. ammoniacal solution of cuprous chloride (made by dissolving 200 g. commercial cuprous chloride and 250 ammonium chloride in 750 water, placing a copper spiral in the bottle, and before use mixing 3 vols. of this solution with 1 vol. liquor ammoniæ, specific gravity 0 905), shake for one minute, draw off the solution, replace it by a fresh quantity, shake again, and repeat this procedure at least twice. After the last removal of the absorbent, run through the funnel 3 or 4 c.c. concentrated

hydrochloric acid, and then a little water, which forms a layer at the top. Draw off the liquid, wash with water, draw in 1 or 2 c.c. concentrated potash solution, shake up, allow some water to enter,

re-establish the normal pressure, and take the reading.

5. Hydrogen.—The gas now contains nothing but H, CH4, and The hydrogen is estimated by fractional combustion, for which purpose a second burette (B) is needed. Measure in the first burette (A) 22 to 25 c.c. of the residual gas under normal pressure, and mix with air for burning the hydrogen. For this purpose open first the bottom tap, then the top tap, so as to communicate outwards, whereupon water will run out and air enter. When the level of the water has gone down to about 5 c.c. below 0, quickly shut the top tap and after this the bottom tap, mix the gases by shaking, regulate the pressure to that of the atmosphere plus that of the column of water in the funnel, and read the volume. Now fill burette B up to the capillary and connect both three-way taps, interposing a palladium tube, C, between them. C is a tube of glass of high melting point, 10 c.c. long, 3 mm, bore, and 5 mm, thick. It contains a 100 mm, of palladium wire, 0.3 mm. thick, folded into four and introduced into the central part of tube C. By heating this part of the tube, it is made to collapse and to hold the wire fast; the remaining portion of C is loosely filled with long fibrous asbestos. The connection between C and the capillaries of A and B is made by short, thick-walled rubber tubing.

Now turn both three-way taps so that both are closed, fill the funnel of burette A with water, lower the pressure by opening the bottom tap for a moment, turn both three-way taps at the same time and quickly, so that C communicates with the interior of both burettes, and heat C. The air in C thus increases its volume, and forces the water in the capillaries back into both burettes. Now connect the rubber tube of the pressure bottle with the lower tap of A, open this tap, heat C at its narrowed part until the small flame turns yellow, and open the lower tap of B, so that the gas passes from A through C into B in a moderately quick current. The water should issue from B in a continuous jet, not in single drops, and the palladium wire should not become red-hot on the side where the gas enters; otherwise some methane would be burnt together with the hydrogen. As soon as the water has got to the top of the burette A, quickly shut first the bottom tap of A and then that of B, and syphon the gas back from B to A as described above. After cooling, the pressure in A is made equal to the normal; the volume is then read, and the contraction ascertained.

Example: 100 c.c. coal-gas, taken for analysis, after absorbing CO₂, heavy hydrocarbons, O and CO, left 85 c.c. Of this 22.2 c.c. were transferred to burette A, and diluted with air to 105.3.

of 19.0. Calculating this upon a 100 c.c. of the original gas, we find $\frac{19.0 \times 85.0}{22.2} = 72.8$.

Therefore the hydrogen amounts to $\frac{2 \times 72.8}{3}$ =48.5 per cent.

As a final control, estimate the *oxygen* left after combustion; it must be less than that originally employed by two-thirds of the contraction observed.

6. Methane is estimated, together with hydrogen, by burning another portion of the gas remaining after the operations 1 to 4, in the "explosion burette." For this, measure off 12 to 15 c.c. of this gas, draw in an excess of air, shake up, ascertain the volume, draw off the confining water, explode by means of an electric spark (generated by a battery and induction coil), ascertain the contraction, let 1 or 2 c.c. potash solution run down inside the burette, and after this, slowly, some water, adjust the pressure and ascertain the total contraction, which is equal to H₂O+CO₂. From this deduct the amount corresponding to the hydrogen found in No. 5; one-third of the remaining contraction corresponds to the methane, for 1 vol. CH₄+2 vols. O₂=0 vols. CO₂+0 vols. H₂O.

Example: Residual gas employed, 12.7 c.c. (forming part of the 86 c.c. remaining after the absorption of CO₂, C_mH_n, O₂, and CO); after addition of air=104.1; therefore air employed=91.4. After the explosion remain 78.9 c.c. gas; therefore contraction

=25.2; calculated upon the total gas $\frac{85 \times 25.5}{12.7}$ = 168.8. From this deduct the contraction due to hydrogen, according to No. 5, = 72.8;

this leaves for the methane a contraction of 168.8 - 72.8 = 96.0, or one-third of it=32.0 per cent, methane.

7. Nitrogen is represented by the deficit from 100 after estimating all the other constituents. Suppose we have found:—

The estimation of ethylene, benzene, acetylene, naphthalene, hydrogen sulphide, total sulphur, ammonia, cyanogen, etc., is described in Lunge-Keane's *Tech. Meth. of Chem. Anal.*, vol. ii., pp. 659 et seq.

The calorific power of coal-gas is best ascertained by means of the Junckers calorimeter, which is always sold with instructions for use.

B. Purifying Material (Spent Oxide).

1. Cyanogen (Bueb).—Boil 20 g. of an average sample of spent oxide (from which the sulphur has been previously extracted as below), or the same quantity of pressed "cyanide mud," with 100 c.c. caustic potash solution (specific gravity 1.26) and 200 c.c. water for half an hour, dilute to 1010 c.c. (reckoning 10 c.c. for the volume of the solid substance), and pass through a dry filter. Take 25 c.c. of the filtrate, add 50 c.c. water and 10 c.c. dilute sulphuric acid (1:10), and titrate with zinc solution. This solution is made as follows:—Dissolve 10.2 g. of pure crystallised zinc sulphate (ZnSO₄, 7H₂O), together with 10 c.c. sulphuric acid of specific gravity 1.7 in water, make up to 1 litre, and compare this with a freshly made solution of 10 g. pure crystallised potassium ferrocyanide in 1 litre, in the following manner:—To 25 c.c. of the ferrocyanide solution add 50 c.c. water and 10 c.c. dilute sulphuric acid. This mixture is titrated with the zinc solution, testing for the completion of the reaction by drops put on to filter paper (preferably Schleicher and Schüll's, No. 601, mark S) soaked with a 1 per cent. solution of ferric chloride. The end of the reaction is reached when no blue coloration is produced on the paper.

Other methods for the estimation of cyanides (described by Knublauch and by Drehschmidt) are given in *Tech. Meth.*, vol. i.,

pp. 546 et seq., and vol. ii., p. 725.

2. Sulphur.—Extract 15 g. of the air-dried mass in a Soxhlet apparatus with 100 c.c. carbon disulphide in a 200 c.c. round-bottomed flask of known weight. Heat on a water-bath, condensing the vapours by a reflux condenser, until twenty extractions have been made. Distil off the CS₂, remove the last portions by hot air, and after cooling again weight he flask. The difference

between the weighings=S.

Sometimes it is desirable to know the amount of S which on burning the oxide forms SO₂, since a certain quantity of S is always retained by lime, etc., on burning the spent mass. For this purpose Pfeiffer burns 1 g. of the sample, by putting a piece of tinder in a litre flask filled with oxygen and previously charged with 25 or 30 c.c. of normal caustic soda solution. Finally he adds 1 c.c. neutral 30 per cent. hydrogen peroxide and titrates back with standard HCl and methyl orange. Each c.c. of the normal soda solution consumed corresponds to 1.6 per cent. of S burnt.

Processes for estimating all the essential constituents of spent oxide are described in *Tech. Meth.*, vol. ii., pp. 723 to 730.

XIII. CALCIUM CARBIDE AND ACETYLENE.

A.—Raw Materials.

(a) Coke, see p. 93.

(b) Limestone, see p. 157.

B.—Technical Calcium Carbide.

(a) The sampling in this case has to be done with special care, since it is anything but easy to obtain a small sample representing the real average quality. The sample is quickly crushed in an iron mortar, provided with a rubber cover, or in a coffee-mill,

and the powder must be kept free from contact with air.

(b) The estimation of the yield of gas should always be made by actual measurement of the gas, not by loss of weight. Take 50 g. carbide, and put it into a glass tube, 2 or 3 cm. wide inside, which is connected with the gas-generating flask (250 c.c.) by a rubber tube so that the carbide can be dropped in small quantities into the flask. 150 c.c. water, previously saturated with acetylene, are first placed in the flask, the cork of which is also provided with an exit-tube connected with a measuring bottle. This bottle holds 20 litres, and has a division on which ½ litre can be read It is connected by means of a lateral neck just over the bottom and by a rubber tube with a level-bottle of the same size, filled with water saturated with acetylene. By raising the levelflask, the water is forced into the measuring flask up to its neck; during the time the gas is given off, the level-flask is lowered, so that there is never any notable pressure in the measuring bottle. When all the gas has been collected in the latter, the level-bottle is placed so that the water is exactly at the same level in both bottles, and about two hours are allowed for the temperature to reach that of the surrounding air. Read the thermometer and barometer, and reduce the volume of the gas by the tables, pp. 36 et seq., to the normal state, regarding it as saturated with moisture. If, as usual, the reduction is to be made not to 0°, but to 15° C., this can be done with sufficient accuracy by the formula:

$$V = \frac{v}{100} (140.2 - 0.6 t) \frac{B}{100}$$

where V is the volume at 15°, w the volume at t°, and B the (corrected height) of the barometer. (Cf. Tech. Meth., vol. ii., pp. 590 et seq.)

(c) Impurities.—It is best to test for these, not in the carbide, but in the acetylene given off from it. Put 70 or 80 g. carbide, crushed to the size of a pea, into a previously weighed, well-dried,

half-litre flask, and weigh it on an ordinary balance which turns to 0°1 g. The cork of this flask is fitted with a dropping funnel, contracted at the outlet, with glass tap, and with a side tube connected with a ten-bulb tube, like that shown in Fig. 8, p. 119. The latter contains 75 cm. of a 2 to 3 per cent. solution of sodium hypochlorite. Run from the funnel three to seven drops of water on to the carbide, and shake the flask gently from time to time. The gas should all be liberated in three or four hours; it may, if required, be measured, or else allowed to escape. Then the flask is filled up to its neck, so as to drive all the gas into the bulb-tube, and in the contents of the latter the phosphoric acid which has been formed by the hypochlorite from the hydrogen phosphide contained in the gas, is estimated by the ordinary magnesia method.

If it is required to estimate the *sulphur* also, which escapes principally as H_2S , divide the contents of the bulb-tube in two portions, estimate in one of these the phosphoric acid as above, and in the other the sulphuric acid, formed from the H_0S , as

BaSO₄.

XIV. EXAMINATION OF THE RAW MATERIALS AND PRODUCTS OF THE MANUFACTURE OF FERTILISERS.

N.B.—This section is based on the resolutions agreed to at the Fifth International Congress of Applied Chemistry at Berlin (1903).

A.—Sampling.

Samples must be taken out of every tenth sack in the case of shipments in bulk, in at least ten places, by means of the sampling-auger, described on p. 251; in the case of ship cargoes, from every fiftieth tub; the total weight to be about 300 g. for each of the three normal samples. In the case of unequal composition, the samples must be ground and mixed; in the case of moist fertilisers, this must be done by hand.

B.—Moisture.

Moisture in crude phosphates, bone charcoal, etc., is estimated by drying 10 g. at 100° up to constancy of weight; in the case of gypsum, during three hours. If the substance alters its percentage of moisture during grinding, the moisture must be determined both in the coarsely crushed and in the finely ground sample, and the result of the analysis is to be calculated on the original coarsely crushed sample.

C.—The Insoluble Matter.

The insoluble matter is determined in 10 g. of the sample. (a) When dissolving in mineral acids, after rendering the silica insoluble by heating on the water-bath during several hours, or on the air-bath to 120°, the residue must be ignited. (b) When dissolving in water, the residue must be dried at 100° up to constancy of weight.

D.—Phosphoric Acid.

1. Preparation of the Solutions.

(a) Phosphates soluble in water.—Shake 20 g. in a litre flask with about 800 g. water for half an hour, and fill up to the mark. Solutions of so-called double superphosphates must be boiled with addition of nitric acid (10 c.c. concentrated nitric acid to 25 c.c. of the solution) before precipitating the phosphoric acid, in order to convert any pyrophosphoric acid present into orthophosphoric acid.

(b) Phosphates soluble in Ammonium Citrate are treated according to Petermann's method. In the case of superphosphates containing upwards of 20 per cent. P₂O₅, take 1 g.; of those containing 12 to 20 per cent. P₂O₅, 2 g.; if there is less than 10 per cent., P₂O₅, and, in the case of composite fertilisers, 4 g. for each sample. Grind it first dry, then with 20 to 25 c.c. water, decant on to a filter, and wash with water until the volume of the filtrate is about 200 c.c. If the filtrate is not quite clear, add a drop of nitric acid. Put the filter and residue into a 250 c.c. flask, add 100 c.c. of the ammonium citrate solution (prepared as below), digest about fifteen hours at the ordinary temperature, with frequent shaking, then one hour at 40°, allow to cool, fill up to the mark, take 50 c.c. of the filtrate and 50 c.c. of the above aqueous solution, mix these, boil with 10 c.c. concentrated nitric acid for ten minutes, and estimate the total phosphoric acid soluble in water and in citrate by the molybdenum or the citrate method.

Preparation of the Ammonium Citrate solution.—Dissolve 500 g. citric acid in water, neutralise with ammonia, allow to cool, reduce the specific gravity to 1'09, and add to a litre of this solution 50 c.c. liquor ammoniæ, specific gravity 0'92. The specific gravity of the final solution should be from 1'082 to 1'083.

(c) Total Phosphoric Acid.—Boil 5 g. with a mixture of three parts hydrochloric acid (specific gravity 112), and 1 part nitric acid (specific gravity 120), or with 20 c.c. concentrated nitric acid and 50 c.c. concentrated sulphuric acid for half an hour, and make up to 250 c.c.

(d) In Thomas-Slag Phosphates the phosphoric acid is estimated in the portion which passes through a 2-millimetre sieve, but the result is calculated upon the whole sample, including the coarser portion. The following estimations are made:—

1. Phosphoric Acid soluble in Citric Acid.—Shake 5 g. Thomas phosphate in a half-litre flask, previously charged with 5 c.c. alcohol, with a 2 per cent solution of pure citric acid during half an hour at $17\frac{1}{2}^{\circ}$, in a revolving agitator which makes thirty to forty revolutious per minute.

2. Total Phosphoric Acid.—Soak 10 g. Thomas phosphate (for the analysis of fine flour passed through sieve No. 100=0'19 mm. mesh) in a half-litre flask with 5 c.c. water, then boil with 50 c.c. concentrated sulphuric acid half an hour, stirring frequently,

and fill up to the mark.

2.- Examination of the Solutions.

For phosphoric acid, according to one of the following methods:—

(a) Molybdenum method, according to Wagner.—To 25 or 50 c.c. solution, free from silica and containing from 0.1 to 0.2 g. P_2O_5 add so much concentrated solution of ammonium nitrate (750 g. per litre) and so much molybdenum solution (150 g. ammonium molybdate, dissolved in 1 litre water and poured into 1 litre nitric acid of specific gravity 1.2) that the total liquid contains 15 per cent. ammonium nitrate, and for each 0.1 g. P₂O₅ not less than 50 c.c. molybdenum solution. Heat to 80° or 90° for ten minutes, put aside for an hour, filter, wash the precipitate with dilute solution of ammonium nitrate (150 g. (NH₄)NO₃+10 c.c. nitric acid in 1 litre) until there is no reaction for calcium, pierce the filter, wash the precipitate into a beaker by means of a $2\frac{1}{2}$ per cent. liquor ammoniæ, dissolve it by stirring, and add so much ammonia that the total volume is 75 c.c. Then add for each 0.1 g. P₂O₅ 10 c.c. of magnesium mixture (55 g. crystallised magnesium chloride + 70 g. ammonium chloride, dissolved in 1 litre of 2.5 per cent. liquor ammoniæ), in single drops, stirring constantly, cover the beaker, allow to stand for two hours, filter the precipitate, wash it with 2.5 per cent. ammonia until the reaction for chlorine ceases, and dry at 100°. Detach the precipitate from the filter, place it in a platinum crucible, add the rolled-up filter, and carbonise it in a covered crucible; then heat the crucible for ten minutes in an upright position over the Bunsen flame and for five minutes on the blowpipe.

(b) Citrate method.—In the case of aqueous solutions of superphosphate, employ 50 c.c. citrate solution for 50 c.c. of the phosphate solution, corresponding to 1 g. substance; in that of acid solutions of bone meal, fish guano, Thomas-slag, flour, etc., take 100 c.c. of the citrate solution for 50 c.c. of the phosphate solution (=\frac{1}{2}\text{ g. substance}). The citrate solution is made by dissolving 1100 g. pure citric acid in water, adding 4 litres of 24 per cent. liquor ammoniæ, and making up to 10 litres. After adding the citrate solution, add at once 25 c.c. magnesium mixture (550 g. magnesium chloride + 1050 ammonium chloride, dissolved in 6\frac{1}{2}\text{ litres water}

+3½ litres 27 per cent. liquor ammoniæ), and shake or stir for half an hour. Filter the precipitate, preferably by means of a Gooch or Neubauer crucible (see below), rinse the beaker with 5 per cent. liquor ammoniæ, and wash the precipitate five or six times with the same solution, using a filter pump. Dry the crucible on a hot plate until the mass begins to crack, ignite for three to five minutes (preferably in a Roessler furnace), and allow to cool in a desiccator. After weighing, the crucible may at once be used for a fresh determination, without removing the precipitate, and thus thirty or forty estimations can be made in it without renewing the asbestos filter.

This method involves several errors, which, however, compensate one another, so that when the above details are strictly adhered to, the final result is perfectly correct. According to the resolutions of the Union of the German Agricultural Research Stations in 1903, the citrate method is the only one admissible

for all fertilisers, except crude phosphates.

The preparation of a Gooch crucible—that is, a platinum crucible with platinum sieve and asbestos filter—is a little trouble-

some; it is described in Tech. Meth., vol. i., p. 25.

The Neubauer crucible (sold by W. C. Heræus, Hanau) is similar to the Gooch crucible, but contains a platinum sponge filter on the sieve. It is ready for use, as obtained from the dealers, and is much more convenient than a Gooch crucible.

E.-Free Acids.

(a) The total free acid is estimated by titration with caustic soda solution and methyl orange.

(b) Free phosphoric acid is estimated gravimetrically in the

alcoholic extract, as described above.

F.—Ferric Oxide and Alumina.

In Germany the accepted method is that of E. Glaser. Dissolve 5 g. phosphate in 25 c.c. nitric acid (specific gravity 1'2) + 12'5 c.c. hydrochloric acid (specific gravity 1'12), and dilute to 500 c.c. Put 100 c.c. (=1 g. of the phosphate) in a 250 c.c. flask, add 25 c.c. concentrated sulphuric acid (specific gravity 1'84); after five minutes' shaking add 100 c.c. 95 per cent. alcohol, allow to cool, fill up to the mark with alcohol, shake well, and fill up again. After waiting for half an hour, filter, heat 100 c.c. of the filtrate in a platinum dish until the alcohol is driven off, transfer to a beaker, add 50 c.c. water, and heat to boiling. Remove the flame, add NH3, till the reaction is alkaline, boil off the excess of NH3, allow to cool, filter, wash with hot water, ignite, and weigh. The weight found is assumed to be aluminium phosphate +ferric phosphate, or 50 per cent. of it=Fe₂O₃+Al₂O₃.

G .- Nitrogen.

1. Nitric-nitrogen is estimated gas-volumetrically by the nitrometer (pp. 137 and 139), or by Schloesing-Grandeau's method (Tech. Meth., vol. ii., p. 381), or by one of the methods for reducing it to NH₃. The following method is due to Ulsch. Into a narbottomed half-litre flask put 25 c.c. of the aqueous nitrate The following method is due to Ulsch. Into a flatsolution (which ought to contain at most 0.5 g. KNO5=0.4 g. NaNO₃) and 10 c.c. dilute sulphuric acid (1 vol. concentrated acid +2 vols. water), add 5 g. commercial "ferrum hydrogenio reductum" (iron reduced by hydrogen), and close the flask with a pear-shaped glass vessel of 25 c.c. capacity filled with water, which at the same time serves as a reflux condenser. Heat first cautiously, then more strongly, at least for half a minute to full boiling (altogether five minutes), dilute with 50 c.c. water, add 20 c.c. caustic soda solution (specific gravity 1.25), and distil the NH₃ formed into titrated hydrochloric or sulphuric acid. The distillation may be finished in five to seven minutes after the commencement of the boiling. By titrating back the excess of acid the quantity of NH₃ is ascertained; each c.c. normal acid saturated = 0.01401 g. N or 0.06302 HNO₃ or 0.10116 KNO₃ or 0.08506 NaNO3.

2. Ammoniacal nitrogen, cf. p. 217. Preferably distil with freshly calcined magnesia, 3 g. to 1 g. NH₃. In the case of ammoniacal superphosphates, the solution prepared as on p. 230

should be used.

3. Total nitrogen is estimated in presence of nitrates by Kjeldahl-Jodlbauer's method. Place 1 g. substance in a flask of difficultly fusible glass holding about 350 c.c., slowly add 30 c.c. phenolsulphuric acid (made by dissolving 200 g. P₂O₅ in 500 c.c. concentrated sulphuric acid, and 40 g. phenol in 500 c.c. concentrated sulphuric acid, and uniting the two solutions, after cooling), shaking continuously, and cooling by placing the flask in cold water. When finished, agitate for another half-hour or hour, add a drop of mercury (about 1 g.), and then gradually 2 to 3 g. dried zinc dust, with good agitation and cooling. Allow to stand for one or two hours; then boil until the solution has become clear and colourless, allow to cool, wash with water into a distilling flask, add 110 c.c. of caustic soda solution of specific gravity 1.285 (which must be free from nitrogen compounds), distil the NH₃ into normal hydrochloric acid, and estimate it by retitrating. The calculation is made as above, sub G, 1.

Damp substances are ground up with a little gypsum before

adding the phenolsulphuric acid.

4. Organic nitrogen, in the absence of nitrates and ammonium salts, is estimated according to Kjeldahl-Wilfarth's method. Put 1 g. substance in a 150 c.c. long-necked flask of Bohemian glass, add a drop of mercury and 25 c.c. of concentrated sulphuric acid,

to a litre of which 200 g. P_2O_5 and 15 g. K_2SO_4 have been added. Heat at first slowly, then to violent boiling, putting the flask, or several flasks, on a wire gauze in a slanting position. The whole is best placed on a sheet of lead with turned-up edges, covered with a thick layer of sand and placed under a hood, so that no damage is done if a flask is cracked. In the case of badly frothing liquids put a little paraffin in the flask and close this loosely by a Kreusler's stopper, i.e., a glass tube drawn out below into a long point, and sealed at the bottom. Continue the boiling until the contents of the flask are quite clear, which may take half an hour to three hours. Then wash its contents by the aid of 200 c.c. water into a half-litre flask, add 100 c.c. caustic soda solution of specific gravity 1 285 (free from N) and 1 to 1 5 g. zinc dust, and distil into titrated HCl, proceeding just as in No. 1.

In the case of substances which cannot be finely ground, prepare a good average sample by weighing off 3 to 5 g., boil with 50 to 60 c.c. sulphuric acid and 2 to 3 g. mercury, wash, after cooling, into a 300 c.c. flask, filling this up to the mark, mix by shaking, and take 100 c.c. for the distillation with caustic soda

and zinc dust.

H.-Potash.

Potash is estimated as in potassium chloride containing sulphate, p. 205, or by the perchloric acid method, *Tech. Meth.*, vol. ii., p. 413.

Details for the examination of the various fertilisers, ibid.,

pp. 418 et seq.

XV. ALUMINA PREPARATIONS.

A.—Raw Materials.

1. Kaolin (china clay), see p. 238, sub "Clay."

2. Bauxite (a).—Dry 2.500 g. at 100° for eight hours, boil with 30 c.c. of a mixture of 1 part concentrated sulphuric acid +1 water, with good agitation, until vapours of SO₃ begin to escape, allow to cool, run the paste slowly into 300 c.c. cold water so as to prevent heating (which would cause a precipitation of TiO₂), add 10 c.c. hydrochloric acid, digest six hours with agitation, filter the solution (a) from the precipitated crude silica and make it, with the washings, up to 500 c.c. Ignite the crude silica, weigh it, evaporate with 2 c.c. hydrofluoric acid and three drops of dilute sulphuric acid, and ignite; the residue is weighed as Al₂O₃, and by deducting it from the crude silica we obtain the pure SiO₂.

(b) Take 200 c.c. of the solution (a) (=1 000 g. bauxite), neutralise with sodium carbonate until a slight precipitate begins to

appear, bring this again into solution by adding a few drops of dilute sulphuric acid, reduce the contained iron to the ferrous state by NaHSO₃ or gaseous SO₂, dilute to 400 or 450 c.c., boil for two hours, replacing the evaporated water by an aqueous solution of SO₂. The titanic acid is thus precipitated. Allow to cool, make to 500 c.c., pour through a dry filter and wash the TiO₂ with warm water containing a little ammonium chloride, but keep the washings separate from the first filtrate. Dry, ignite, and weigh the TiO₂.

(c) Boil 125 c.c. of the first filtrate obtained in (b) (=0.250 g. bauxite) till the SO₂ has been removed, add a little zinc, dilute strongly, and estimate the *iron* by titration with permanganate, after having rendered the solution slightly acid by sulphuric acid,

as described p. 154.

(d) Alumina, Ferric oxide, and Titanic acid together are estimated in the first solution (a). Take 25 c.c. of this solution (=0·125 g. bauxite), add a little furning nitric and hydrochloric acid, dilute considerably, add NH3 in slight excess, boil up for a moment, filter, dissolve the precipitate again in hydrochloric acid, precipitate again with NH3 wash, filter, dry, and weigh. By adding the alumina found in (a), and deducting the TiO2 found in (b), and the ferric oxide in (c), we obtain the remainder = Alumina.

(e) Ignite a fresh sample of dried bauxite for a quarter of an hour by means of the blowpipe; the loss of weight is = chemically

combined water+organic matter.

B .- Control of Working Conditions.

1. The residue from decomposing the bauxite is tested by boiling 2 g. with 3 c.c. concentrated sulphuric acid +3 c.c. water until the red colour is destroyed, diluting a little, filtering, and making the filtrate up to 100 c.c. In this we estimate:

(a) Iron in 10 c.c. by reducing it to the ferrous state and

titrating with KMnO₄, p. 154.

(b) Ferric oxide+Alumina by precipitation with NH₃.

(c) Soluble soda by boiling 20 c.c. with a solution of ammonium chloride and absorbing the NH₃ set free in titrated hydrochloric acid.

2. Aluminate solution.—In this we estimate Na₂O and Al₂O₃ in the same operation, as described below for sodium aluminate.

C.—Commercial Products.

1. Sulphate of Alumina and Alum:

(a) Estimation of Alumina—(a) Gravimetric estimation.—Dissolve 10 g. in water, dilute to $\frac{1}{2}$ litre, take 50 c.c. of the clear solution=1 g. of the substance, add ammonia in slight excess, boil up for a moment, filter, wash, dry the precipitate, ignite, and weigh the Al₂O₃. It is slightly contaminated with traces of iron, silicate, and phosphoric acid, which may be neglected.

(β) Volumetric Analysis.—Dissolve 5 g. in water, dilute to $\frac{1}{2}$ litre, take out 50 c.c. = 0.5 g. substance, neutralise the free acid by dilute solution of caustic soda (indicator: methyl orange, till the pink changes to yellow), then add phenolphthalein, and titrate with standard caustic soda solution until the red colour appears. Each c.c. of the NaOH solution corresponds to 0.1703 g. Al₂O₃.

N.B.—This method gives only approximate results, unless a number of precautions, detailed in *Tech. Meth.*, vol. i., p. 613,

are observed.

(b) Iron cannot be estimated either gravimetrically or by titration, on account of its small quantity. Hence it is estimated colorimetrically by Lunge and Kéler's method. We require for this a number of small stoppered cylinders of white glass, 13 mm. internal diameter, 17 cm. high, containing 25 c.c. divided in 0.1 c.c., and a free space of 5 c.c. above the 25 c.c. mark. Also the following reagents:—(1) a 10 per cent. solution of potassium thiocyanate; (2) pure ether; (3) a solution of 8.630 g. ammonium-iron-alum and 5 c.c. concentrated sulphuric acid in 1 litre; (4) a solution prepared from (3) by diluting it in the proportion of 1:100, so that this solution contains 10 mg. Fe per litre. It should be kept protected from sunlight, but even then keeps only for a few days, whereas solution (3), when protected from air and light, keeps a long time without getting turbid; (5) pure nitric acid. It is hardly possible to obtain nitric acid absolutely free from iron, but this does not matter, if it gives only a slight pink colour with potassium thiocyanate, since very little of it is used, and an equal quantity for the check test as

for the actual test.

Dissolve 1 or 2 g. of the aluminium sulphate, weighed exactly, in a little water, add exactly 1 c.c. of the pure nitric acid (5), heat a few minutes, allow to cool, and dilute to 50 c.c. Put 5 c.c. of this solution into one of the colorimeter cylinders, A. (N.B.—If this method is applied to estimate traces of iron in sulphuric acid, this is diluted in the same way.) Into a second cylinder, B, put 5 c.c. of dilute nitric acid, obtained by diluting 1 c.c. of (5) to 50 c.c., and a certain accurately measured quantity of the ironalum solution (3), e.g., 1 c.c. Add as much pure water to cylinder A as you put iron solution in B, so as to always have the same degree of dilution in A and B. Then add to both A and B 5 c.c. of the thiocyanate solution (1) and 10 c.c. of the ether (2), put the stopper in and shake thoroughly, until the aqueous layer has become colourless and the red colour has passed over entirely into the ether. The comparison of the colours in A and B is most accurate after a few hours, since they deepen a little on standing, but marked differences can be observed at once. so that three cylinders will suffice, of which A receives the solution to be tested, B and C the quantities of iron most nearly approaching to A. The comparison is made by holding the cylinders a little distance from a white surface (not putting them down upon it!) and looking at them from the top downwards. It is then quite easy to estimate differences of \pm 0.1 c.c. of the iron-alum solution (5), that is of \pm 0.001 mg. Fe in the 5 c.c. employed for analysis, but only when the total quantity of iron does not exceed 2 c.c. of the solution, that is=0.02 mg. Fe. If there should be more than this present, the permanganate method, p. 112, is applicable.

(c) Free acid in aluminium sulphate cannot be directly titrated by any of the hitherto known indicators. Beilstein and Grosse proceed as follows:—Dissolve 1 or 2 g. of the sulphate in 5 c.c. water, add 5 c.c. of a cold saturated solution of ammonium sulphate, stir fifteen minutes, and precipitate with 50 c.c. 95 per cent. alcohol. Wash the precipitate with 50 c.c. alcohol, evaporate the alcohol from the mixed filtrate and washings on the waterbath, and titrate the acid in the residue by decinormal soda solution and phenolphthalein.

(d) Zinc only occurs occasionally in commercial sulphate of alumina, but is very injurious. Estimate it by adding to the solution of the sulphate a sufficient quantity of barium acetate to precipitate all the sulphuric acid, and precipitating the zinc in the

filtrate as ZnS.

2. Aluminate of Soda:

(a) Soda and Alumina.—Dissolve 2 g. in water, dilute to 100 c.c. and titrate 10 c.c. (=0°2 g. substance) quite hot, with phenolphthalein as indicator, by fifth normal hydrochloric acid until the red colour has vanished. The soda only is saturated at this stage, and each c.c. of the acid corresponds to 0°0062 g. Na_2O . Now add a single drop of methyl orange and continue the titration with the same acid, but at a temperature of 30°, until the alumina first precipitated has been redissolved and the red colour has appeared. Each c.c. of acid used in this second titration corresponds to 0°003407 g. Al_2O_3 . The percentage is obtained directly when employing 0°200 g. substance by multiplying the c.c. used in the first titration (a) by 3°105=per cent. Na_2O_3 and those used in the second titration (b) by 1°704=per cent. Al_2O_3 .

(b) Insoluble matter is estimated in 10 to 20 g. substance in the usual manner, but employing "hardened" filtering paper, since ordinary filter paper would not stand the strongly caustic solution.

(c) Silica is estimated by evaporating with hydrochloric acid, digesting the residue with dilute HCl, filtering, washing, igniting,

and weighing the residue.

3. Commercial Alumina is either the hydrate or anhydrous. In this the silica occurring as an impurity is estimated as in 2 (c); total soda by igniting at a red heat, digesting with water, heating with normal HCl, and titrating back the excess of acid; soluble soda by boiling with 100 c.c. water and titration with normal HCl and phenolphthalein; iron in the hydrochloric acid solution as in

No. 1 (b); loss of weight on ignition $(=H_2O+CO_2)$ by heating for fifteen minutes over the blowpipe.

XVI CEMENT INDUSTRY.

A.—Portland Cement.

1. Raw Materials.

(a) Limestone.—(a) Estimate carbon dioxide, as described p. 158, by titration or by volumetric estimation of CO₂, p. 171. It is calculated as CO₂. In the presence of considerable quantities of magnesia (which is considered as an injurious constituent of cement), estimate it in the hydrochloric acid solution, as on p. 148, calculate it as MgCO₃, and calculate the excess of CO₂ as CaCO₃.

(β) Argillaceous residue is the difference between 100 and the carbonates found in (a). If there is much present, it may be

examined like clay, No. (b).

(b) Clay.—The percentage of coarse sand (quartz) is found by elutriation. Weigh 50 g. of the coarsely ground, dried average sample into a rather large porcelain dish, pour over it 100 c.c. dilute hydrochloric acid (1 concentrated acid +8 water), boil for about three hours, allow to cool, pour off the acid and direct a jet of water on to the mass, carefully rubbing it up with the fingers, so that only clay goes away with the water and pure sand remains behind. This plan is better than the application of mechanical elutriating apparatus.

The sand may be sorted by sieves into different sizes, viz., fine dust (down to 0.025 mm.), dust (0.040 mm.), fine sand (0.20 mm.),

coarse sand (above this).

Complete analysis of clay (cf. Tech. Meth., vol. i., pp. 569 et seq.,

and pp. 688 et seq.).

1. Decomposition by means of alkaline carbonate, i.e., a mixture of equal parts potassium carbonate and sodium carbonate, of which 6 to 10 g. are required for one part of clay. Dry the clay at 120°, grind it very finely, mix it intimately with the alkaline carbonate in the platinum crucible itself by means of a platinum or glass spatula (which is afterwards cleaned with a little carbonate), and heat in the covered crucible, first slowly, then up to full, quiet fusion. A good Bunsen or Fletcher burner is preferable to the blowpipe for the heating. After cooling, heat the bottom of the crucible by a small flame to a low red heat twice successively, in order to facilitate the separation of the fused mass, allow to cool, pour a few c.c. of water, and heat gently with a small flame, until the cake detaches itself from the crucible. Wash it into a good-sized platinum dish, cover this with a large watch-glass and heat on the water-bath until the mass has softened and fallen

to powder. Then add an excess of hydrochloric acid, remove the watch-glass, wash its under-surface, and evaporate to dryness on the water-bath. During the evaporation the mass is stirred with a glass rod, so as to render the residue powdery. Then heat the dish in an air-bath to 120° for an hour, moisten it, after cooling, with moderately strong hydrochloric acid, allow to stand for an hour, heat up with water, pour the clear portion through a filter, and continue this treatment until the residue ceases to yield a colour with hydrochloric acid. Then transfer it to a filter, wash, dry, and ignite it first over a small flame, then to constancy of weight, and weigh it as silica. It may still contain some titanic acid. This is separated by evaporating with hydrofluoric acid and concentrated sulphuric acid on the water-bath as a residue which should be tested whether it yields the purple microcosmic salt bead of TiO₂

The filtrate from the titanic acid is divided in two halves. In one of these estimate alumina+ferric oxide by adding pure liquor ammoniæ (free from carbonate) in slight excess, boiling up for a moment, filtering, washing, and igniting. In the other half estimate the *iron* by reducing with zinc and titrating with per-

manganate, cf. p. 112.

In the filtrate from the precipitate of $Al_2O_3 + F_2O_3$, estimate calcium by precipitation with ammonium oxalate (p. 148), and in the filtrate from this magnesium by ammonium phosphate (p. 148).

The Alkalies can be estimated, if desired, by decomposing about 5 g. clay with hydrofluoric acid; cf. Meth. Tech., vol. i., p. 694.
 Sulphur, present as sulphates or pyrites, is estimated by oxidation with aqua regia and precipitating the hydrochloric acid

solution with barium chloride; cf. p. 108.

Carbon dioxide, as in the case of limestone, pp. 158 or 171.
 Loss of weight on ignition over the blowpipe or a powerful gas burner gives water+organic matter+CO₂+sulphur present

as pyrites, etc.

(c) Separation of silica present as quartz, and that present in the form of silicates.—The separation of these two kinds of silica is frequently demanded in so-called "rational analysis of clay." It can be effected by the process of Lunge and Milberg (Z. angew. Chem., 1897, p. 393), on the basis of the observation that extremely finely divided quartz is dissolved by concentrated caustic soda solution, but not by a 5 per cent solution of sodium carbonate, whilst the latter dissolves the silica, separated from silicates by strong acids in an amorphous state, when heated on the water-bath for half an hour. This is applied to the separation of the two modifications of silica as follows:—Heat 5 g. of clay (dried at 120°) with dilute sulphuric acid (50 c.c. concentrated acid+100 c.c. water) to boiling in a porcelain or platinum dish, covered with a watch-glass, until the water has been driven off and fumes of SO₃ begin to escape, allow to cool, dilute with water,

pour off the liquid, moisten the residue with hydrochloric acid, heat for a quarter of an hour, filter, and wash. Wash the moist residue, which contains a mixture of both modifications of SiO₂, into a porcelain dish, make up the solution to about 250 c.c., about 12.5 g. pure anhydrous sodium carbonate, and heat on the water-bath for half an hour. Then pour off the clear liquid and repeat the treatment with 5 per cent. solution of Na₂CO₃ three times. Finally, wash the insoluble matter on to a filter and wash it thoroughly with water containing a little alcohol. The dried and ignited residue consists of the SiO₂ present as quartz; the difference between this and the total SiO₂ found in (b) 1 is the SiO₂ present as silicates.

2. Control of the Working Conditions.

The crude mixture is tested for its percentage of clay and calcium carbonate like limestone; compare A, 1. Usually the estimation of CO_2 (pp. 158 or 171) is sufficient.

The clinker is analysed like the finished cement, if this is

required.

3. Commercial Cement.

Ignite 1 g. cement in a platinum crucible over the blowpipe for fifteen minutes, decompose by hydrochloric acid, filter from the insoluble matter, fuse this with sodium carbonate, dissolve the melt in water, and unite this solution with the filtrate previously obtained. In this solution the following estimations are made:—

(a) Silica is determined by boiling down the united solutions and filtering off the precipitated SiO₂. The filtrate is again concentrated by boiling, and any SiO₂ that separates is united with the first portion. Dry the total (crude) silica, heat on the blowpipe for half an hour, and weigh. Then heat with 10 c.c. hydrofiluriacid and four drops concentrated sulphuric acid till fumes cease to be given off, and deduct the residue from the crude SiO₂; the portion thus removed by volatilisation represents the real SiO₂.

(b) Divide the united filtrates into two halves. In one of these estimate the Sesquioxides, Al₂O₃+Fe₂O₃, by precipitation

with pure liquor ammoniæ, as on p. 239.

(c) Ferric oxide is estimated in the second half of the filtrate from (a), by reducing to the ferrous state by means of zinc or H₂S and titrating with permanganate; cf. p. 112.

(d) Calcium is estimated in the filtrate obtained in (b) by

precipitation with ammonium oxalate, p. 148.

(e) Magnesium in the filtrate from (d), by precipitation with

ammonium phosphate, p. 148.

(f) Sulphates are determined in a special sample by dissolving 1 g. in hot hydrochloric acid, filtering, and precipitating with barium chloride, p. 108.

(g) Total sulphur.—Fuse 1 g. cement with sodium carbonate

and a little potassium nitrate, dissolve in hot water, filter, acidify, and precipitate with barium chloride.

(h) The estimation of alkalies is rather troublesome, and is only carried out in exceptional cases; cf. Tech. Meth., i., p. 694.

(i) The physical tests for fineness of grinding, time of setting, breaking strain, etc., are described ibid.

B.—Hydraulic Lime and Roman Cement.

The raw material for these are marls. In these usually only CO₂ and argillaceous residue are estimated, as in the case of limestone, p. 238.

An accurate analysis can be made as described for clay, p. 238, more especially the separation of the silica present as quartz from that of the silicates.

C.—Puzzuolanas, Trass, Granulated Blast-Furnace Slag.

1. Hygroscopic water is estimated by drying 10 g. at 110.°

2. Chemically combined water.—Ignite 1 g. of the substance dried as in No. 1 in a platinum crucible by means of the blowpipe, a Hempel gas-furnace, or other suitable means. The temperature ought to be raised gradually, so as to attain a red heat in about ten minutes, in order to avoid mechanical losses by dust being carried away through a sudden liberation of steam. After this continue the heating for half an hour to a yellow heat, and then transfer at once to the desiccator. The loss of weight is an important criterion for the hydraulicity.

3. Silica present as silicates should be estimated as well as that of quartz as an important hydraulic factor, as described p. 239.

4. Mechanical tests for fineness of grinding, etc., as for cement. supra, p. 238.

XVII. PREPARATION OF STANDARD SOLUTIONS. Introduction.

The analytical methods given in the foregoing pages are based upon the metric system of weights and measures. As there are still some laboratories in which the English system is used, the following remarks on the relation of the metric to the English

system may prove useful.

The unit of weight of the English system is the grain. normal solutions are prepared so that 1000 grains by volume (100 decems) contain one equivalent of the reagent in grains, and consequently all normal solutions prepared on the English system are identical in concentration with those prepared on the metric system.

English burettes usually hold 1000 grains, and are divided into 100 parts of 10 grains each, called one decem. The decem corresponds to the cubic centimetre. As, however, this unit, the decem, is ten times the unit of weight, the following rules must be observed when any of the data are to be changed from the metric to the English system:—

Instead of Litre read 10,000 grains.

,, Cubic centimetre read decem, or ten times the number of grains.

Grams read ten times the number of graius.

If, for instance, we are told to prepare a standard solution of permanganate by dissolving 15 820 g. of potassium permanganate in 1 litre of water, and that 1 c.c. of such a solution corresponds to 0 028 g. of iron, we shall obtain a solution of equal strength by dissolving 158 20 grains in 10,000 grains of water, and 1 decem of this solution will correspond to 0 28 grain of metallic iron. No errors can possibly occur if the reader will always substitute ten times as many grains for any number of grams, ten times as many grains, or an equal number of decems, for any number of cubic centimetres, and 10,000 grains for every litre. Where we are directed to measure out by means of a pipette 50 c.c., we take 500 grains instead, etc.; but when speaking of the number of cubic centimetres on the burette, we substitute exactly the same number of decems.

It will also be useful to remember that:

Grams per litre = grains per 1000 grains. = ounces per 1000 ounces. = ounces per cubic foot (approximately). Grams per litre ÷ 16 = lbs. per cubic foot. Grams per litre × 70 = grains per 70,000 grains. = grains per gallon. $0.4375 \times \text{grams per cub. metre}$ = grains per cubic foot. = lbs. per 1000 lbs. Kilograms per cubic metre = lbs. per 16 feet. Kilograms per cubic metre = lbs. per cubic foot. 16 x cub. metres per kilogram = cubic feet per lb. Kilograms per square metre = 0.205 lb. per square foot. Kilograms per sq. metre $\times 4.89 = lbs$, per square foot.

A.—Normal Acid and Alkali.

As basis of Alkalimetry and Acidimetry, we employ chemically pure sodium carbonate. This is tested for purity by dissolving 5 g. in water, which ought to yield a perfectly clear, colourless solution; if, after acidifying this solution with

nitric acid, no opalescence is caused by barium chloride, or silver nitrate, the salt may be taken as sufficiently pure. Before using it, the sodium carbonate must be heated in a platinum crucible, which is half-filled with it and is placed on a sand-bath, the sand reaching to the same level outside as the carbonate inside. A thermometer is put in, which at the same time serves as a stirrer. The temperature is raised to 270° to 300° for about half an hour; the contents are then emptied hot into a stoppered weighing-bottle, which is kept in a desiccator up to the time of weighing. Then weigh off, for normal acid, four portions of about 2 g. each into the beakers in which the titration is to take place; for one-fifth normal acid the single portions ought not to exceed 0.4 g. The balance ought to turn to at least 0.5 mg.

As normal acid we prefer hydrochloric acid, which has the following advantages over sulphuric and oxalic acid, viz.:—1st, It is more generally applicable, e.g., for alkaline earths; 2nd, its strength, after being fixed by pure sodium carbonate, can be most accurately checked by silver nitrate, far more accurately than that of sulphuric acid by barium chloride; 3rd, it does not change

on keeping, like oxalic acid.

Normal HCl (36:47 g. HCl per litre) is prepared as follows:—Dilute pure hydrochloric acid to 1:020 specific gravity (4° Tw.). Such an acid will be rather too strong. Fill a burette with this acid, and titrate with it one of the weighed samples of sodium carbonate, the weight of which is w grams. Suppose that x c.c. of this acid are required. As the acid is sure to be too strong, x will always be smaller than $\frac{w}{0.053}$, and we shall have to add to

every x c.c. of the acid $\frac{w}{0.053}$ x c.c. of water, and if the total quantity of acid of specific gravity 1.020 amounts to V c.c., the amount of water to be added thereto to render it correct will be n c.c., where $n = V\left(\frac{w}{0.053 \, x} - 1\right)$. For one-fifth normal acid

the above factor would be $=\frac{w}{0.0106}$.

If accurate normal alkali is at hand, it may be similarly employed for examining the provisional acid, and then adjusting

it to the normal strength.

In any case, the mixed normal acid must be checked by titrating new samples of sodium carbonate, when x ought to $=\frac{w}{0.053}$. A further check is afforded by estimating the chlorine gravimetrically by silver nitrate; 10 c.c. (=0.3647 HCl) ought to yield

1.4334 g. AgCl.

The ordinary *indicator* in alkalimetry and acidimetry used to be tincture of litmus, which must be kept in open vessels, to avoid

its being spoiled. When employing litmus, the liquid to be tested must be kept boiling for some time, in order to expel all CO₂, and normal acid must be added as long as, on further boiling, the colour changes back from red to purple, or blue. This prolonged boiling causes some alkali to be dissolved from most kinds of glass, which makes the tests inaccurate. A test with litmus rarely lasts less than half an hour, usually more. Phenolphthalein has exactly the same drawbacks. Even the action of the carbon dioxide contained in the air, which comes into contact with the liquid on cooling, may cause trouble in very accurate On the other hand, a test is finished in a few minutes, if litmus is replaced by a very dilute solution of methyl orange (dimethylaminoazobenzene-sulphonic acid), but in this case the liquids must not be hot, but at the ordinary temperature, and only mineral acids, not oxalic acid, may be employed. The cold solution of sodium carbonate is coloured just perceptibly yellow by adding a drop or two of the solution of methyl orange, preferably by means of a pipette; if the colour is too intense, it will cause the transition into red on neutralisation to be less sharp. CO₂ does not act in the least upon methyl orange; a change of colour only takes place when all Na₂CO₃ has been decomposed. When the Na₂CO₃ has been exactly converted into NaCl, the colour turns from yellow to brownish, which is due to the action of free CO2 on the indicator. At this point the reading is made, preferably by means of a Göckel screen. Just one drop of acid is then added, when the colour ought now to become distinctly pink. If it remains brownish, another drop of acid is added, and so forth. Exactly the same course is followed in titrating acids with caustic soda solution; in this case also the reading is taken at the brownish transition colour, before the change to yellow has taken place. The results obtained in this way are identical with those obtained by the proper application of litmus or phenolphthalein, that is, working with these indicators under complete exclusion of air, with prolonged boiling, and in porcelain or silver vessels. The great advantage of methyl orange over the last-named indicators is the saving of time, the working at ordinary temperatures, and the possibility of employing glass vessels without any danger of error caused by the use of this material.

Another advantage of methyl orange is that it is not affected by sulphwretted hydrogen (which destroys litmus); hence it can be employed, e.g., for the direct titration of black-ash liquors. Sulphur dioxide acts upon it like the stronger mineral acids, but only to the extent of one-half of its equivalent; that is, the point of neutrality is reached when the compound NaHSO₃ has been formed. In the presence of nitrous acid methyl orange is gradually destroyed, but it is quite easy to employ it even in this case

by proceeding as described on p. 135.

The above description of the transition from yellow through

brownish to pink applies only to more accurate work, e.g., when employing fifth-normal acid and alkali. With normal or seminormal liquids this intermediate colour is hardly observed, the change passing directly from yellow to pink, and vice versa.

It is generally agreed that methyl orange is the best indicator for titrating bases by means of strong mineral acids, and this holds good also for the titration of the strong acids—sulphuric, hydrochloric, and nitric acid. In these cases, indeed, its advantage over litmus or phenolphthalein is even more marked, because a slight percentage of CO₂ in the standard alkali employed has no effect. But organic acids cannot be titrated with methyl orange.

Some authors have proposed, in lieu of methyl orange, the unsulphonated compound, dimethylaminoazobenzene, but this is only soluble in alcohol, and cannot be recommended. This is

also the case with ethyl orange.

To prepare standard alkali, dissolve about 50 g. of the best commercial caustic soda in 1 litre of pure water and titrate 50 c.c. of this solution with standard acid. More than 50 c.c. of acid will be required; we call this x c.c. The fraction $\frac{5000}{x}$ shows

the number of c.c. of the first solution, which must be diluted with pure water to 1 litre in order to obtain a really normal alkali. The solution thus prepared is again checked by titration with

normal acid.

The normal alkali, when intended to be used with litmus. should be as free as possible from carbonate, and should be protected against absorption of CO2 from the air, because otherwise the change of colour does not take place sufficiently rapidly, and markedly in cold solutions. A solution of sodium hydroxide entirely free from carbonate is difficult to prepare and to preserve when in constant use. When employing methyl orange as an indicator, an ordinary caustic soda solution may be employed without any special precautions. The caustic soda employed should not contain more than a very small proportion of alumina; ordinary strong caustic nearly always fulfils this condition, or it may even be replaced by a solution of 53 00 g. pure sodium carbonate in 1 litre water, which is employed cold, and which vields as accurate results as NaOH, no notice being taken of the CO2 which escapes with effervescence. The general use of this solution is, however, inconvenient on account of the efflorescence on the burettes, necks of bottles, etc. Weaker (e.g., fifth-normal, or even seminormal) solutions do not have this drawback.

All standard solutions must be prepared and employed as nearly as possible at a certain temperature. Mohr prescribes 15°; some prefer 18° C., as being more suitable for laboratories. When the solutions have stood for some time in bottles, a little water is evaporated and recondensed in the upper part of the bottles; the contents must then be properly mixed by shaking.

246 THE TECHNICAL CHEMISTS' HANDBOOK

If the temperature of the laboratory differs more than 2° or 3° from that employed for preparing the standard solutions, a correction should be made by means of the following table. In order to reduce the volumes read off at t° to 15° , deduct per 100 c.c. the following amounts:—

t°	C.C.	t°	c.c.
15	0	23	0.135
16	0.013	24	0.156
17	0.027	25	0.179
18	0.043	26	0.202
19	0.059	27	0.227
20	0.076	28	0.252
21	0.095	29	0.278
22	0.114	30	0.305

B.—Potassium Permanganate.

The ordinary solution is seminormal, i.e. it yields 0 004 g. oxygen per c.c. It serves, e.g., for estimating nitrous acid in sulphuric acid, for testing the nitrogen acids in the chamber exits, for testing manganese ore, for testing Weldon mud, etc.

Since iron only occurs in very small quantity in the products of alkali manufacture, it is best estimated by means of a tenth or twentieth normal solution made from the seminormal solution by dilution, and corresponding to 0 005584 or 0 002792 g. Fe per c.c.

respectively.

The solution is made by dissolving pure crystallised potassium permanganate, and is then quite stable, if protected from dust and direct sunlight. With perfectly pure KMnO₄, and with absolutely pure water, it would be necessary to dissolve 15 803 g. per litre. Since, however, there is no certainty of the absolute purity either of the salt or of the distilled water, we dissolve 16 g. of well-crystallised permanganate in 1 litre of distilled water, and allow to stand for a week before standardising it, so that the KMnO₄ may complete its action upon the impurities contained in the water. Only then is the titre of the solution checked as below, and eventually brought to exactly seminormal by adding a little water. Prepared in this manner, and protected against dust and direct sunlight, the solution keeps for any length of time.

None of the methods formerly employed for standardising permanganate (by means of metallic iron, or oxalic acid, or hydrogen peroxide, etc.), is entirely free from objections. No such objection exists to the employment of Kahlbaum's pure sodium oxalate, first proposed by Sörensen. This salt need only be kept for a few hours in a drying oven at 100°, and then allowed to cool in a desiccator over calcium chloride. Dissolve about 1°3 g. of this (exactly weighed) in about 200 c.c. water, heated to 60° to 70°, add dilute sulphuric acid, and run in the permanganate solution from a burette, first quickly, then drop by drop, until

a permanent red colour is produced. If a be the weight of sodium oxalate, b the c.c. of permanganate solution used, the fraction $\frac{29.851}{b} \frac{a}{b}$ gives the quantity of oxygen given off per c.c. of

the permanganate solution.

If a brown precipitate (of MnO₂) should be formed during the titration, the experiment must be rejected, but this occurs only when the solutions are too concentrated or too hot (i.e. above 70°).

Special rules for standardising permanganate solutions by means of sodium oxalate are given by Me. Bride in J. Soc. Chem.

Ind., 1913, p. 1131.

Permanganate is best employed in a burette with a lateral hollow glass-tap. Any change in its titre (due to dust, etc.) is perceptible by a deposition of MnO₂ in the bottle. It is advisable

to check the solution once every three months.

Permanganate can be used with perfect accuracy in the presence of free hydrochloric acid, if the solutions contain a considerable quantity of manganese salts; in other cases the same effect is produced by adding, say 1 g. of manganese sulphate free from iron.

C.—Iodine Solution.

Weigh exactly 12.692 g. of pure resublimed iodine (either bought as such, or prepared by grinding up commercial iodine with 10 per cent. of potassium iodide and resubliming) on a balance turning at least with 5 mg.; put it into a litre flask containing a concentrated solution of 15 to 18 g. KI, close the flask, agitate till the iodine is completely dissolved, and fill up to the mark. This decinormal solution is checked by the arsenite solution (p. 248). Both solutions ought to be precisely equivalent, c.c. per c.c.

For estimating very small quantities of sodium sulphide a special iodine solution is sometimes made, by dissolving 3.2515 g. of pure iodine with 5 g. of potassium iodide in a litre, to correspond

to 0.001 g. Na₂S per c.c.

Solutions of iodine, especially the more dilute ones, keep a long time in well-stoppered bottles in a cool place, but they ought

to be checked once a month by the arsenite solution.

Preparation of the starch solution.—Grind up 3 g. potato starch with a little water to a homogeneous paste; introduce this gradually into 300 g. of boiling water, contained in a porcelain dish, and continue the boiling till an almost clear liquid has been produced. Allow this to settle in a tall beaker, pour the clear portion through a filter, and saturate it with common salt. This solution, when kept in a cool place, is stable for some time; as soon as fungoid growths are noticed in it, it is thrown away.

A very convenient form of soluble starch is that made by Zulkowsky's method, by heating 100 parts of concentrated glycerine with 6 parts of starch to 190° C. for about an hour, pouring into water, precipitating the soluble starch by alcohol, and filtering. This starch is kept in the state of a thick paste, not to be allowed to dry, and a small quantity is taken out for each test by means of a glass rod. There are also other forms of soluble starch, e.g., "ozone-starch."

D .- Sodium Arsenite Solution.

This serves for standardising the iodine solution, and as its volumetrical complement, especially in testing bleaching powder. Employ commercial pure powdered arsenious acid; test its purity by subliming a little from a small dish into a watch-glass, when no yellow sublimate of As₂S₃ (which volatilises more easily than As₂O₃) should result initially; on heating more strongly it should leave no residue. Before use the powdered As₂O₃ is kept for some time over sulphuric acid in a desiccator, and can then be weighed out without any special precautions, since it is not hygroscopic. For preparing a decinormal solution, weigh out exactly 4948 g. As₂O₃, dissolwe it in a little hot solution of caustic soda, neutralise with dilute sulphuric acid (using phenolphthalein as indicator), add a solution of about 20 g. sodium bicarbonate in 500 c.c. water, and dilute on cooling to 1000 c.c. This solution is quite stable, and equivalent to 0.003546 g. chlorine or 0.012692 g.

iodiné per c.c.

If really pure and dry arsenious acid has been employed, the above solution will be correct at once. But when preparing large quantities, it ought to be checked by grinding up 0.5 g. iodine with 0.1 g. potassium iodide, heating this mixture in a small dish on a sand-bath or upon an asbestos board till abundant vapours arise, covering with a dry watch-glass, allowing the major portion, but not the whole, of the iodine to sublime into the watch-glass, covering this with a second watch-glass which fits air-tight upon the former, and has been weighed with it, and weighing. Slip the watch-glasses into a solution of 1 g. of potassium iodide (free from iodate), in 10 g. water, wait a little till the iodine is dissolved, dilute with 100 c.c. water, and titrate with the arsenite When the colour is only a light yellow, add a little starch solution, and titrate exactly till the blue colour has just vanished. The c.c. of arsenite solution used, multiplied by 0.012692, ought to correspond exactly with the weight of iodine taken. Or the dry, sublimed iodine is transferred directly from the upper watch-glass into a tared stoppered weighing-bottle, weighed, and dissolved in KI solution in the same bottle.

E.—Silver Solution.

Weigh out exactly 16'989 g. of pure crystallised silver nitrate, preferably kept in a desiccator for a few hours, and dissolve in 1 litre. This gives a decinormal solution, corresponding per c.c. to

0.003546 g. Cl, or 0.003647 g. HCl, or 0.005846 g. NaCl. By dissolving 2.906 g. AgNO₃ in 1 litre, a solution is obtained corre-

sponding to 0.001 g. NaCl per c.c.

Ammoniacal silver solution, for Lestelle's estimation of alkaline sulphides, is obtained by dissolving 13.818 g. of pure silver in pure nitric acid, adding 250 c.c. liquor ammoniæ, and diluting to 1 litre. Each c.c. of this corresponds to 0.005 g. Na₂S.

F.—Copper Solution.

Copper solution, for testing ferrocyanide, is obtained by dissolving 12:486 g. pure crystallised, not effloresced, cupric sulphate, in 1 litre water. (Cf. p. 170.)

G.—Oxalic Acid Solution.

Oxalic acid solution is employed for testing the "base" of Weldon mud, and caustic soda or lime in the presence of carbonate (pp. 157 and 158). Dissolve 63°03 g. pure, not effloresced, crystallised oxalic acid in 1 litre water, and check with normal alkali. This solution is not quite stable, especially when exposed to daylight; nor can it be employed for alkalimetry, when using methyl orange as an indicator.

XVIII. RULES FOR SAMPLING.

A.—Fuel.*

Take a shovelful of each wheelbarrow, basket, etc., throw it into a cask or tub closed by a lid, coarsely grind up the whole without delay, mix the contents, spread them out in a flat, square heap, divide this diagonally into four quadrants, remove two opposite quadrants, grind up the other two more finely and mix them again, and continue in this manner until the weight has been reduced to about \(\frac{1}{4}\) cwt. Put this into a tin box, which is soldered up and sent to the testing-laboratory. There this sample is ground again, mixed up, and divided into twelve or sixteen portions in the manner of a chess-board. Take out a teaspoonful from each of these portions and grind them in a porcelain mortar to a powder as fine as dust. This powder is kept in a stoppered bottle, and is well mixed up before taking out a fresh sample for testing.

For separate moisture tests, a number of samples are taken

during the first sampling, and kept in air-tight vessels.

B.—Ores and Minerals (Pyrites, Manganese, Salt, etc.)

(a) Smalls, slack, salt, or other substances not requiring to be crushed.—Take a sample of about 1 lb. of each weighing-tub, cart,

^{*} According to the rules laid down for the German Official tests of steam-boilers and steam-enginee.

or the like, by means of a scoop, so as to obtain about the same quantity each time. Of railway trucks, which are tipped directly into the warehouse, take three samples, one from the middle and one from each end.* All these single samples are put in a cask and kept covered, to prevent the evaporation of moisture. When the large sample is taken, empty the contents of the cask on a level, clean, and hard place, spread it flat, heap it up in a cone at the centre by going regularly round with a spade; spread this heap again flat, and take a sample of about a quarter of the mass, by taking out with a spade two strips crossing each other at right angles, and adding a little from the centre of each remaining quadrant. Treat this reduced sample exactly like the larger one, so that a third sample of about 5 lbs. is obtained. Mix this again thoroughly, and fill it into four (or more) wide-necked bottles of 4 ounces capacity, placed close together on a sheet of paper, so that a portion of each handful gets into each of the four bottles. When these are full, they are at once closed with tight-fitting corks; these are cut off straight above the necks of the bottles and well covered with sealing wax, putting on the seals of both buyer and seller, or any other party concerned. The mixing and filling must be done as quickly as possible, in order to prevent the evaporation, or, on the other hand, the absorption of appreciable quantities of moisture during the operation.

The above sample bottles are handed over to the laboratory chemist, who has to pulverise their contents till they pass completely through a sieve with holes 1 mm. ($=\frac{1}{\sqrt{5}}$ in.) wide; no coarse material must be left behind. From this, after thorough mixing, a smaller sample is taken and reduced to the degree of division necessary for analysis, by grinding in a steel or agate mortar, in the case of softer substances in a porcelain mortar. Manganese samples should not be treated in iron mortars. Moisture is estimated in an unground portion of the sample.

(b) Ores in pieces requiring to be crushed.—Large-sized samples must be taken if the lumps of the ore are very coarse. If the pieces are not above the size of an apple, and not too unequal, it is sufficient to take a sample from each tub, etc., as in (a), but with a shovel or scoop holding about 10 lbs. In the case of larger lumps, and of very unequal sizes, it is preferable to tip every tenth or twentieth tub or cart into a separate place, where the whole average sample is collected. In any case, the proportion between the large and small pieces must be represented as accurately as possible in the average sample. This is then crushed to the size of a walnut, either by hand or by machinery, leaving no larger lumps behind. The crushed material is thoroughly mixed by turning it over with a spade several times;

^{*} At some factories very unsatisfactory results have been obtained with this mode of sampling; they prefer that described later on (in b), viz., taking a certain number of entire tubs, barrows, or carts as sample.

it is then spread out in a flat heap and a smaller sample of about \$\frac{1}{4}\$ cwt. is taken, by lifting out two strips crossing each other at right angles, adding something from the centre of each remaining quadrant. The reduced sample is crushed further, either in a flarge metal mortar, or preferably with a sledge hammer on a flanged cast-iron plate about 3 ft. square, bedded on a solid foundation; the latter process is much more convenient and cleanly than grinding in a mortar. The coarse portions are sifted out by a riddle of \$\frac{1}{8}\$-in. holes and crushed again, till all has passed through. The product is reduced as in (a), by mixing, etc., to a quantity of 2 or 4 lbs., from which the sample bottles are filled as described above.

C.—Chemicals.

Saltcake, soda ash, etc., if in bulk, are sampled as in No. 1, (a). If packed in casks, each third, fifth, or tenth cask, according to the size of the parcel, is bored at one of its bottoms and sampled by means of an auger (Fig. 20), which is inserted up to the centre of



the cask, turning it round its axis all the while. The single cask samples are put into a large wide-mouthed bottle, as drawn, till the sampling is over. Then empty the whole on to a large sheet of paper, mix thoroughly, crush any lumps with a spatula, and fill the 4-ounce bottles, previously prepared, exactly as described in No. 1 as for ores, observing the simple rules for corking and sealing.

Bleaching powder, potash, and any other substances which are liable to be quickly spoilt in contact with the air by attracting moisture, or from other reasons, are treated like the foregoing substances, but operating with the greatest possible speed, and keeping the large bottles for collecting the cask samples well closed. The sampling is still more safely performed by taking away the upper end of the cask, removing the top layer to a depth of about 2 inches, taking a handful of the material from the interior as far as it is possible to reach in, which should be nearly at the centre of the cask, and placing it in the large bottles. In this way there is the least contact with air. Or else a sample-auger is employed, like that shown in Fig. 21, p. 252. It is made of a piece of gas-pipe of 13-inch bore, cut open for part of its length, so that a longitudinal slot of 1 inch width, a, is formed. One side of the slot is sharpened, as well as the tip b, which is driven into the bleaching powder, etc. The upper part of the pipe is left uncut, and is provided with a handle, c. Before introducing the auger the cask is well shaken up; then it is placed in an upright

252 THE TECHNICAL CHEMISTS' HANDBOOK

position and the auger is driven in as deeply as possible, in case of need by the aid of a hammer. This is done either after opening the cask, or by boring a hole in the end, which is afterwards closed by a piece of tin, with paper underneath. After driving in the auger, it is turned several times round its axis, so that it cuts through the bleaching powder with its sharp side and is thus filled up with it. The sample drawn out is put on paper, and is crushed on this as quickly as possible, preferably by means of a small hand-roller; it is then mixed and spread out flat. Small samples are finally taken from various parts by means of a spatula, as quickly as possible, and are put into bottles, which are tightly closed and kept in a dark place. Bleaching-powder samples should be always tested with as little delay as possible.



Fig. 21.

Caustic soda.—Since the samples attract moisture and carbonic acid on their surface, even in well-closed bottles, the outer opaque crust must be removed by scraping before weighing out the samples (cf. p. 198). It should be borne in mind that the centre of the drum is of weaker strength than the remainder, because the foreign salts accumulate in the portion which remains liquid the longest. The average strength is best represented by the portions next to the bottom and sides of the drum, which solidify quickest. This is most conveniently done while the contents are still in the liquid state. For the control of the manufacture itself it is best to take samples out of every pot during the time its contents are ladled out, from the top, the centre, and the bottom. These are poured out on to a metal plate, where they quickly solidify. The centre sample is the most important one for judging of the quality of each pot.

Solid sulphuric anhydride cannot be sampled directly for analysis. An auger cannot be employed, as the mass is too firm and tough; melting the mass in the drums themselves is out of the question, on account of the clouds of fumes. The following process is, therefore, employed:—A large sample of the solid anhydride is mixed with so much exactly analysed "monohydrated" sulphuric acid that an acid of about 70 per cent. is formed, which is liquid at ordinary temperatures. This mixture is made in a stoppered bottle, and is gently heated to 30° or 40° C., the stopper being loosely put in till the solution is complete, and a small sample then taken out by means of Lunge and Rey's

glass-tap pipette (p. 145).

COMPARISON OF HYDROMETER DEGREES 253

XIX. COMPARISON OF THE HYDROMETER DEGREES ACCORDING TO BAUMÉ AND TWADDELL, WITH THE SPECIFIC GRAVITIES.

В.	т.	Spec. Gravity.	В.	T.	Spec. Gravity.	В.	T.	Spec. Gravity.
0 0.7 1.0 1.4 2.0	0 1 1·4 2 2·8	1.000 1.005 1.007 1.010 1.014	15·4 16·0 16·5 17·0 17·1	24 25 26 26 8 27	1·120 1·125 1·130 1·134 1·135	29·3 29·7 30·0 30·2 30·6	51 52 52.6 53 54	1.255 1.260 1.263 1.265 1.270
2·1 2·7 3·0 3·4 4·0	3 4 4·4 5 5·8	1.015 1.020 1.022 1.025 1.029	17·7 18·0 18·3 18·8 19·0	28 28·4 29 30 30·4	1·140 1·142 1·145 1·150 1·152	31·0 31·1 31·5 32·0 32·4	54·8 55 56 57 58	1.274 1.275 1.280 1.285 1.290
4·1 4·7 5·0 5·4	6 7 7·4 8	1.030 1.035 1.037 1.040 1.045	19·3 19·8 20·0 20·3 20·9	31 32 32·4 33 34	1.155 1.160 1.162 1.165 1.170	32·8 33·0 33·3 33·7 34·0	59 59.4 60 61 61.6	1.295 1.297 1.300 1.305 1.308
6.7 7.0 7.4 8.0 8.7	10 10·2 11 12 13	1.050 1.052 1.055 1.060 1.065	21.0 21.4 22.0 22.5 23.0	34·2 35 36 37 38	1·171 1·175 1·180 1·185 1·190	34·2 34·6 35·0 35·4 35·8	62 63 64 65 66	1:310 1:315 1:320 1:325 1:330
9.0 9.4 10.0 10.6 11.0	13·4 14 15 16 16·6	1.067 1.070 1.075 1.080 1.083	23·5 24·0 24·5 25·0 25·5	39 40 41 42 43	1·195 1·200 1·205 1·210 1·215	36·0 36·2 36·6 37·0 37·4	66·4 67 68 69 70	1.332 1.335 1.340 1.345 1.350
11:2 11:9 12:0 12:4	17 18 18·2 19	1.085 1.090 1.091 1.095	26.0 26.4 26.9 27.0	44 45 46 46.2 47	1·220 1·225 1·230 1·231	37·8 38·0 38·2 38·6 39·0	71 71·4 72 73 74	1.355 1.357 1.360 1.365 1.370
13.6 14.0 14.2 14.9	20 21 21.6 22 23	1·100 1·105 1·108 1·110 1·115	27·4 27·9 28·0 28·4 28·8	48 48•2 49 50	1·235 1·240 1·241 1·245 1·250	39·4 39·8 40·0 40·1	75 76 76·6 77	1.375 1.380 1.383 1.385
14·9 15·0	23.2	1.116	29.0	50.4	1.252	40.5	78	1.390

N.B.—The Banmé degrees are calculated by the formula $d = \frac{144.3}{144.3 - n}$, water of 15° C.

being put=0° and eulphuric acid of 1.842 at 15° C.=66°. This is the Baumé's hydrometer, mostly used on the Continent of Europe, but other scales are in use there as well, and quite another scale for Baumé's hydrometer is used in America.

254 THE TECHNICAL CHEMISTS' HANDBOOK

COMPARISON OF THE HYDROMETER DEGREES ACCORDING TO BAUMÉ AND TWADDELL, WITH THE SPECIFIC GRAVITIES—Continued.

В.	т.	Spec. Gravity.	в.	т.	Spec. Gravity.	в.	T.	Spec. Gravity.
40.8	79	1·395	50.9	109	1.545	59·5	140	1.700
41.0	79·4	1·397	51.0	109·2	1.546	59·7	141	1.705
41.2	80	1·400	51.2	110	1.550	60·0	142	1.710
41.6	81	1·405	51.5	111	1.555	60·2	143	1.715
42·0	82 💊 1	1·410	51·8	112	1.560	60·4	144	1.720
42·3	83	1·415	52·0	112·6	1.563	60·6	145	1.725
42.7	84	1.420	52·1	113	1.565	60.9	146	1.730
43.0	84 •8	1.424	52·4	114	1.570	61.0	146·4	1.732
43.1	85	1.425	52·7	115	1.575	61.1	147	1.735
43.4	86	1.430	53·0	116	1.580	61.4	148	1.740
43·8	87	1:435	53·3	117	1.585	61.6	149	1.745
44·0	87·6	1:438	53·6	118	1.590	61.8	150	1.750
44·1	88	1:440	53·9	119	1.595	62.0	150 6	1.753
44·4	89	1:445	54·0	119·4	1.597	62.1	151	1.755
41·8	90	1:450	54·1	120	1.600	62.3	152	1.760
45.0	90.6	1.453	54·4	121	1:605	62.5	153	1.765
45.1	91	1.455	54·7	122	1:610	62.8	154	1.770
45.4	92	1.460	55·0	123	1:615	63.0	155	1.775
45.8	93	1.465	55·2	124	1:620	63.2	156	1.780
46.0	93.6	1.468	55·5	125	1:625	63.5	157	1.785
46·1	94	1.470	55.8	126	1.630	63·7	158	1.790
46·4	95	1.475	56.0	127	1.635	64·0	159	1.795
46·8	96	1.480	56.3	128	1.640	64·2	160	1.800
47·0	96 6	1.483	56.6	129	1.645	64·4	161	1.805
47·1	97	1.485	56.9	130	1.650	64·6	162	1.810
47.4	98	1·490	57·0	130.4	1.652	64.8	163	1.815
47.8	99	1·495	57·1	131	1.655	65.0	164	1.820
48.0	99•6	1·498	57·4	132	1.660	65.2	165	1.825
48.1	100	1·500	57·7	133	1.665	65.5	166	1.830
48.4	101	1·505	57·9	134	1.670	65.7	167	1.835
48.7 49.0 49.4 49.7 50.0	102 103 104 105 106	1.510 1.515 1.520 1.525 1.530	58.0 58.2 58.4 58.7 58.9	134 · 2 135 136 137 138	1.671 1.675 1.680 1.685 1.690	65.9 66.0 66.1 66.3 66.5	168 168 ·4 169 170	1.840 1.842 1.845 1.850 1.855
50·3	107	1.535	59·0	138·2	1:691	66·7	172	1.860
50·6	108	1.540	59·2	139	1:695	67·0	173	1.865

XX. VALUE OF ALKALI PER TON.

Price per unit.	1 per cent.	2 per cent.	8 per cent.	4 per cent.	5 per cent.
Pence.	£ s. d. 0 1 3 0 1 4 $\frac{1}{4}$ 0 1 $\frac{5}{2}$ 0 1 6 $\frac{3}{4}$	£ s. d. 0 2 6 0 2 8½ 0 2 11 0 3 1½	£ s. d. 0 3 9 0 4 0\frac{3}{4} 0 4 4\frac{1}{2} 0 4 8\frac{1}{4}	£ s. d. 0 5 0 0 5 5 0 5 10 0 6 3	£ s. d. 0 6 3 0 6 91 0 7 81 0 7 93
$egin{array}{c} 1 \\ 1_{\overline{16}} \\ 1_{\overline{8}} \\ 1_{\overline{16}} \end{array}$	$\begin{array}{cccc} 0 & 1 & 8 \\ 0 & 1 & 9\frac{1}{2} \\ 0 & 1 & 10\frac{1}{2} \\ 0 & 1 & 11\frac{3}{4} \end{array}$	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	$\begin{array}{cccc} 0 & 5 & 0 \\ 0 & 5 & 3\frac{3}{4} \\ 0 & 5 & 7\frac{1}{2} \\ 0 & 5 & 11\frac{1}{4} \end{array}$	0 6 8 0 7 1 0 7 6 0 7 11	$\begin{array}{c cccc} 0 & 8 & 4 \\ 0 & 8 & 10\frac{1}{4} \\ 0 & 9 & 4\frac{1}{2} \\ 0 & 9 & 10\frac{3}{4} \end{array}$
1½ 1½ 1½ 1¾ 1½ 1√c	$\begin{array}{ccccc} 0 & 2 & 1 \\ 0 & 2 & 2\frac{1}{4} \\ 0 & 2 & 3\frac{1}{2} \\ 0 & 2 & 4\frac{3}{4} \end{array}$	$\begin{array}{ccccc} 0 & 4 & 2 \\ 0 & 4 & 4\frac{1}{2} \\ 0 & 4 & 7 \\ 0 & 4 & 9\frac{1}{2} \end{array}$	$\begin{array}{ccccc} 0 & 6 & 3 \\ 0 & 6 & 6\frac{3}{4} \\ 0 & 6 & 10\frac{1}{2} \\ 0 & 7 & 2\frac{1}{4} \end{array}$	0 8 4 0 8 9 0 9 2 0 9 7	$\begin{array}{ccccc} 0 & 10 & 5 \\ 0 & 10 & 11\frac{1}{4} \\ 0 & 11 & 5\frac{1}{2} \\ 0 & 11 & 11\frac{3}{4} \end{array}$
$1\frac{1}{2}$ $1\frac{1}{76}$ $1\frac{5}{8}$ $1\frac{1}{16}$	$\begin{array}{ccccc} 0 & 2 & 6 \\ 0 & 2 & 7\frac{1}{4} \\ 0 & 2 & 8\frac{1}{2} \\ 0 & 2 & 9\frac{3}{4} \end{array}$	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	$\begin{array}{ccccc} 0 & 7 & 6 \\ 0 & 7 & 9\frac{3}{4} \\ 0 & 8 & 1\frac{1}{2} \\ 0 & 8 & 5\frac{1}{4} \end{array}$	0 10 0 0 10 5 0 10 10 0 11 3	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$
12 118 17 17 115	$\begin{array}{ccccc} 0 & 2 & 11 \\ 0 & 3 & 0\frac{1}{2} \\ 0 & 3 & 1\frac{1}{2} \\ 0 & 3 & 2\frac{3}{4} \end{array}$	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	0 11 8 0 12 1 0 12 6 0 12 11	$\begin{array}{c cccc} 0 & 14 & 7 \\ 0 & 15 & 1\frac{1}{4} \\ 0 & 15 & 7\frac{1}{2} \\ 0 & 16 & 1\frac{3}{4} \end{array}$
$2 \ 2_{16} \ 2_{8} \ 2_{16} \ 2_{16} \ $	0 3 4 0 3 54 0 3 61 0 3 73	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	0 13 4 0 13 9 0 14 2 0 14 7	$\begin{array}{cccc} 0 & 16 & 8 \\ 0 & 17 & 2\frac{1}{4} \\ 0 & 17 & 8\frac{1}{2} \\ 0 & 18 & 2\frac{3}{4} \end{array}$
$egin{array}{c} 2rac{1}{4} \ 2rac{1}{16} \ 2rac{3}{8} \ 2rac{7}{16} \ 2rac{1}{2} \end{array}$	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	$\begin{bmatrix} 0 & 7 & 6 \\ 0 & 7 & 8\frac{1}{2} \\ 0 & 7 & 11 \\ 0 & 8 & 1\frac{1}{2} \\ 0 & 8 & 4 \end{bmatrix}$	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	0 15 0 0 15 5 0 15 10 0 16 3 0 16 8	$\begin{array}{ccccc} 0 & 18 & 9 \\ 0 & 19 & 3\frac{1}{4} \\ 0 & 19 & 9\frac{1}{2} \\ 1 & 0 & 3\frac{3}{4} \\ 1 & 0 & 10 \\ \end{array}$

The sum gives the value per ton of 36 ,£3 13 9

256 THE TECHNICAL CHEMISTS' HANDBOOK

VALUE OF ALKALI PER TON-Continued.

Price per unit.	6 per cent.	7 per ceut.	8 per cent.	9 per cent.	10 per cent.
Pence.	£ s. d. 0 7 6 0 8 1½ 0 8 9 0 9 4½	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	£ s. d. 0 10 0 0 10 10 0 11 8 0 12 6	£ s. d. 0 11 3 0 12 2½ 0 13 1½ 0 14 0¾	$\begin{array}{cccccccccccccccccccccccccccccccccccc$
1 1 ₁ 1 ₈ 1 ₁ 1 ₇	$\begin{array}{cccc} 0 & 10 & 0 \\ 0 & 10 & 7\frac{1}{2} \\ 0 & 11 & 3 \\ 0 & 11 & 10\frac{1}{2} \end{array}$	$\begin{array}{cccc} 0 & 11 & 8 \\ 0 & 12 & 4\frac{3}{4} \\ 0 & 13 & 1\frac{1}{2} \\ 0 & 13 & 10\frac{1}{4} \end{array}$	0 13 4 0 14 2 0 15 0 0 15 10	$\begin{array}{cccc} 0 & 15 & 0 \\ 0 & 15 & 11\frac{1}{4} \\ 0 & 16 & 10\frac{1}{2} \\ 0 & 17 & 9\frac{3}{4} \end{array}$	$\begin{array}{cccc} 0 & 16 & 8 \\ 0 & 17 & 8\frac{1}{2} \\ 0 & 18 & 9 \\ 0 & 19 & 9\frac{1}{2} \end{array}$
1½ 1½ 1½ 1¾ 1√c	$\begin{array}{cccc} 0 & 12 & 6 \\ 0 & 13 & 1\frac{1}{2} \\ 0 & 13 & 9 \\ 0 & 14 & 4\frac{1}{2} \end{array}$	$\begin{array}{cccc} 0 & 14 & 7 \\ 0 & 15 & 3\frac{5}{4} \\ 0 & 16 & 0\frac{1}{2} \\ 0 & 16 & 9\frac{1}{4} \end{array}$	0 16 8 0 17 6 0 18 4 0 19 2	$\begin{array}{cccc} 0 & 18 & 9 \\ 0 & 19 & 8\frac{1}{2} \\ 1 & 0 & 7\frac{1}{2} \\ 1 & 1 & 6\frac{3}{4} \end{array}$	$\begin{array}{cccc} 1 & 0 & 10 \\ 1 & 1 & 10\frac{1}{2} \\ 1 & 2 & 11 \\ 1 & 3 & 11\frac{1}{2} \end{array}$
$1\frac{1}{2}$ $1\frac{9}{6}$ $1\frac{5}{8}$ $1\frac{1}{16}$	$\begin{array}{cccc} 0 & 15 & 0 \\ 0 & 15 & 7\frac{1}{2} \\ 0 & 16 & 3 \\ 0 & 16 & 10\frac{1}{2} \end{array}$	$\begin{array}{cccc} 0 & 17 & 6 \\ 0 & 18 & 2\frac{5}{4} \\ 0 & 18 & 11\frac{1}{2} \\ 0 & 19 & 8\frac{1}{4} \end{array}$	1 0 0 1 0 10 1 1 8 1 2 6	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	$\begin{array}{cccccccccccccccccccccccccccccccccccc$
134 1138 178 178	$\begin{array}{cccc} 0 & 17 & 6 \\ 0 & 18 & 1\frac{1}{2} \\ 0 & 18 & 9 \\ 0 & 19 & 4\frac{1}{2} \end{array}$	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	1 3 4 1 4 2 1 5 0 1 5 10	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	$\begin{array}{cccc} 1 & 9 & 2 \\ 1 & 10 & 2\frac{1}{2} \\ 1 & 11 & 3 \\ 1 & 12 & 3\frac{1}{2} \end{array}$
$egin{array}{c} 2 \\ 2\frac{1}{16} \\ 2\frac{1}{8} \\ 2\frac{3}{16} \end{array}$	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	1 6 8 1 7 6 1 8 4 1 9 2	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$
$egin{array}{c} 2rac{1}{4} \ 2rac{1}{16} \ 2rac{3}{8} \ 2rac{7}{16} \ 2rac{1}{2} \end{array}$	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	1 10 0 1 10 10 1 11 8 1 12 6 1 13 4	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	$\begin{array}{cccccccccccccccccccccccccccccccccccc$

The sum gives the value per ton of 36£3 18 9

VALUE OF ALKALI PER TON-Continued.

Price per unit.	20 per cent.	80 per cent.	40 per cent.	48 per cent.	50 per cent.
Pence. 34 15 16 7 8 15 16	£ s. d. 1 5 0 1 7. 1 1 9 2 1 11 3	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	£ s. d. 2 10 0 2 14 2 2 18 4 3 2 6	£ s. d. 3 0 0 3 5 0 3 10 0 3 15 0	£ s. d. 3 2 6 3 7 8½ 3 12 11 3 18 1½
$egin{array}{c} 1 \\ 1_{rac{1}{16}} \\ 1_{rac{3}{16}} \end{array}$	1 13 4 1 15 5 1 17 6 1 19 7	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	3 6 8 3 10 10 3 15 0 3 19 2	4 0 0 4 5 0 4 10 0 4 15 0	$\begin{array}{cccccccccccccccccccccccccccccccccccc$
$1\frac{1}{4}$ $1\frac{6}{18}$ $1\frac{3}{18}$	2 1 8 2 3 9 2 5 10 2 7 11	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	4 3 4 4 7 6 4 11 8 4 15 10	5 0 0 5 5 0 5 10 0 5 15 0	$\begin{array}{ccccc} 5 & 4 & 2 \\ 5 & 9 & 4\frac{1}{2} \\ 5 & 14 & 7 \\ 5 & 19 & 9\frac{1}{2} \end{array}$
$1\frac{1}{2}$ $1\frac{9}{16}$ $1\frac{5}{8}$ $1\frac{11}{16}$	2 10 0 2 12 1 2 14 2 2 16 3	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	5 0 0 5 4 2 5 8 4 5 12 6	6 0 0 6 5 0 6 10 0 6 15 0	$\begin{array}{cccccccccccccccccccccccccccccccccccc$
155 156 156 156	2 18 4 3 0 5 3 2 6 3 4 7	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	5 16 8 6 0 10 6 5 0 6 9 2	7 0 0 7 5 0 7 10 0 7 15 0	$\begin{array}{cccccccccccccccccccccccccccccccccccc$
$2 \\ 2\frac{1}{16} \\ 2\frac{1}{8} \\ 2\frac{3}{16}$	3 6 8 3 8 9 3 10 10 3 12 11	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	6 13 4 6 17 6 7 1 8 7 5 10	8 0 0 8 5 0 8 10 0 8 15 0	$\begin{array}{cccccccccccccccccccccccccccccccccccc$
$egin{array}{c} 2rac{1}{4} \ 2rac{1}{16} \ 2rac{3}{8} \ 2rac{1}{16} \ 2rac{1}{2} \end{array}$	3 15 0 3 17 1 3 19 2 4 1 3 4 3 4	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	7 10 0 7 14 2 7 18 4 8 2 6 8 6 8	9 0 0 9 5 0 9 10 0 9 15 0 10 0 0	$\begin{array}{cccccccccccccccccccccccccccccccccccc$

The snm gives the value per ton of 36 ,,£3 18 9

258 THE TECHNICAL CHEMISTS' HANDBOOK

VALUE OF ALKALI PER TON-Continued.

Price per unit.	52 per cent.	54 per cent.	56 per cent.	57 per cent.	58 per cent.
Pence.	£ s. d. 3 5 0 3 10 5 3 15 10 4 1 3	£ s. d. 3 7 6 3 13 1½ 3 18 9 4 4 4½	£ s. d. 3 10 0 3 15 10 4 1 8 4 7 6	£ s. d. 3 11 3 3 17 2½ 4 3 1½ 4 9 0¾	£ s. d. 3 12 6 3 18 6½ 4 4 7 4 10 7½
$1\\ 1_{\frac{1}{16}}\\ 1_{\frac{1}{8}}\\ 1_{\frac{3}{16}}$	4 6 8 4 12 1 4 17 6 5 2 11	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	4 13 4 4 19 2 5 5 0 5 10 10	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	$\begin{array}{cccccccccccccccccccccccccccccccccccc$
$1\frac{1}{4}$ $1\frac{5}{1^{5}\epsilon}$ $1\frac{3}{8}$ $1\frac{7}{1^{7}\epsilon}$	5 8 4 5 13 9 5 19 2 6 4 7	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	5 16 8 6 2 6 6 8 4 6 14 2	5 18 9 6 4 8½ 6 10 7½ 6 16 6¾	$\begin{array}{cccccccccccccccccccccccccccccccccccc$
1½ 1½ 1½ 1½ 1½	6 10 0 6 15 5 7 0 10 7 6 3	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	7 0 0 7 5 10 7 11 8 7 17 6	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	$\begin{array}{cccccccccccccccccccccccccccccccccccc$
14 148 18 18 18	$egin{array}{cccccccccccccccccccccccccccccccccccc$	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	8 3 4 8 9 2 8 15 0 9 0 10	8 6 3 8 12 2 1 8 18 1 1 9 4 0 2	$\begin{array}{cccccccccccccccccccccccccccccccccccc$
$2 \\ 2^{1}_{16} \\ 2^{1}_{8} \\ 2^{3}_{16}$	8 13 4 8 18 9 9 4 2 9 9 7	$\begin{array}{cccccccccccccccccccccccccccccccccccc$	9 6 8 9 12 6 9 18 4 10 4 2	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	$\begin{array}{cccccccccccccccccccccccccccccccccccc$
2½ 2½ 2½ 2½ 2½ 2½	9 15 0 10 0 5 10 5 10 10 11 3 10 16 8	$\begin{bmatrix} 10 & 2 & 6 \\ 10 & 8 & 1\frac{1}{2} \\ 10 & 13 & 9 \\ 10 & 19 & 4\frac{1}{2} \\ 11 & 5 & 0 \end{bmatrix}$	10 10 0 10 15 10 11 1 8 11 7 6 11 13 4	$ \begin{array}{cccccccccccccccccccccccccccccccccccc$	$\begin{array}{cccccccccccccccccccccccccccccccccccc$

The sum gives the value per ton of 86 ,£3 18 9

INDEX

ACETYLENE, 228	Arsanic, astimation in sulphuric acid,
Acid, free, in fertilisers, 232	144
in sulphate of alumina, 237	in hydrochloric acid, 154
atandard, praparation of, 243	Arsenita of sods, standard solution, 248
Acids in chambers, 117	Ash of fual, 93
Air compression, 59	of mixing coal, 164
currenta, spead of, 99	Atomic weights, 3
tablas of, 100	Auger for sampling, 251
Alkali available in black-ash, 167	Available sods. Sea Alkali
in tank wasta, 168	
in aoda ash, 178	Base of Weldon mud, 157
total, in tank wasta, 169	Baumé's hydromater, 253
fras, in blaach liquors, 194	Bauxita, 234
standard, preparation of, 245	Beet ashes, 207
valua per ton, 255	Balgian mathod for estimating zinc in
Alkalimetrical dagrasa, 179	blanda, 112
table of, 180	Black-ash, 166
Alumina, commercial, 237	Bleach liquora, 164
preparations, 234	Blaaching powdar, 159
aulphata of, 235	tabla of percentages, 160
in fertilisers, 232	sampling, 251
Aluminate of sods, 237	Bleaching powder chambers, tests hefore
Ammonis manufacturs, 217	opaning them, 161
volatila, 217	Blanda, 112
total, 217, 219	cinders from, 114
solutions, apecific gravities of, 221	Boiling points of various substances, 33
carbonate, apacific gravities of solu-	of water at various pressures, 57
tions, 222	Bottoms, cauatic, 192
sulphata, 219	Brimatone, anelysis, 106
Ammoniacal brine, 185	Bunta buratta, 223
Ammonia-soda process, 185	Burner gases, 115
Anemometar, Fletchar's, 99	Burnt pyritas, 111
tables for, 100	
Sagar'a, 102	CALCIUM CARBIDE, 228
Aquaons vapour, tension at various tem-	Calorific power of fual, 95
paraturas, 52, 53	of coal-gas, 227
Araa of circlas, atc., tabla of, 63	Carbon, fixed, in fuel, 98
Arsenic, estimation in brimstons, 106	Carbon dioxida. Sea Carbonatas

in Deacon gasss 162

Carbon dioxide in electrolytic chlorin	
	complete analysis, 238
in carbonated soda liquor, 171 by Lunge and Rittener's method, 1	Coal, 98 71 mixing, for Leblanc process, 164
in coal-gas, 224	gas, 222
monoxide, 224	Coinage of different countries, \$8
Carbonated soda liquor, 171	Coke, 93
Carbonates in pyrites, 111	Compounds, symbols, molecular weights,
in quicklime, 150	percentage composition, 4
in manganese ore, 155	Compression of air, 59
in bleaching powder or bleach liquo	rs, Copper, astimation in pyrites, 109
160	in burnt pyritas, 112
in canatic aoda, 193	solutions, standard, 249
Caruallite, 205	Cubic centimetras in gas-volumetric
Cauatic hottoms, 192	analyses, calculation to milligrams of
liquor, 186	the substance required, 15
specific gravitiea, 187	Cyanogeu in spent oxide, 227
soda, manufacture, 189	Dry con process 169
in black-ash, 167	Deacon process, 162 Decomposing flask, 219
commercial, 193	Degrees, alkalimetrical, table, 179
sampling, 252	Density of gases and vapours, 14
Cement, Portland, 288, 240	Dranght, testing spead of, 99
Cementa, other, 241	
Centigrade degrees, comparison with Fa	Ah: Electrical units, 62
renheit, 27, 28, 29	Electro-chemical equivalents, 62
Chamber gasea, 116	Electrolytic chlorine, 163
Chance process, 180	alkali liquora, 193
Chancel's sulphurimeter, 108	English weights and measures, reduction
Chemicals, sampling of, 251	to metrical, 83
Chimney gases, 95	Eachka's method for estimating sulphur,
from chemical works (Act of Parl	
ment), 149	Expansion, linear, of aubstances, 26
China clay, 234	Explosive mixtures of gases and air, 60
Chlorates estimation 164	FACTORS FOR GRAVIMETRIC ANALYSES, 12
Chlorates, estimation, 164 by Fresenius's mathod, 194	Factors for reducing volumes of gases to
by Ditz and Knöpfelmacher, 194	normal tamperature and pressure, 48
Chloride, estimation in common salt,	
in saltcake, 148	Centigrade, 27, 28, 29
of potassium, 164	Feed-water for steam-boilers, 104
Chlorine, estimation in salt, 148	Ferchland's estimation of carbon dioxide,
Chlorine, free, in hydrochloric acid, 18	
in the atmosphere of chambers before	
opening them, 161	Ferrocyanide in tank liquor, 170
available in bleaching powder, 159	Fertilisers, 229
comparison with French degrees,	
in Deacon gases, 162	moisture, 229
electrolytic, 163	estimation of phosphoric acid, 230
liquid, pressure and specific graviti	
165	ferric oxide and alumina, 232
Cinders from pyrites, 111	nitrngen, 233
from blende, 114	Fire gasea, 95
Circumferences, table of, 68	Fished salts in caustic soda manufacture,
Claus kilns, gases of, 184	192

Fletcher's anemometer, 99	Hypochlorites, 159
Freezing mixtures, 32	Hypochlorous acid, free, 193
points, 30	
Fuel, 93	Indicators, 243
calorific power of, 95	International atomic weights, 3
sampling, 249	Iodine in nitrate of soda, 196
Furnaces, 95	in nitric acid, 203
	solution, standard, 247
Gas-burettes, 222	Iron in burnt pyrites, 112
Gases, deneity of, 14	in sulphuric acid, 143
solubility in water, 18	in sulphate of soda, 143
reduction of volume to 0° C., 36	in hydrochloric acid, 154
to a pressure of 760 mm., 42	in sulphats of alumina, 236
to 0° C. or 32° F., 48	17
factors for the same, 48	KAINITE, 205
Gaees, liquefied, properties, 61	Kaoliu, 284
See Fire gases, Burner gases, Chimney	Kjeldahl-Jodlbauer's method for estimat-
gae, Chamber gases, etc.	ing nitrogen, 233
in sulphur recovery (Claus kilns), 184	True is south a 110
Gas-liquor, 217	LEAD, in pyritee, 110
Gas-producers (generators), 97	in blende, 114
Gas-volumeter, Lunge's, 139	in sulphuric acid, 143
with decomposing flask, 219	chambers. See Chambers
Gas-volumetric analysis, calculation, 15	Leblanc process, 166
Gay-Lussac's degrees of bleaching powder,	raw materials, 166
160	black-ash, 166
Glass-tap pipette, 145	tank waste, 169
Gravimetric analysis, factors for, 12	liquor, 170
Gravity, epecific, of gases, 14	carbonated liquor, 171
of solide, 22	mother liquor, 173
of liquide, 25	sulphur recovery, 182
of estursted solutions, 25	Le Chatelier's pyrometer, 103 Lime, estimation in blende, 114
II 10/	in salt, 147
HARDNESS OF WATER, temporary, 104	in emitcake, 148
total, 105	in limestone, 157
reagente for removing, 105	caustic, 158
Hargreavee' process, 151	quick, 158
Heats, specific, 57	slaked, 158
Heating effects, 58 High temperatures, 35	milk of, 158
Hydraulic lime, 241	specific gravities of milk of, 159
Hydrocarbons in coal-gas, 224	in black-ash, 166
Hydrochloric acid in chimney gases, 149	hydraulic, 241
specific gravities, 162	Lime-kiln gases, 183
influence of temperature on, 153	Lime mud in caustic soda manufacture,
analysis, 153	192
estimation of HCl, 153	Limestone, 157, 238
of impurities, 154	Linear expansion of substances, 26
estimation of scid required for decom-	Liquefied gasss, properties, 61
poeing manganese ore, 156	Liquor ammoniæ, 220
standard, 243	Litmus, 244
Hydrogen in coal-gae, 225	Litre weights of gaees, 14
sulphide, 184	Lunge's formula for testing the work of
Hydrometer degrees, comparison of, 253	furnaces, 97
- · · · · · · · · · · · · · · · · · · ·	

Lunge-Orsat apparatus, 198 Lunge's nitrometer, 187 gas-volnmeter, 189, 219	Nitrogen, organic, 233 Nitrometer, Lunge's, 137, 195 Nitrous acid, estimation for, in sulphuric
reagent for nitrous acid, 143	acid, 185
glass-tap pipette, 145 Lunge and Rittener's method for estimat-	Nitrons acid, detection of very small quantitiee, 143
ing carbon dioxide, 171	in commércial nitric acid, 203, 204
and Kéler's method for estimating	Nordhansan oil of vitriol, specific gravi-
small quantities of iron, 236	ties, 130
and Millberg's separation of quartz	at different temperatures, 131
from silicates, 239	fnsing points, 138
MAGNESIUM SALTS IN POTASSIUM CHLOR-	percentage of SO_3 in, 134 analysis, 144
ine, 206	Normal acid and alkali, etc. See Stand-
Manganese ore, natural, 155	ard
sampling, 249	
dloxide, estimation, 165, 156	OIL OF VITRIOL. See Nordhausen oil of
mud, recovered, 156	vitriol
Manures. See Fertilisere	Ores, sampling of, 249
Mathematical tables, 63	Orset apparatue, 95
Measures and weights of different coun-	Orsat-Lunge apparatus, 98
tries, 79	Oxalic acid, standard solution, 249
Melting points, 30 Mensuration of sreas and solid contents, 77	Oxygen in chamber gases, 117
Metale, sheets, weight of, 87	in coal-gas, 224
Methane in coal-gas, 226	
Methyl orange, 244	Palladium tune, 225
Metrical weights and measures, reduction	Percentage composition of compounds, 4
to Euglish, 83	Perchlorates, 197
Minerale, eampling of, 249	Permanganate solution, standard, 246
Mixing-coal, 166	Phosphates, 230
Molecular weights of compounds, 4	Phosphoric scid, coluble, 230, 231 total, 230, 231
Molyhdenum method for phosphates, 231	Portland cement, 238
Mother liquor of Leblanc sods, 173 Muriatic acid. See Hydrochloric acid	raw materials, 238
maranto sold. Sold Hydrochiolio sold	working conditions, 240
NITRATE OF SODA, 195	commercial, 240
Nitra-cake, 197	Potach in fertilisers, 234
Nitric scid, manufacture of, 195	chlorate of, 164
specific gravities, 198	Potassium, estimation, 205
influence of temperature, 201	carbonate, commercial, 207
titration, 203	epecific gravities of solutions, 209
impurities, 203	influence of temperature, 212 chloride, 205, 207
mixtures with sulphuric acid, 204 oxide, 119	ealts, 205
Nitrogen, in coal-gas, 226	sulphate, 207
acids, estimation in chamber gases,	hydroxide, apacifio gravities, 214
116	nitrate in commercial nitrate of aoda
in sulphuric acid, 135	197
relative proportions of, 142	perchlorate, 197
qualitative test for, 142	permanganate, standard solution, 246
in fertilisers, 283	Pressure of gasse, reduction to normal, 40
nitric-, 283	of water, reduction to mercurial pres
total, 283	sure, 51

Producar gas, 97	Solubility of gases in water, 18
Purifying material of gas-works, 227	of salts at 0° and 100°, 16
water, reagants for, 107	at various temperatures, 17
Puzznolanas, 241	Solutions of salts, specific gravity, 25
Pyritas, 108	Specific gravities, of solids, 22
burnt, 111	of gases, 14
burner gasas, 115	of liquids, 25
sampling, 249	of saturated solutions, 25
Pyrometar, La Chatelier's, 103	comparison of hydrometers, 253
Wanner's, 104	heata, 57
indications of, 35	Spant oxide of gas-works, 108, 227
3.7.7.7.7.7.7.7.7.7.7.7.7.7.7.7.7.7.7.7	Standard solutions, general, 241
QUARTZ IN CEMENT, 239	comparison of English and Franch
Quality in outside it, and	systems, 241
Reich's test for burner gases, 115	
Rock-salt, 146	influence of temperature on, 246 acid, 242
Roman cemant, 289	alkali, 246
Toman comany, 200	
Salt, common and rock-, 146	permanganate, 246 iodine, 247
sampling, 249	
Salteake, 147	sodium arsenite, 248
Salts, fished, in caustic-soda manufac-	silver, 248
ture, 192	copper, 249
	oxalic acid, 249
Salts, aclubility of, 16, 17	Starch solution, 247
Sampling, rulas for, 249	Steam-boilers, faad-water, 104
auger, 251	Storage weights of substances, 24
Segar's anomometer, 102	Sulphata of soda, 147
Selenium, in brimstone, 108	Sulphide of sodium, 168, 178
in sulphuric acid, 148	Sulphur, in fuel, 94
Sheet metals, weight, 87	in mixing coal, 166
Silica in cament, 289	in brimatone, 107
Silver solution, etandard, 248	in pyrites, 108
Slaga, 241	in burnt pyritas, 111
Soda, availabla. Sea Alkali	in blanda, 112
ash, commercial, 178	in cindara from blenda, 114
manufacture by Lablanc process,	in tank waste, 169, 182
166	in gas-liquor, 217
raw materials for, 166	in apent oxide, 227
by ammonia process, 185	specific gravities of solutions of, in
caustic, manufactura, 186. See Sodium	carbon disulphida, 107
hydroxide and Standard alkali	acids of, in chambar gases, 116
Sodium arsanite, standard solution, 248	compounds, in soda liquors, 173
astimation in caustic sods, 193	dioxide iu chamber gages, 115
carbonate solutions, apacific gravities	in hydrochloric acid, 154
of, at 15°, 174; at 30°, 175	recovery from tank waste, 182
influence of temparature, 176	Sulphur compounds, various, in Lablanc
pure, for standardising, 243	liquors, 173
hydroxide, 168	Sulphuric acid, ordinary, quantitative
specific gravities, 187	examination of free acid, 135
influence of temperature, 190	examination for nitrous acid, 186
Sodium nitrate, 195	for total nitrogen acids, 137
ealta in commercial potassium ohlorida,	relative proportions of, 142
206	qualitative test for nitrogen acids,
silicate, 179	142

INDEX

tures, 51

Sulphnric acid, other impurities, 148 manufacture, raw materials, 106 gases, 115

Sulphuric scid, specific gravities at 60° F., 121

reduction to other temperatures, 126 freezing and melting points, 132 boiling points, 132

fusing points of, and of Nordhausen oil of vitriol, 133

mixtures with nitric acid, 204 fuming. See Nordhausen oil oi vitriol

anhydride, analysis, 144 sampling, 252

Sulphurimeter, Chancel's, 108 Symbols of compounds, 4

TANK LIQUOR, 169 waste, 168, 182

Temperature, reduction of gases to normal, 36

Temperaturee, high, measured by pyrometer, 35

measurement of, 102

Tension of squeoue vapour at various temperatures, 52, 58, 55

Thermometers, conversion of Centigrade into Fahrenheit degrees above 100°, and vice versa, 29

Thermometric scales, comparison, Centigrade degrees as units, 27 Fahrenheit degrees as unite, 28 above 100°, 29

Thiocyanate, 218

Thomas-slag phosphates, 231

Titanic acid, 235 Traes, 241 Twaddell's hydrometer, 253

Varours, density of, 14
Vat liquor, 170
waste, 169
Vitriol chambers. See Chambers.
Volume of gases, reduction to normal
temperatures and pressure, 36
Volumes of water at different tempera-

Wanner's Pyrometer, 104
Water, hardness, temporary, 104
total, 105
pressure, reduction to mercurial pressure, 51
volumes at different temperatures, 51
vapours, tension of, 52, 58, 55
boiling points at various pressures, 57

boiling points at various pressures, 57 reagents for purifying, 105
Weight of eheet metals, 87
of substances as stored, 24
Weights and measures of different countries, 87
reducing English to metrical, and vice versa, 88

ZING IN PYRITES, 110
in blende, 112
in sulphate of alumina, 237
blende, 112
cinders from, 114
solution, 227

Weldon mud and liquors, 156

